



Level



Pressure



Flow



Temperature



Liquid
Analysis



Registration



Systems
Components



Services




Solutions

Operating Instructions

Proline t-mass A 150

HART

Thermal Mass Flow Measuring System

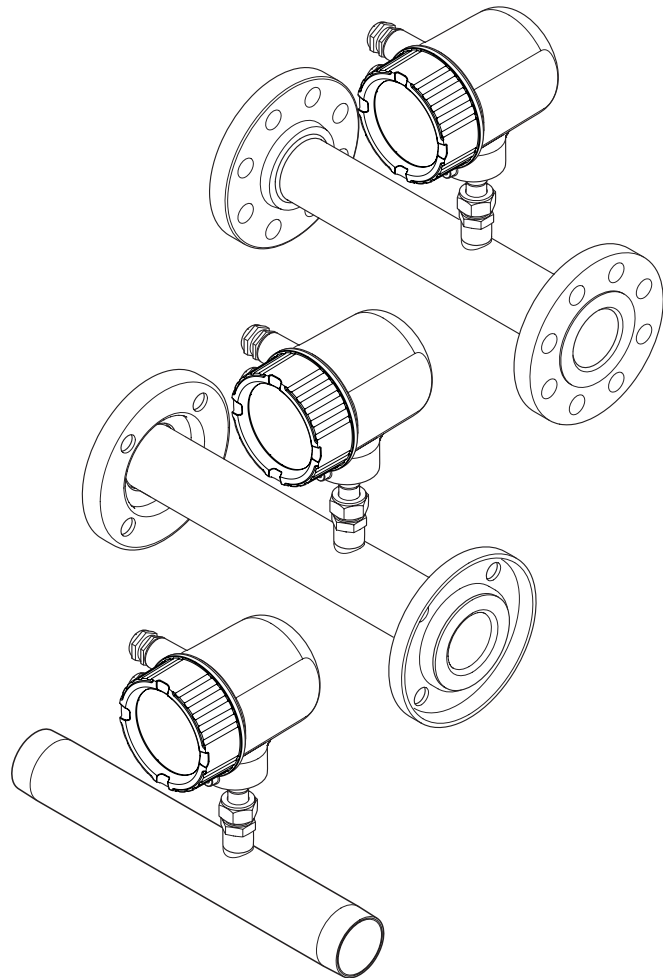

- Make sure the document is stored in a safe place such that it is always available when working on or with the device.
- To avoid danger to individuals or the facility, read the "Basic safety instructions" section carefully, as well as all other safety instructions in the document that are specific to working procedures.
- The manufacturer reserves the right to modify technical data without prior notice. Your Endress +Hauser Sales Center will supply you with current information and updates to these Instructions.

Table of contents

1	Document information	5	7	Electrical connection	22
1.1	Document function	5	7.1	Connection conditions	22
1.2	Document conventions	5	7.1.1	Required tools	22
1.2.1	Safety symbols	5	7.1.2	Requirements for connecting cable	22
1.2.2	Electrical symbols	5	7.1.3	Requirements for the supply unit	22
1.2.3	Tool symbols	5	7.1.4	Terminal assignment	22
1.2.4	Symbols for certain types of information	6	7.1.5	Preparing the measuring device	23
1.2.5	Symbols in graphics	6	7.2	Connecting the measuring device	23
1.3	Documentation	7	7.2.1	Connecting the cables	24
1.3.1	Standard documentation	7	7.3	Ensuring the degree of protection	24
1.3.2	Supplementary device-dependent documentation	7	7.4	Post-connection check	25
2	Basic safety instructions	8	8	Operation options	26
2.1	Requirements for the personnel	8	8.1	Overview of operation options	26
2.2	Designated use	8	8.2	Structure and function of the operating menu	26
2.3	Workplace safety	9	8.2.1	Structure of the operating menu	26
2.4	Operational safety	9	8.2.2	Operating philosophy	28
2.5	Product safety	9	8.3	Access to the operating menu via the local display	29
3	Product description	10	8.3.1	Operational display	29
3.1	Product design	10	8.3.2	Navigation view	31
3.2	Registered trademarks	10	8.3.3	Editing view	33
4	Incoming acceptance and product identification	11	8.3.4	Operating elements	34
4.1	Incoming acceptance	11	8.3.5	Opening the context menu	35
4.2	Product identification	12	8.3.6	Navigating and selecting from list	37
4.2.1	Transmitter nameplate	12	8.3.7	Calling the parameter directly	37
4.2.2	Sensor nameplate	13	8.3.8	Calling up help text	38
5	Storage and transport	14	8.3.9	Changing the parameters	39
5.1	Storage conditions	14	8.3.10	User roles and related access authorization	40
5.2	Transporting the product	14	8.3.11	Disabling write protection via access code	40
5.3	Packaging disposal	14	8.3.12	Enabling and disabling the keypad lock	40
6	Installation	15	8.4	Access to the operating menu via the operating tool	42
6.1	Installation conditions	15	8.4.1	Field Xpert SFX100	42
6.1.1	Mounting position	15	8.4.2	FieldCare	42
6.1.2	Requirements from environment and process	19	8.4.3	AMS Device Manager	42
6.2	Mounting the measuring device	19	8.4.4	SIMATIC PDM	43
6.2.1	Required tools	19	8.4.5	Field Communicator 475	43
6.2.2	Preparing the measuring device	20	8.4.6	Connecting operating tools	43
6.2.3	Mounting the measuring device	20	9	System integration	45
6.2.4	Turning the transmitter housing	20	9.1	Overview of device description files	45
6.2.5	Turning the display module	21	9.1.1	Current version data for the device	45
6.3	Post-mounting check	21	9.1.2	Operating tools	45
			9.2	Measured variables via HART protocol	45
			9.3	Other settings	46
			10	Commissioning	47
			10.1	Function check	47
			10.2	Switching on the measuring device	47
			10.3	Setting the operating language	47

10.4	Configuring the measuring device	48	13	Repair	90
10.4.1	Selecting the gas type	48	13.1	General notes	90
10.4.2	Specifying the process pressure	49	13.2	Spare parts	90
10.4.3	Determining the installation factor	49	13.3	Endress+Hauser services	90
10.4.4	Configuring the current output	50	14	Maintenance	91
10.4.5	Configuring the pulse/frequency/switch output	50	14.1	Maintenance tasks	91
10.5	Advanced settings	52	14.1.1	Exterior cleaning	91
10.5.1	Defining the tag name	53	14.1.2	Interior cleaning	91
10.5.2	Configuring applications	53	14.2	Measuring and test equipment	91
10.5.3	Setting the system units	54	14.3	Endress+Hauser services	91
10.5.4	Configuring the current output	56	15	Return	92
10.5.5	Configuring the PFS output	59	16	Disposal	93
10.5.6	Configuring the output conditioning	64	16.1	Removing the measuring device	93
10.5.7	Configuring the low flow cut off	65	16.2	Disposing of the measuring device	93
10.5.8	Configuring the totalizer	66	17	Technical data	94
10.5.9	Configuring the local display	66	17.1	Application	94
10.6	Configuration management	68	17.2	Function and system design	94
10.7	Simulation	69	17.3	Characteristic values	94
10.8	Protecting settings from unauthorized access	70	17.4	Output	95
10.8.1	Write protection via access code	71	17.5	Power supply	98
10.8.2	Write protection via write protection switch	71	17.6	Performance characteristics	100
11	Operation	74	17.7	Installation	102
11.1	Adjusting the operating language	74	17.8	Environment	102
11.2	Configuring the display	74	17.9	Process	102
11.2.1	Navigation path	74	17.10	Mechanical construction	103
11.2.2	Parameter overview with brief description	74	17.11	Operability	105
11.3	Reading measured values	74	17.12	Certificates and approvals	107
11.3.1	Process variables	74	17.13	Accessories	108
11.3.2	Totalizer	75	17.14	Documentation	108
11.3.3	Output values	76	18	Appendix	109
11.4	Adapting the measuring device to the process conditions	77	18.1	Overview of the Operator/Maintenance operating menu	109
11.5	Performing a totalizer reset	77	Index	127	
11.6	Showing data logging	78			
12	Diagnostics and troubleshooting	79			
12.1	General troubleshooting	79			
12.2	Diagnostic information on local display	81			
12.2.1	Diagnostic message	81			
12.2.2	Calling up remedial measures	83			
12.3	Diagnostic information in the operating tool	83			
12.4	Adapting the diagnostic information	84			
12.4.1	Adapting the diagnostic behavior	84			
12.5	Overview of diagnostic information	85			
12.6	Resetting the measuring device	87			
12.7	Diagnostics list	87			
12.8	Event logbook	87			
12.8.1	Event history	87			
12.8.2	Filtering the event logbook	88			
12.8.3	Overview of information events	88			





1 Document information

1.1 Document function



 


These Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

1.2 Document conventions



1.2.1 Safety symbols


 

Symbol	Meaning
 A0011189-EN	DANGER! This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.
 A0011190-EN	WARNING! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.
 A0011191-EN	CAUTION! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.
 A0011192-EN	NOTICE! This symbol contains information on procedures and other facts which do not result in personal injury.

1.2.2 Electrical symbols











Symbol	Meaning
 A0011197	Direct current A terminal to which DC voltage is applied or through which direct current flows.
 A0011198	Alternating current A terminal to which alternating voltage (sine-wave) is applied or through which alternating current flows.
 A0011200	Ground connection A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system.
 A0011199	Protective ground connection A terminal which must be connected to ground prior to establishing any other connections.
 A0011201	Equipotential connection A connection that has to be connected to the plant grounding system: This may be a potential equalization line or a star grounding system depending on national or company codes of practice.

1.2.3 Tool symbols





Symbol	Meaning
 A0013442	Torx screwdriver
 A0011220	Flat blade screwdriver

Symbol	Meaning
 A0011219	Phillips head screwdriver
 A0011221	Allen key
 A0011222	Hexagon wrench

1.2.4 Symbols for certain types of information

Symbol	Meaning
 A0011182	Allowed Indicates procedures, processes or actions that are allowed.
 A0011183	Preferred Indicates procedures, processes or actions that are preferred.
 A0011184	Forbidden Indicates procedures, processes or actions that are forbidden.
 A0011193	Tip Indicates additional information.
 A0011194	Reference to documentation Refers to the corresponding device documentation.
 A0011195	Reference to page Refers to the corresponding page number.
 A0011196	Reference to graphic Refers to the corresponding graphic number and page number.
	Series of steps
	Result of a sequence of actions
 A0013562	Help in the event of a problem

1.2.5 Symbols in graphics

Symbol	Meaning
1, 2, 3,...	Item numbers
	Series of steps
A, B, C, ...	Views
A-A, B-B, C-C, ...	Sections
 A0013441	Flow direction
 A0011187	Hazardous area Indicates a hazardous area.
 A0011188	Safe area (non-hazardous area) Indicates a non-hazardous location.

1.3 Documentation

1.3.1 Standard documentation

Document type	Purpose and content of the document
Technical Information	Planning aid for your device The document contains all the technical data on the device and provides an overview of the accessories and other products that can be ordered for the device.
Brief Operating Instructions	Guide that takes you quickly to the 1st measured value The Brief Operating Instructions contain all the essential information from incoming acceptance to initial commissioning.



The document types listed are available:

- On the CD-ROM supplied with the device
- In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download

1.3.2 Supplementary device-dependent documentation

If the device is being used in a hazardous location or in accordance with the Pressure Equipment Directive: Instructions in the relevant supplementary documentation must be consistently observed. The supplementary documentation is an integral part of the device documentation.

Document type	Device particularities and document content
Safety Instructions	Operation in hazardous areas The document contains all the necessary information for the safe operation of the device in hazardous areas, and explains how the device can be identified as an Ex system from the device nameplate.
Information on the Pressure Equipment Directive	Operation in accordance with the Pressure Equipment Directive The document contains all the necessary information for the safe operation of the device when used in accordance with the Pressure Equipment Directive, and explains how the device can be identified as pressure equipment from the device nameplate.
Installation Instructions	Ordered accessory The Installation Instructions contain all the information needed to install the ordered accessory or spare part.



The document types listed are available:

- On the CD-ROM supplied with the device
- In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download

2 Basic safety instructions

2.1 Requirements for the personnel

The personnel for installation, commissioning, diagnostics and maintenance must fulfill the following requirements:

- ▶ Trained, qualified specialists must have a relevant qualification for this specific function and task
- ▶ Are authorized by the plant owner/operator
- ▶ Are familiar with federal/national regulations
- ▶ Before beginning work, the specialist staff must have read and understood the instructions in the Operating Instructions and supplementary documentation as well as in the certificates (depending on the application)
- ▶ Following instructions and basic conditions

The operating personnel must fulfill the following requirements:

- ▶ Being instructed and authorized according to the requirements of the task by the facility's owner-operator
- ▶ Following the instructions in these Operating Instructions

2.2 Designated use

Application and media

The measuring device described in these Instructions is intended only for flow measurement of gases.

To ensure that the measuring device remains in proper condition for the operation time:

- ▶ Only use the measuring device in full compliance with the data on the nameplate and the general conditions listed in the Operating Instructions and supplementary documentation.
- ▶ Based on the nameplate, check whether the ordered device is permitted for the intended use in the hazardous area (e.g. explosion protection, pressure vessel safety).
- ▶ Use the measuring device only for media against which the process-wetted materials are adequately resistant.

Incorrect use

The manufacturer is not liable for damage caused by improper or non-designated use.

If the sensor gland is opened, the accuracy specifications of the measuring device no longer apply. In such situations, the measuring device must be removed and returned for recalibration and to the manufacturer.

⚠ WARNING

Risk of injury if the process connection and sensor gland are opened under pressure.

- ▶ The process connection should only be opened in an unpressurized state.

NOTICE

Dust and moisture can enter the transmitter when the transmitter housing is opened.

- ▶ Only open the transmitter housing briefly, ensuring that no dust or moisture enters the housing.

NOTICE

The accuracy specifications no longer apply if the sensor is opened.

- ▶ If the sensor gland is opened, the accuracy specifications of the measuring device no longer apply. In such situations, the measuring device must be removed and returned for recalibration to the manufacturer.

NOTICE**Danger of breakage of the sensor due to corrosive or abrasive fluids!**

- ▶ Verify the compatibility of the process fluid with the sensor material.
- ▶ Ensure the resistance of all fluid-wetted materials in the process.
- ▶ Observe the specified maximum process pressure.

Verification for borderline cases:

- ▶ For special fluids and fluids for cleaning, Endress+Hauser is glad to provide assistance in verifying the corrosion resistance of fluid-wetted materials, but does not accept any warranty or liability.

Residual risks

The external surface temperature of the housing can increase by max. 15 K due to the power consumption of the electronic components. Hot process fluids passing through the measuring device will further increase the surface temperature of the housing. The surface of the sensor, in particular, can reach temperatures which are close to the fluid temperature.

Possible burn hazard due to fluid temperatures!

- ▶ For elevated fluid temperature, ensure protection against contact to prevent burns.

2.3 Workplace safety

For work on and with the device:

- ▶ Wear the required personal protective equipment according to federal/national regulations.

For welding work on the piping:

- ▶ Do not ground the welding unit via the measuring device.

2.4 Operational safety

Risk of injury.

- ▶ Operate the device in proper technical condition and fail-safe condition only.
- ▶ The operator is responsible for interference-free operation of the device.

Conversions to the device

Unauthorized modifications to the device are not permitted and can lead to unforeseeable dangers.

- ▶ If, despite this, modifications are required, consult with Endress+Hauser.

Repair

To ensure continued operational safety and reliability,

- ▶ Carry out repairs on the device only if they are expressly permitted.
- ▶ Observe federal/national regulations pertaining to repair of an electrical device.
- ▶ Use original spare parts and accessories from Endress+Hauser only.


2.5 Product safety

This measuring device is designed in accordance with good engineering practice to meet state-of-the-art safety requirements, has been tested, and left the factory in a condition in which they are safe to operate.

It meets general safety standards and legal requirements. It also complies with the EC directives listed in the device-specific EC Declaration of Conformity. Endress+Hauser confirms this by affixing the CE mark to the device.

3 Product description

3.1 Product design

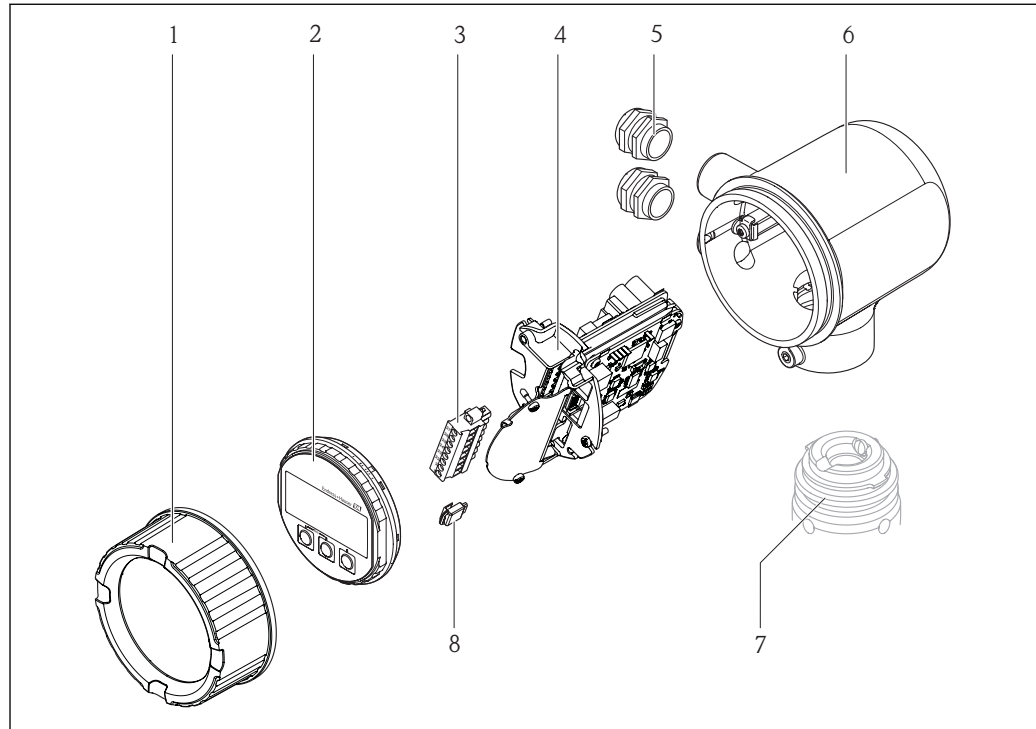

A0017196

- 1 Electronics compartment cover
- 2 Display module
- 3 Terminal block
- 4 Electronics module
- 5 Cable gland
- 6 Transmitter housing
- 7 Sensor
- 8 S-DAT

3.2 Registered trademarks

HART®


Registered trademark of the HART Communication Foundation, Austin, USA

Applicator®, FieldCare®, Field Xpert™, HistoROM®

Registered or registration-pending trademarks of the Endress+Hauser Group


4 Incoming acceptance and product identification

4.1 Incoming acceptance

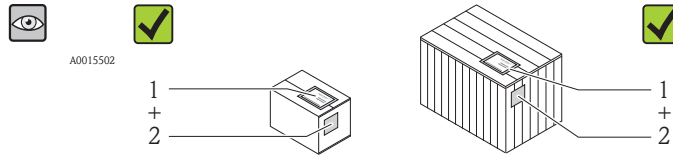


A0013843

Is the order code on the delivery note (1) identical to the order code on the product sticker (2)?

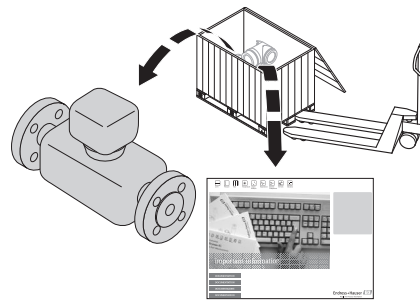


A0013695

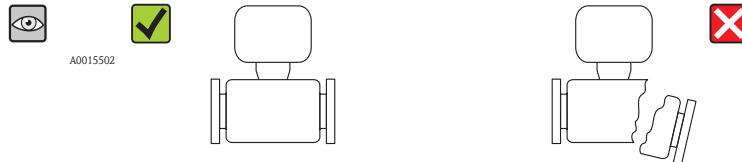


A0013698

Are the goods undamaged?

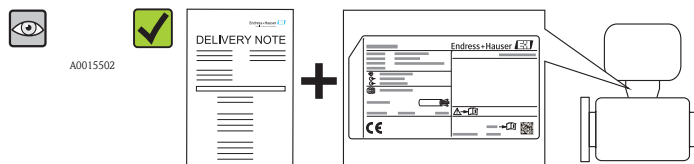


A0013699

Do the nameplate data match the ordering information on the delivery note?

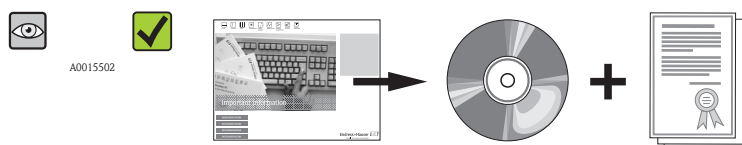

A0013697

Is the CD-ROM with the Technical Documentation and documents present?

 

 If one of the conditions does not comply, contact your Endress+Hauser distributor.

4.2 Product identification


The following options are available for identification of the measuring device:


- Nameplate specifications
- Order code with breakdown of the device features on the delivery note
- Enter serial numbers from nameplates in *W@M Device Viewer* (www.endress.com/deviceviewer): All information about the measuring device is displayed.


For an overview of the scope of the Technical Documentation provided, refer to the following:

- The chapters "Additional standard documentation on the device" (→  7) and "Supplementary device-dependent documentation" (→  7)
- The *W@M Device Viewer*: Enter the serial number from the nameplate (www.endress.com/deviceviewer)


4.2.1 Transmitter nameplate

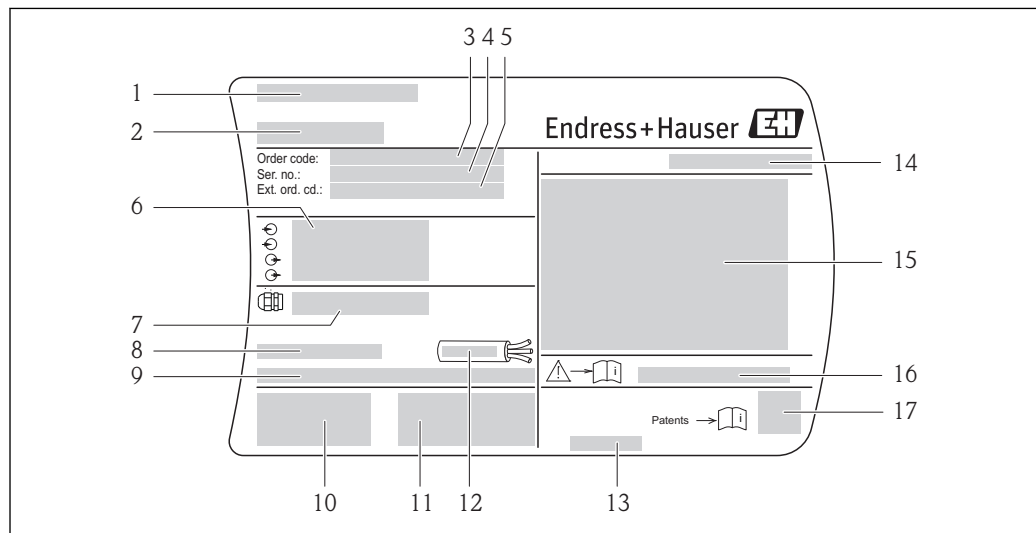

 1 Example of a transmitter nameplate

 - 1 Manufacturing location
- 2 Name of the transmitter
- 3 Order code
- 4 Serial number (Ser. no.)
- 5 Extended order code (Ext. ord. cd.)
- 6 Electrical connection data, e.g. available inputs and outputs, supply voltage
- 7 Type of cable glands
- 8 Permitted ambient temperature (T_a)
- 9 Firmware version (FW) and device revision (Dev.Rev.) from the factory
- 10 CE mark, C-Tick
- 11 Additional information on version: certificates, approvals
- 12 Permitted temperature range for cable
- 13 Manufacturing date: year-month
- 14 Degree of protection
- 15 Approval information for explosion protection
- 16 Document number of safety-related supplementary documentation (→  7)
- 17 2-D matrix code

4.2.2 Sensor nameplate

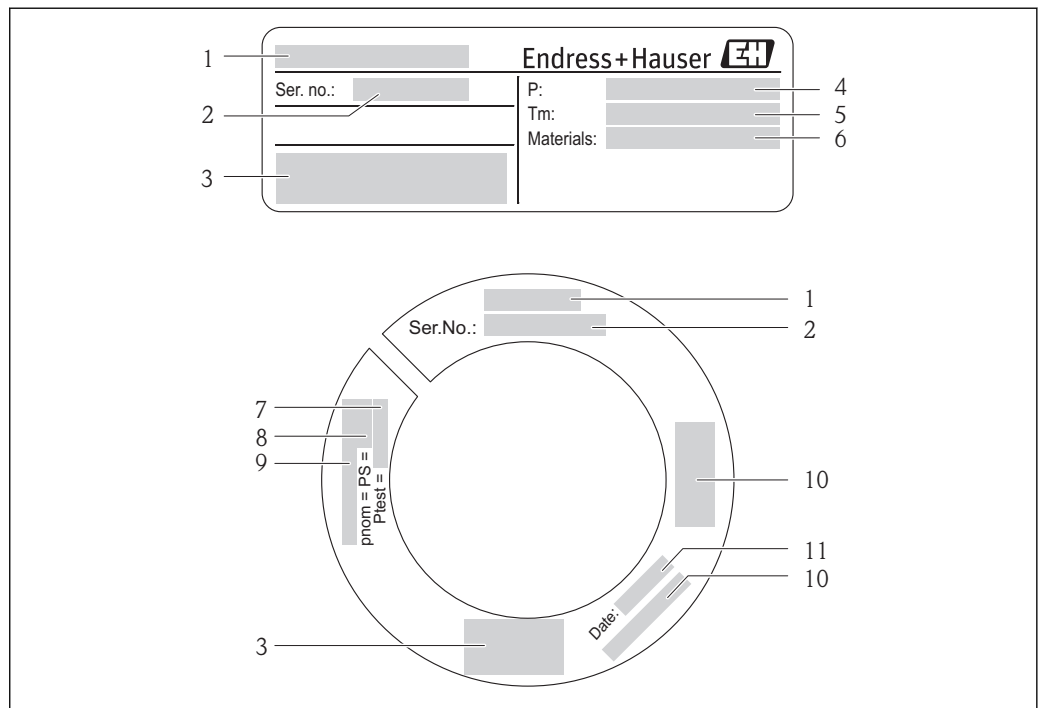

A0017232

2 Example of 1st sensor nameplate

- 1 Name of the sensor
- 2 Serial number (Ser. no.)
- 3 CE mark, C-Tick
- 4 Process temperature range
- 5 Medium temperature range
- 6 Material of measuring tube, manifold and seal
- 7 Test pressure of the sensor
- 8 Nominal pressure of the sensor
- 9 Flange nominal diameter/nominal pressure
- 10 Approval information for Pressure Equipment Directive
- 11 Manufacturing date: year-month

Order code

The measuring device is reordered using the order code.


Extended order code

- The device type (product root) and basic specifications (mandatory features) are always listed.
- Of the optional specifications (optional features), only the safety and approval-related specifications are listed (e.g. LA). If other optional specifications have also been ordered, they are indicated collectively by the placeholder symbol "#" (e.g. #LA#).
- If the ordered optional specifications do not include any safety and approval-related specifications, they are indicated by the + placeholder symbol (e.g. XXXXXX-ABCDE+).

5 Storage and transport

5.1 Storage conditions

Observe the following notes for storage:

- Store in the original packaging to ensure protection from shock.
- Do not remove protective covers or protective caps installed on process connections. They prevent mechanical damage to the sealing surfaces and contamination in the measuring tube.
- Protect from direct sunlight to avoid unacceptably high surface temperatures.
- Select a storage location where moisture cannot collect in the measuring device as fungus and bacteria infestation can damage the lining.
- Store in a dry and dust-free place.
- Do not store outdoors.
- Storage temperature(→  19)

5.2 Transporting the product

WARNING

Center of gravity of the measuring device is higher than the suspension points of the webbing slings.

Risk of injury if the measuring device slips.

- ▶ Webbing slings are usually not required. However if they are used, make sure that the center of gravity of the measuring device is higher than the suspension points of the webbing slings.

Observe the following notes during transport:

- Transport the measuring device to the measuring point in the original packaging.
- Lifting gear
 - Webbing slings: Do not use chains, as they could damage the housing.
 - For wood crates, the floor structure enables these to be loaded lengthwise or broadside using a forklift.
- Do not lift the measuring device by the transmitter housing.
- Do not remove protective covers or protective caps installed on process connections. They prevent mechanical damage to the sealing surfaces and contamination in the measuring tube.

5.3 Packaging disposal

All packaging materials are environmentally friendly and 100% recyclable:

- Measuring device secondary packaging: polymer stretch film that conforms to EC Directive 2002/95/EC (RoHS).
- Packaging:
 - Wood crate, treated in accordance with ISPM 15 standard, which is confirmed by the affixed IPPC logo.
 - or
 - Carton in accordance with European Packaging Directive 94/62EC; recyclability is confirmed by the affixed RESY symbol.
- Seaworthy packaging (optional): Wood crate, treated in accordance with ISPM 15 standard, which is confirmed by the affixed IPPC logo.
- Carrying and mounting hardware:
 - Disposable plastic pallet
 - Plastic straps
 - Plastic adhesive strips
- Dunnage: Paper cushion

6 Installation

6.1 Installation conditions

No special measures such as supports are necessary. External forces are absorbed by the construction of the device.

6.1.1 Mounting position

 
 
 

Mounting location

Thermal measuring devices require a fully developed flow profile as a prerequisite for correct flow measurement. For this reason, please pay attention to the following points and document sections when installing the device:

- Avoid flow disturbances, as the thermal measuring principle reacts sensitively to them.
- Take measures to avoid condensation (e.g. condensation trap, thermal insulation etc.).

Orientation

The direction of the arrow on the sensor helps you to install the sensor according to the flow direction (direction of medium flow through the piping).

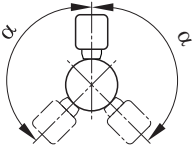Vertical orientation	 A0017337	✓✓ ¹⁾
Horizontal orientation, transmitter head up	 A0015589	✓✓
Horizontal orientation, transmitter head down	 A0015590	✓✓ ²⁾
Inclined mounting position, transmitter head down	 A0015773	✓ ³⁾


- 1) In the case of saturated or unclean gases, upward flow in a vertical pipe section is preferred to minimize condensation or contamination.
- 2) Suitable only for clean and dry gases. If buildup or condensate are always present: Mount the sensor in an inclined position.
- 3) Select inclined mounting position ($\alpha = \text{approx. } 135^\circ$) if the gas is very wet or saturated with water.

Requirement for pipework

The measuring device must be professionally installed, and the following points must be observed:

- Piping must be professionally welded.
- Seals must be sized correctly.
- Flanges and seals must be correctly aligned.
- The internal pipe diameter on the inlet side must match the internal diameter of the process connection ordered. The maximum permitted deviation between the internal diameters is: 1 mm (0.04 in)
- Following installation, the pipe must be free from dirt and particles in order to avoid damage to the sensors.

Further information → ISO standard 14511

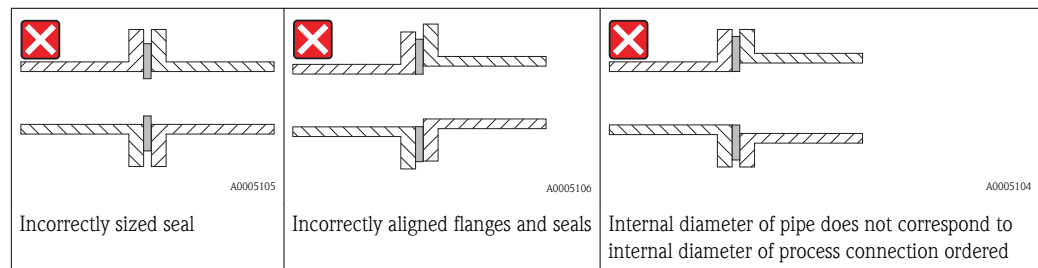


Inlet and outlet runs

The thermal measuring principle is sensitive to disturbed flow conditions.

- As a general rule, the measuring device should always be installed as far away as possible from any flow disturbances. For further information, please refer to → ISO 14511.
- If possible, the sensor should be installed upstream from valves, T-pieces, elbows etc. To attain the specified level of accuracy of the measuring device, the below mentioned inlet and outlet runs must be maintained at minimum. If there are several flow disturbances present, the longest specified inlet run must be maintained.

Recommended inlet and outlet runs (without flow conditioner)

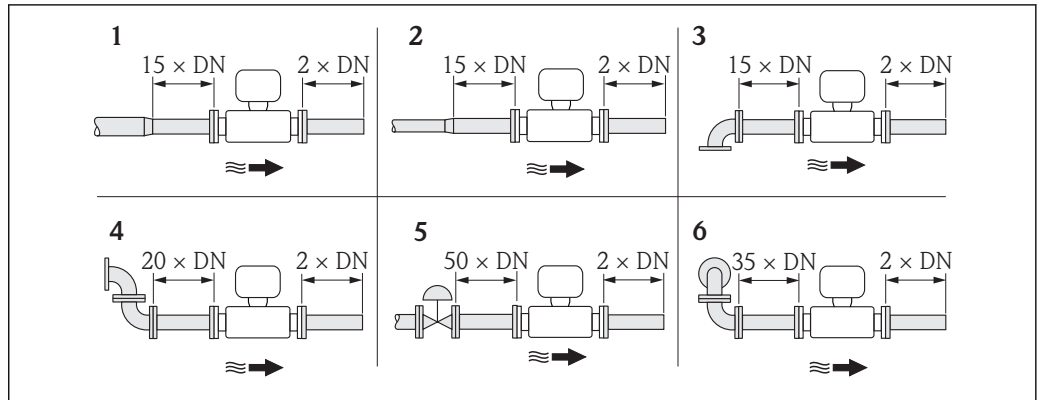

A0016942


- 1 reduction
- 2 expansion
- 3 90° elbow or T-piece
- 4 2 × 90° elbow
- 5 Control valve
- 6 2 × 90° elbow (3-dimensional)

Installation dimensions

For the dimensions and installation lengths of the device, see the "Technical Information" document, "Mechanical construction" section

Outlet run for pressure or temperature transmitter

If a pressure or temperature measuring device is installed downstream of the measuring device, make sure there is sufficient distance between the two devices.

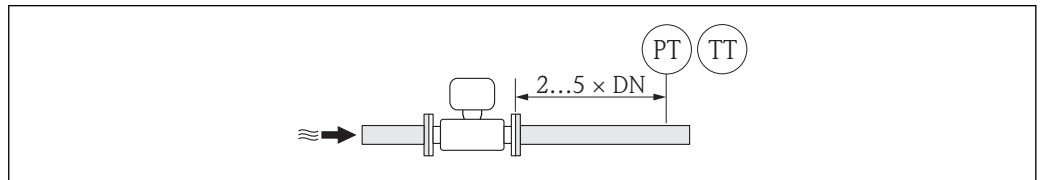


A0015548

- PT Pressure measuring device
- TT Temperature measuring device

Flow conditioner (19 hole) for use with fixed flanges

If the inlet runs cannot be observed, the use of a flow conditioner is recommended.

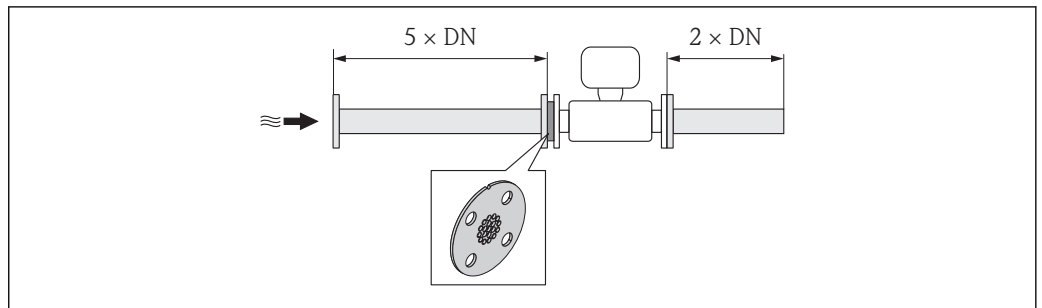


A0015547

3 Recommended inlet and outlet runs when using a flow conditioner

This is a special Endress+Hauser design which was developed for the sensor t-mass A 150 (DN 40 to 50 / 1 ½ to 2"). The arrangement of the individual screw holes and their diameter means that the flow conditioner can be used for different flange pressure ratings.

The flow conditioner and the seals are installed between the pipe flange and the measuring system. To ensure correct centering of the flow conditioner, use only standard screws which match the screw holes .

Please note that the flow conditioner must be mounted in such a way that the alignment notch is pointing in the direction of the transmitter. Incorrect installation could have a negative effect on the measurement accuracy.

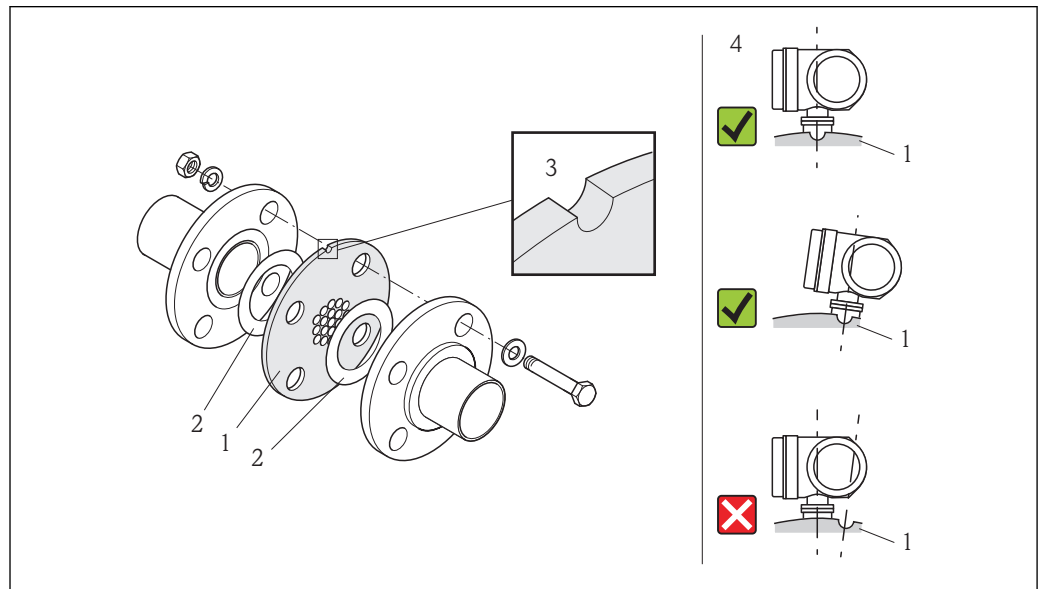

A0005116

- 1 Flow conditioner
 2 Seal
 3 Alignment notch
 4 Correctly align the alignment notch and transmitter.

- i** ■ Not suitable for lap joint flange or threaded versions!
- Order the sensor and the flow conditioner together to ensure that they are calibrated together. Joint calibration guarantees optimum performance. Ordering the flow conditioner separately and using it with the device will further increase measurement uncertainty.
- The use of flow conditioners from other suppliers will affect the flow profile and pressure drop and will have an adverse effect on performance.
- Screws, nuts, seals etc. are not included in the scope of supply and must be provided by the customer.

Pressure loss

The pressure loss for flow conditioners is calculated as follows:

$\Delta p = K \cdot \frac{\dot{m}^2}{\rho} \cdot \frac{1}{D^4}$		A0005243
Δp = Pressure loss [mbar] ρ = Density [kg/m ³] K = Constant 1876 (SI units) or 8.4 · 10 ⁻⁷ (US units)	\dot{m} = Mass flow [kg/h] D = Diameter [mm]	

Calculation example

- $\dot{m} = 412 \text{ kg/h}$
- $\rho = 8.33 \text{ kg/m}^3$ at 7 bar abs. and 20 °C (68 °F)
- $D = 42.8 \text{ mm}$ for DN 40, PN 40

Calculation in SI units

$$\Delta p = 1\,876 \cdot (412^2 \div 8.33) \cdot (1 \div 42.8^4) = 11.4 \text{ mbar}$$

6.1.2 Requirements from environment and process**Ambient temperature range**

Measuring device	-40 to +60 °C (-40 to +140 °F)
Local display	-20 to +60 °C (-4 to +140 °F), the readability of the display may be impaired at temperatures outside the temperature range.

- ▶ If operating outdoors:
Avoid direct sunlight, particularly in warm climatic regions.

System pressure**Sensor**


Depending on the version, please note the details on the name plate .
Max. 40 bar g (580 psi g)

Thermal insulation

If the gas is very humid or saturated with water, the pipe and the sensor housing should be insulated to prevent water droplets condensing on the transducer.

NOTICE**Electronics overheating on account of thermal insulation!**

- ▶ Observe maximum permitted insulation height of the transmitter neck so that the transmitter head is completely free.

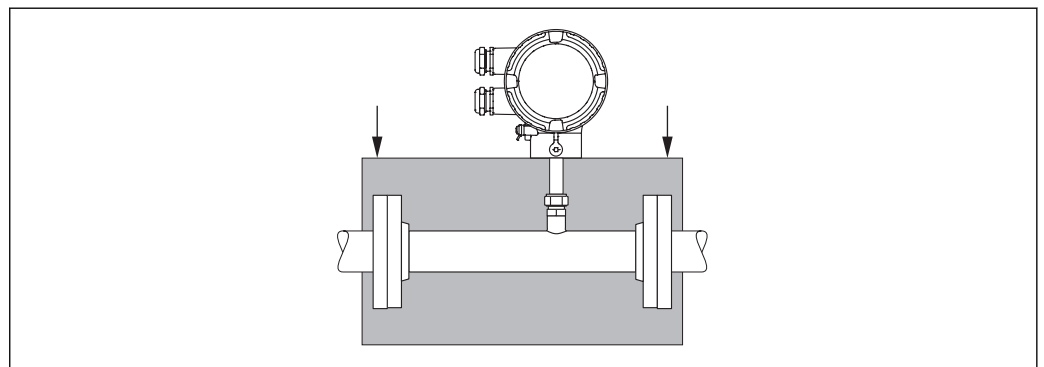

A0015521

6.2 Mounting the measuring device**6.2.1 Required tools****For transmitter**

For turning the transmitter housing (in increments of 90°): Allen screw 4 mm (0.15 in)

For sensor

For flanges and other process connections: Corresponding mounting tools


6.2.2 Preparing the measuring device

1. Remove all remaining transport packaging.
2. Remove any protective covers or protective caps present from the sensor.
3. Remove stick-on label on the electronics compartment cover.

6.2.3 Mounting the measuring device**⚠ WARNING****Danger due to improper process sealing!**

- ▶ Ensure that the inside diameters of the gaskets are greater than or equal to that of the measuring tube and piping.
- ▶ Ensure that the gaskets are clean and undamaged.
- ▶ In the case of lap joint flanges the transmitter housing can rotate about the pipe axis if the flanges are not tightened.
- ▶ Install the gaskets correctly.


1. Ensure that the direction of the arrow on the sensor matches the flow direction of the medium.
2. Install the measuring device or turn the transmitter housing so that the cable entries do not point upwards.

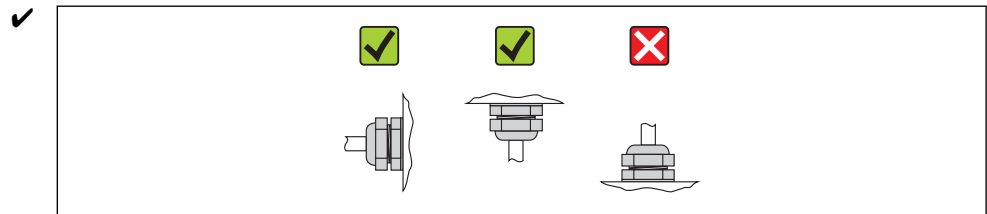

A0013964

6.2.4 Turning the transmitter housing

To provide easier access to the connection compartment or display module, the transmitter housing can be turned clockwise or counterclockwise to 4 indexed positions by a maximum of 2 x 90°:

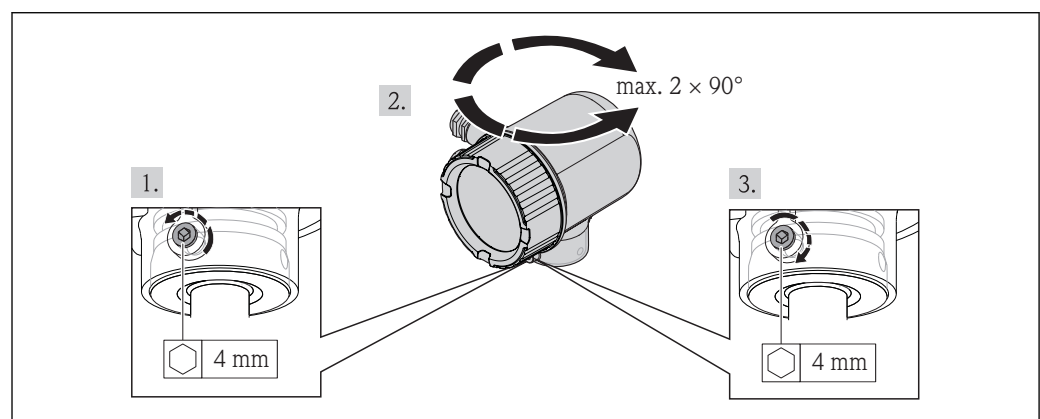


A0017227

1. Unscrew the securing screw using an Allen key.
2. Rotate the housing in the desired direction.

3. Firmly tighten the securing screw.

6.2.5 Turning the display module

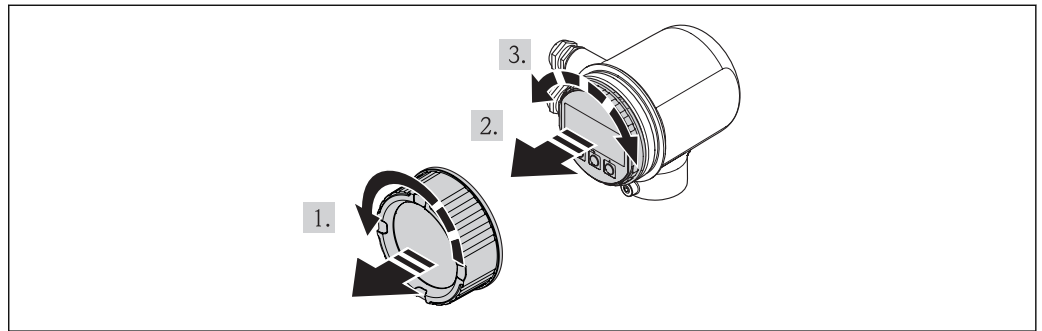

A0017228

1. Remove the cover of the electronics compartment.
2. Pull out the display module with a gentle rotational movement.
3. Turn the display module to the desired position: Max. 4×90° in each direction.
4. Feed the ribbon cable into the gap between the housing and main electronics module and plug the display module into the electronics compartment and turn it until it engages.
5. Screw the cover of the electronics compartment back on.

6.3 Post-mounting check

Is the device damaged (visual inspection)?	<input type="checkbox"/>
Does the measuring device conform to the measuring point specifications? For example: <ul style="list-style-type: none"> ■ Process temperature (→ 102) ■ Process pressure (refer to the chapter on "Material load curves" of the "Technical Information" document) ■ Ambient temperature range (→ 19) ■ Measuring range (→ 94) 	<input type="checkbox"/>
Has the correct orientation for the sensor been selected (→ 15)? <ul style="list-style-type: none"> ■ According to sensor type ■ According to medium properties ■ According to medium temperature ■ According to process pressure 	<input type="checkbox"/>
Does the arrow on the sensor match the direction of flow of the medium through the piping (→ 15)?	<input type="checkbox"/>
Have sufficient inlet and outlet runs been provided upstream and downstream of the measuring point?	<input type="checkbox"/>
Correctly aligned in the direction of flow?	<input type="checkbox"/>
Is the device adequately protected from precipitation and direct sunlight?	<input type="checkbox"/>
Is the device protected against overheating?	<input type="checkbox"/>
Is the device protected against excessive vibrations?	<input type="checkbox"/>
Check gas property (e.g. purity, dryness, cleanliness).	<input type="checkbox"/>
Are the measuring point identification and labeling correct (visual inspection)?	<input type="checkbox"/>

7 Electrical connection

7.1 Connection conditions

7.1.1 Required tools

- For cable entries: Use corresponding tools
- Wire stripper
- When using stranded cables: Crimping tool for wire end ferrule
- Flat blade screwdriver ≤ 3 mm (0.12 in)

7.1.2 Requirements for connecting cable

The connecting cables provided by the customer must fulfill the following requirements.

Electrical safety

In accordance with applicable federal/national regulations.

Cable specification

Permitted temperature range:

- -40 °C (-40 °F)... ≥ 80 °C (176 °F)
- Minimum requirement for cable temperature range: ambient temperature $+20$ K

Current output

For 4-20 mA HART: Shielded cable recommended. Observe grounding concept of the plant.

Pulse/frequency/switching output

Standard installation cable is sufficient

Cable diameter

- Included cable glands: M20 \times 1.5 with cable \varnothing 6 to 12 mm (0.24 to 0.47 in)
- Core cross-sectional area 0.5 to 1.5 mm² (21 to 16 AWG)

7.1.3 Requirements for the supply unit

Device supply voltage

DC 24 V (18 to 30 V)

The power supply circuit must comply with ELV (BS 7671) requirements.

Pulse/frequency/status supply voltage

An external power supply is required for each output.


Order characteristic for "Output"	Maximum terminal voltage
Option B, K	DC 30 V

Load

0 to 750 Ω , depending on the external supply voltage of the power supply unit

7.1.4 Terminal assignment

The terminal assignment for the electrical connection can be found on the nameplate of the electronics module.

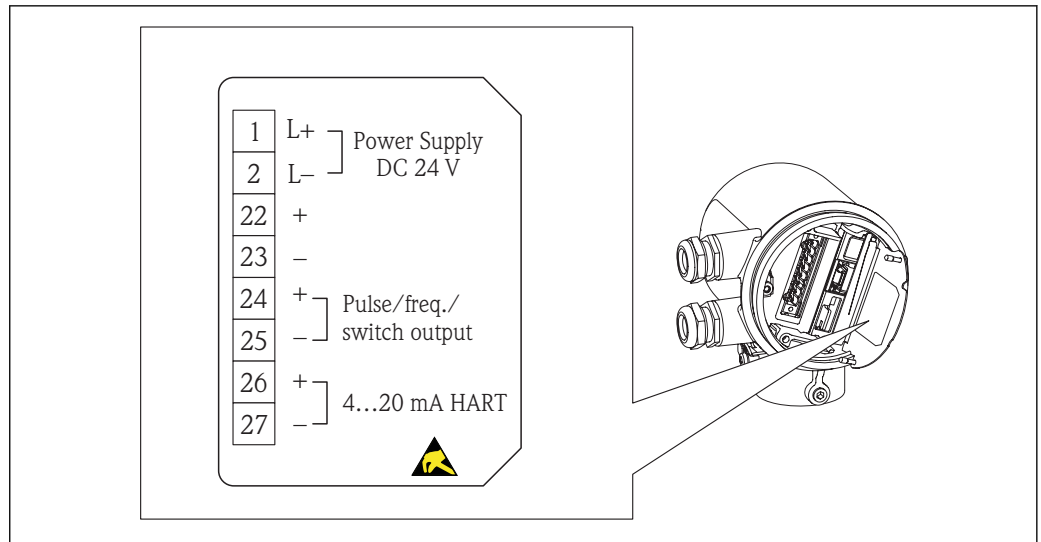

A0017222

7.1.5 Preparing the measuring device

1. Remove dummy plug if present.
2. **NOTICE!** Insufficient sealing of the housing. Operational reliability of the measuring device could be defeated. Use suitable cable glands corresponding to the degree of protection. If measuring device is delivered without cable glands:
Provide suitable cable gland for corresponding connecting cable. (→ 22)
3. If measuring device is delivered with cable glands:
Observe cable specification (→ 22).


7.2 Connecting the measuring device

NOTICE

Limitation of electrical safety due to incorrect connection!

- ▶ Have electrical connection work carried out by correspondingly trained specialists only.
- ▶ Observe applicable federal/national installation codes and regulations.
- ▶ Comply with local workplace safety regulations.
- ▶ SELV/PELV-compliant 24 V DC (18 to 30 V) power supply.
- ▶ 4 to 20 mA HART active
- ▶ Maximum output values: DC 24V, 22 mA, load 0 to 750 Ω

7.2.1 Connecting the cables

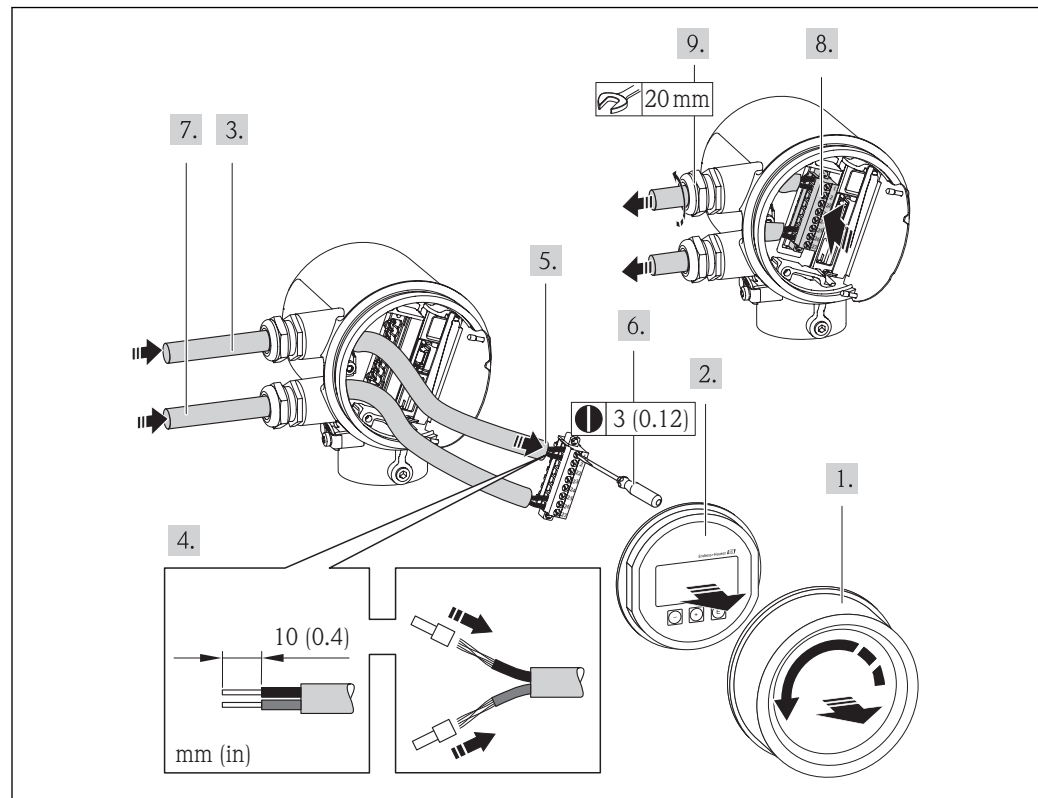

A0017250

1. Unscrew the connection compartment cover.
2. Remove the display module.
3. Push the supply cable through the cable entry. To ensure tight sealing, do not remove the sealing ring from the cable entry.
4. Strip the cable and cable ends. In the case of stranded cables, also fit wire end ferrules.
5. Connect the cable in accordance with the terminal assignment (→ 98). For HART communication: When connecting the cable shielding to the ground terminal, observe the grounding concept of the facility.
6. Firmly tighten the screws in the terminal block.
7. Perform the same steps for the signal cable as for the power supply cable.
8. Insert the terminal block into the electronics module.
9. Firmly tighten the cable glands.
10. **NOTICE!** Housing degree of protection voided due to insufficient sealing of the housing. Screw in the thread without using any lubricant. The threads on the cover are coated with a dry lubricant.
Reverse the removal procedure to reassemble the transmitter.


7.3 Ensuring the degree of protection

The measuring device fulfills all the requirements for the IP66 and IP67 (Type 4X enclosure) degree of protection.

To guarantee IP 66 and IP 67 degree of protection (Type 4X enclosure), carry out the following steps after the electrical connection:

1. Check whether the housing seals of the connection and electronics compartment are clean and inserted correctly. Dry, clean or replace the seals if necessary.

2. Tighten all housing screws and screw covers.
3. Firmly tighten the cable glands.
4. To ensure that moisture does not enter the cable entry, route the cable so that it loops down before the cable entry ("water trap").

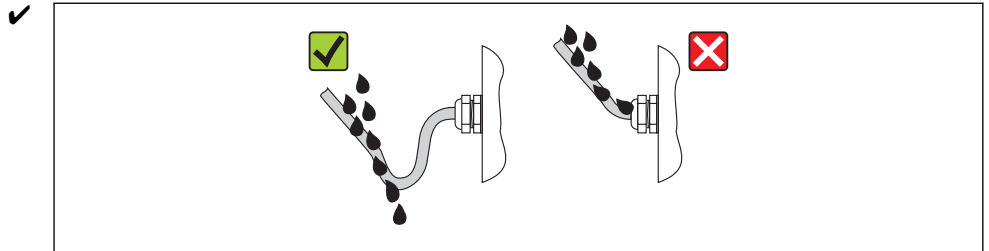

A0013960


5. Insert dummy plugs into unused cable entries.

7.4 Post-connection check

Are cables or the device undamaged (visual inspection)?	<input type="checkbox"/>
Are the power supply and signal cables correctly connected?	<input type="checkbox"/>
Does the supply voltage correspond to the specifications in the connection diagram?	<input type="checkbox"/>
Do the cables comply with the requirements (→ 22)?	<input type="checkbox"/>
Do the cables have adequate strain relief? Are they routed securely?	<input type="checkbox"/>
Is the cable route completely isolated? Without loops and cross-overs?	<input type="checkbox"/>
Are all the screw terminals firmly tightened?	<input type="checkbox"/>
Are all the cable glands installed, firmly tightened and leak-tight? Cable run with "water trap" (→ 22) ?	<input type="checkbox"/>
Does the supply voltage match the specifications on the transmitter nameplate (→ 22)?	<input type="checkbox"/>
Is the terminal assignment correct (→ 22)?	<input type="checkbox"/>
If supply voltage is present, is the device ready for operation and do values appear on the display module?	<input type="checkbox"/>
Are all housing covers installed and firmly tightened?	<input type="checkbox"/>

8 Operation options

8.1 Overview of operation options

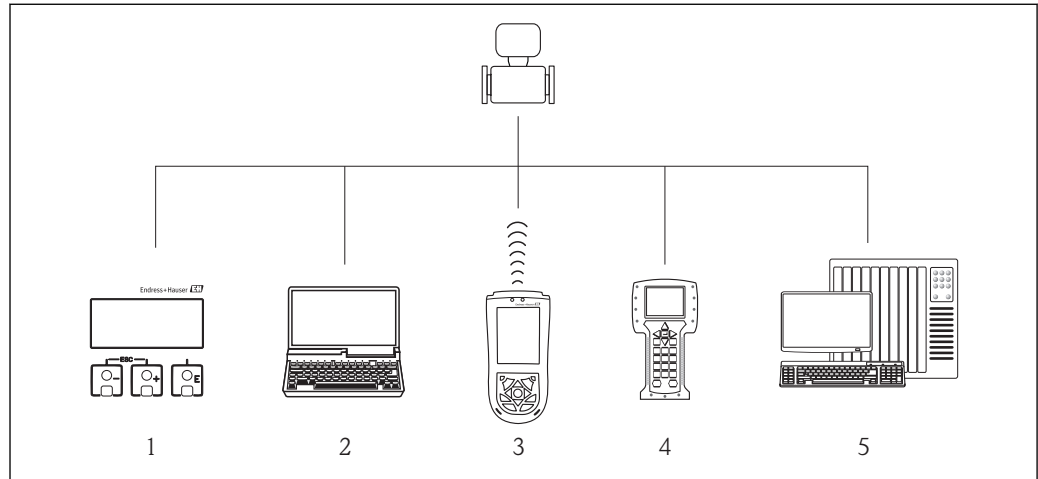

A0015607


- 1 Local operation via display module
- 2 Computer with operating tool (e.g. FieldCare, AMS Device Manager, SIMATIC PDM)
- 3 Field Xpert SFX100
- 4 Field Communicator 475
- 5 Control system (e.g. PLC)

8.2 Structure and function of the operating menu

8.2.1 Structure of the operating menu

 For an overview of the operating menu with menus and parameters (→  109)

 For an overview of the operating menu for experts: (→  109)

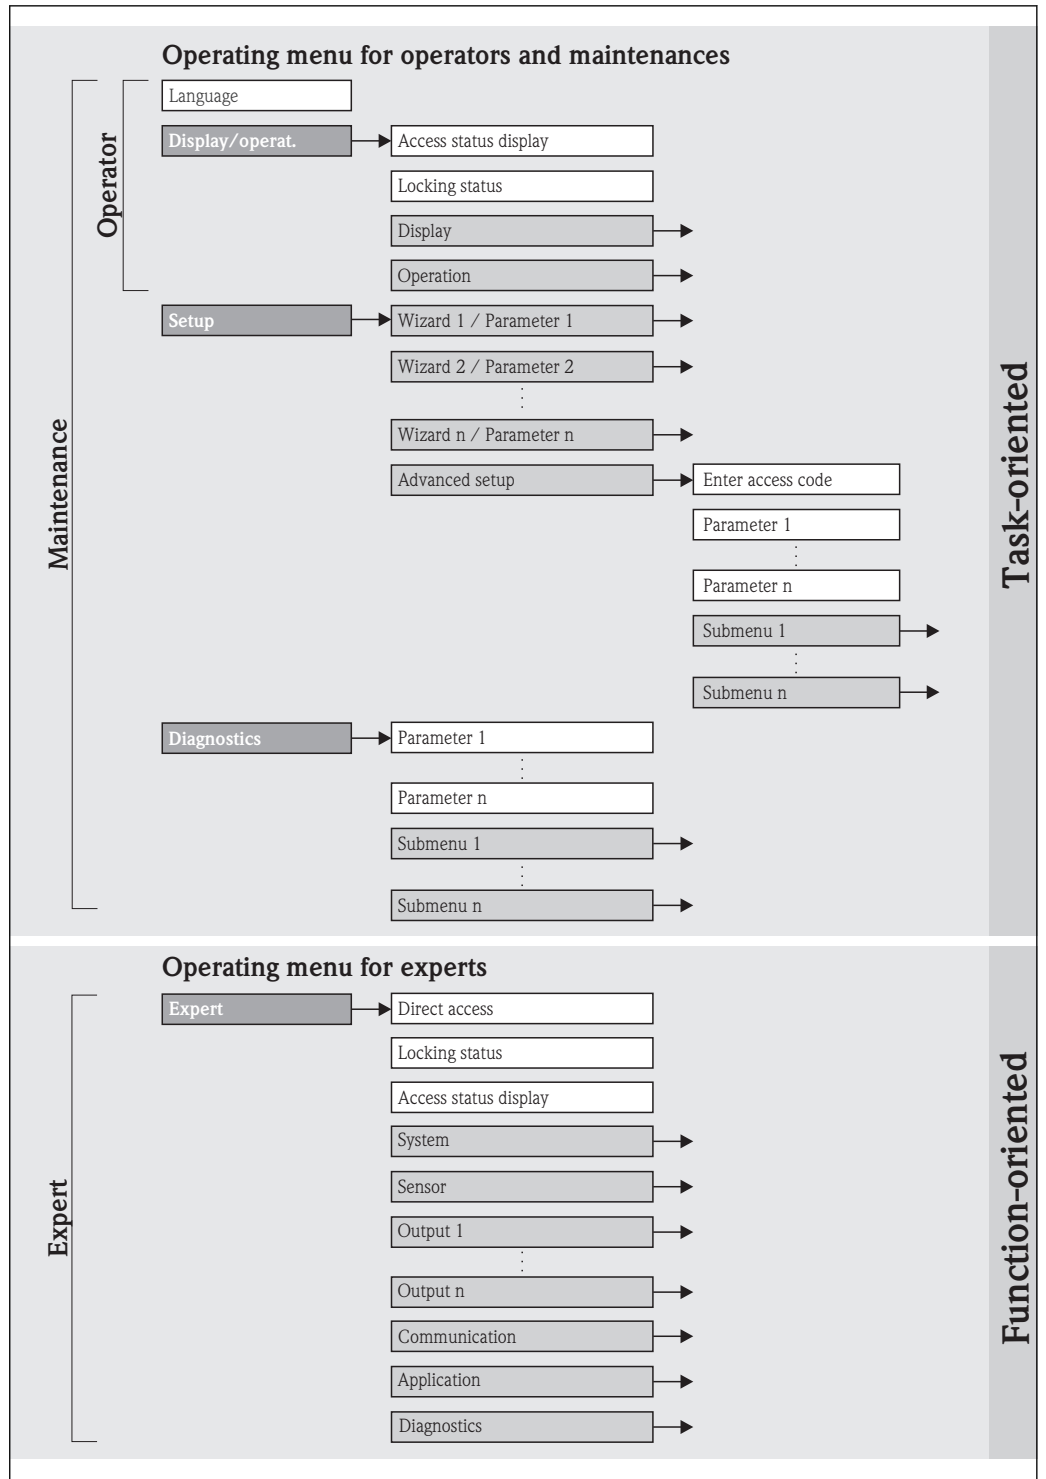

A0018237-EN


8.2.2 Operating philosophy

The individual parts of the operating menu are assigned to certain user roles. Each user role contains typical tasks within the device lifecycle.

Menu		User role and tasks	Content/meaning
Language	task-oriented	Role "Operator", "Maintenance" Tasks during operation: <ul style="list-style-type: none"> ■ Configuring the measured value display ■ Reading measured values 	Defining the operating language
Display/operat.			Configuration of the measured value display (e.g. display format, display contrast) Resetting and controlling totalizers
Setup		"Maintenance" role Commissioning: <ul style="list-style-type: none"> ■ Configuration of the measurement ■ Configuration of the outputs 	Wizards for quick commissioning: <ul style="list-style-type: none"> ■ Defining the medium ■ Configuring the outputs ■ Configuring the measured value display ■ Defining the output conditioning ■ Configuring the low flow cut off "Advanced setup" submenu: <ul style="list-style-type: none"> ■ For more customized configuration of the measurement (adaptation to special measuring conditions) ■ Configuration of totalizers
Diagnosis		"Maintenance" role Fault elimination: <ul style="list-style-type: none"> ■ Diagnostics and elimination of process and device errors ■ Measured value simulation 	Contains all parameters for error detection and analyzing process and device errors: <ul style="list-style-type: none"> ■ "Diagnostic list" submenu Contains up to 5 currently pending diagnostic messages. ■ "Event logbook" submenu Contains up to 20 or 100 (order option) event messages that have occurred. ■ "Device information" submenu Contains information for identifying the device. ■ "Measured values" submenu Contains all current measured values. ■ "Data logging" submenu (order option) Storage and visualization of up to 1000 measured values ■ "Simulation" submenu Is used to simulate measured values or output values. ■ "Device reset" submenu Resets the device configuration to certain settings
Expert	function-oriented	Tasks that require detailed knowledge of the function of the device: <ul style="list-style-type: none"> ■ Commissioning measurements under difficult conditions ■ Optimal adaptation of the measurement to difficult conditions ■ Detailed configuration of the communication interface ■ Error diagnostics in difficult cases 	Contains all the parameters of the device and makes it possible to access these parameters directly using an access code. The structure of this menu is based on the function blocks of the device: <ul style="list-style-type: none"> ■ "System" submenu Contains all higher-order device parameters that do not pertain either to measurement or the measured value communication. ■ "Sensor" submenu Contains all parameters for configuring the measurement. ■ "Output" submenu Contains all parameters for configuring the analog current outputs. ■ "Communication" submenu Contains all parameters for configuring the digital communication interface. ■ "Application" submenu Contains all parameters for configuring the functions that go beyond the actual measurement (e.g. totalizer). ■ "Diagnostics" submenu Contains all parameters for error detection and analyzing process and device errors and for device simulation.

8.3 Access to the operating menu via the local display

8.3.1 Operational display

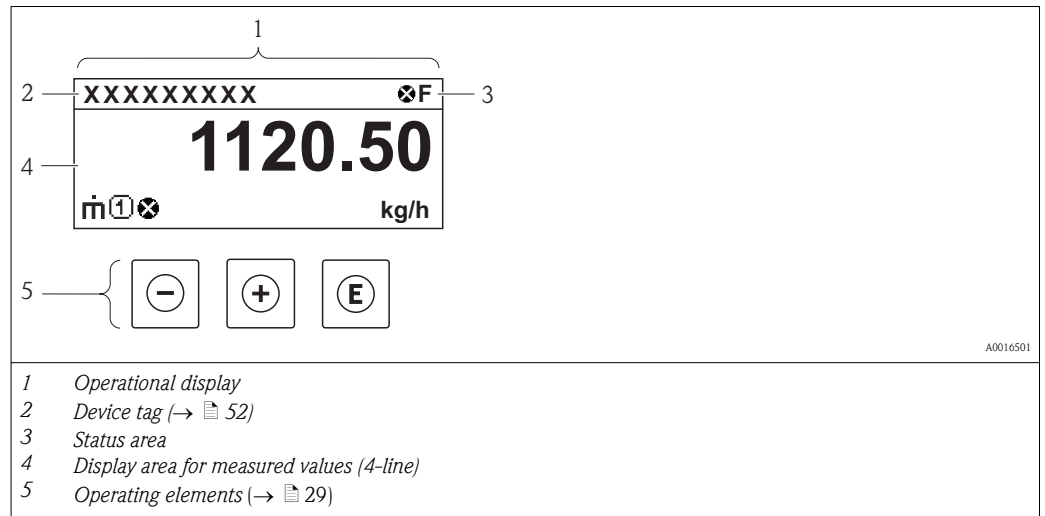

Status area

The following symbols appear in the status area of the operational display at the top right:

Status signals

Symbol	Meaning
F <small>A0013956</small>	Failure A device error has occurred. The measured value is no longer valid.
C <small>A0013959</small>	Function check The device is in service mode (e.g. during a simulation).
S <small>A0013958</small>	Out of specification The device is being operated: <ul style="list-style-type: none"> ■ Outside its technical specification limits (e.g. outside the process temperature range) ■ Outside of the configuration carried out by the user (e.g. maximum flow in parameter 20 mA value)
M <small>A0013957</small>	Maintenance required Maintenance is required. The measured value is still valid.


Diagnostic behavior

Symbol	Meaning
 <small>A0013961</small>	Alarm Measurement is interrupted. The signal outputs and totalizers assume the defined alarm condition. A diagnostics message is generated (→ 81).
 <small>A0013962</small>	Warning Measurement is resumed. The signal outputs and totalizers are not affected. A diagnostics message is generated (→ 81).

Locking


Symbol	Meaning
 <small>A0013963</small>	Device locked The measuring device is hardware locked (→ 70).

Communication






Symbol	Meaning
 A0013965	Communication via remote operation is active.

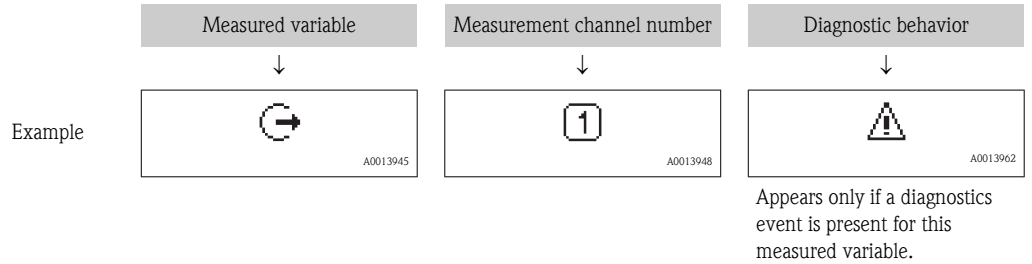Display area


In the display area, each measured value is prefaced by certain symbol types for further description:




Measured variables


Symbol	Meaning
 A0013711	Corrected volume flow, FAD
 A0013710	Mass flow
 A0013947	Temperature
 A0013943	Totalizer
 A0013945	Current output

Measurement channel numbers

Symbol	Meaning
 A0016325	Measurement channel 1 to 4
The measurement channel number is displayed only if more than one channel is present for the same measured variable type.	

Diagnostic behavior


The diagnostic behavior pertains to a diagnostic event that is relevant to the displayed measured variable. For more information about the symbols, refer to the "Status area" section (→  29).

 The number and display of the measured values can be configured via the parameter **Format display**.

Navigation path


"Display/operat." menu → Display → Format display

8.3.2 Navigation view

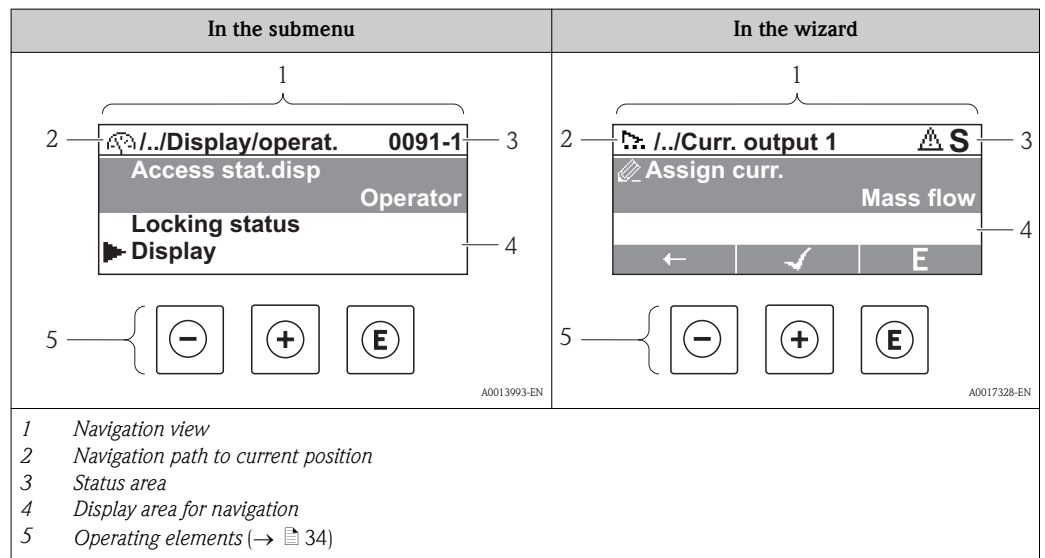

Navigation path

The navigation path - displayed at the top left in the navigation view - consists of the following elements:

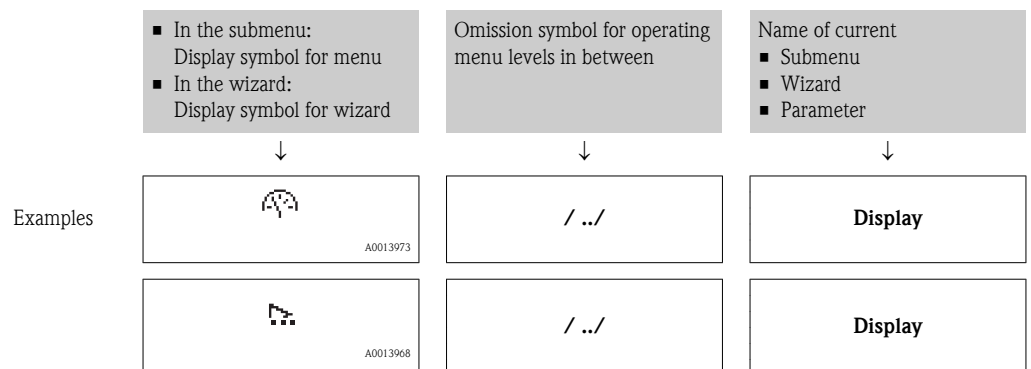

For more information about the menu icons, refer to the "Display area" section (→ 32)

Status area

The following appears in the status area of the navigation view in the top right corner:





- Of the submenu
 - The direct access code for the parameter you are navigating to (e.g. 0022-1)
 - If a diagnostic event is present, the diagnostic behavior and status signal
- In the wizard
 - If a diagnostic event is present, the diagnostic behavior and status signal

For information on the diagnostic behavior and status signal (→ 81)





For information on entering the direct access code and how this function works: (→ 37)

Display area




Menus

Symbol	Meaning
 A0013973	Display/operat. Appears: <ul style="list-style-type: none"> In the menu next to the "Display/operat." selection At the left in the navigation path in the "Display/operat." menu
 A0013974	Setup Appears: <ul style="list-style-type: none"> In the menu next to the "Setup" selection At the left in the navigation path in the "Setup" menu
 A0013975	Diagnosis Appears: <ul style="list-style-type: none"> In the menu next to the "Diagnostics" selection At the left in the navigation path in the "Diagnostics" menu
 A0013960	Expert Appears: <ul style="list-style-type: none"> In the menu next to the "Expert" selection At the left in the navigation path in the "Expert" menu




Submenus, wizards, parameters

Symbol	Meaning
 A0013967	Submenu
 A0013968	Wizard
 A0013972	Parameters within a wizard  No display symbol exists for parameters in submenus.


Locking

Symbol	Meaning
 A0013963	Parameter locked When displayed in front of a parameter name, indicates that the parameter is locked. <ul style="list-style-type: none"> By a user-specific access code (→  71) By the hardware write protection switch (→  70)

Wizard operation

Symbol	Meaning
 A0013978	Switches to the previous parameter.
 A0013976	Confirms the parameter value and switches to the next parameter.
 A0013977	Opens the editing view of the parameter.




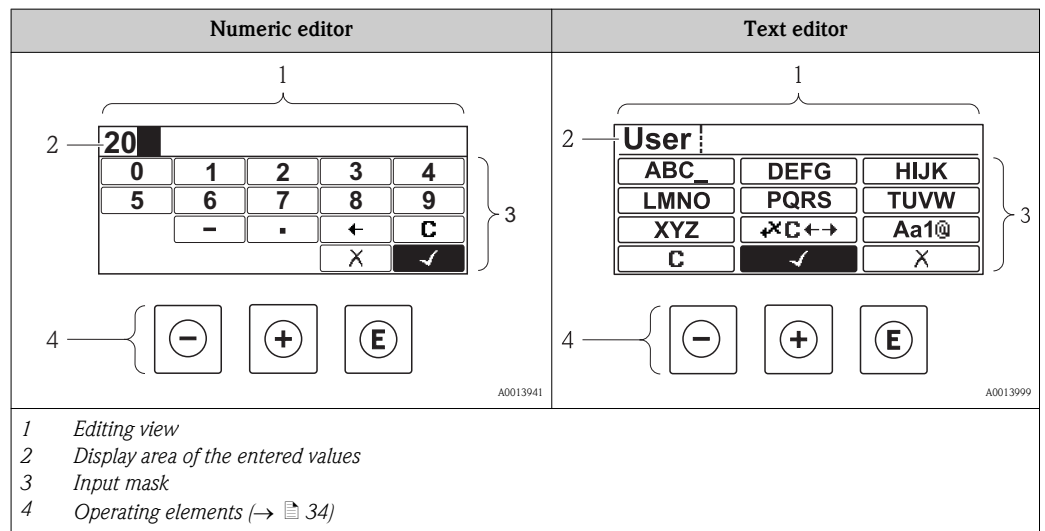



8.3.3 Editing view




 
Input mask

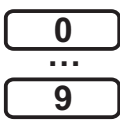



The following input symbols are available in the input mask of the numeric and text editor:

 
Numeric editor

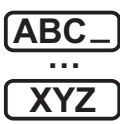



Symbol	Meaning
 A0013998	Selection of numbers from 0 to 9.
 A0016619	Inserts decimal separator at the input position.
 A0016620	Inserts minus sign at the input position.
 A0013985	Confirms selection.
 A0016621	Moves the input position one position to the left.
 A0013986	Exits the input without applying the changes.
 A0014040	Clears all entered characters.

 Text editor



Symbol	Meaning
 A0013997	Selection of letters from A to Z
 A0013981	Toggle <ul style="list-style-type: none"> ■ Between upper-case and lower-case letters ■ For entering numbers ■ For entering special characters






 <small>A0013985</small>	Confirms selection.
 <small>A0013987</small>	Switches to the selection of the correction tools.
 <small>A0013986</small>	Exits the input without applying the changes.
 <small>A0014040</small>	Clears all entered characters.

Correction symbols under 

Symbol	Meaning
 <small>A0013989</small>	Clears all entered characters.
 <small>A0013991</small>	Moves the input position one position to the right.
 <small>A0013990</small>	Moves the input position one position to the left.
 <small>A0013988</small>	Deletes one character immediately to the left of the input position.

 8.3.4 Operating elements

Key	Meaning
 <small>A0013969</small>	<p>Minus key</p> <p><i>In a menu, submenu</i> Moves the selection bar upwards in a choose list.</p> <p><i>With a Wizard</i> Confirms the parameter value and goes to the previous parameter.</p> <p><i>With a text and numeric editor</i> In the input mask, moves the selection bar to the left (backwards).</p>
 <small>A0013970</small>	<p>Plus key</p> <p><i>In a menu, submenu</i> Moves the selection bar downwards in a choose list.</p> <p><i>With a Wizard</i> Confirms the parameter value and goes to the next parameter.</p> <p><i>With a text and numeric editor</i> Moves the selection bar to the right (forwards) in an input screen.</p>

Key	Meaning
 <small>A0013952</small>	<p>Enter key</p> <p><i>For operational display</i></p> <ul style="list-style-type: none"> ■ Pressing the key briefly opens the operating menu. ■ Pressing the key for 2 s opens the context menu. <p><i>In a menu, submenu</i></p> <ul style="list-style-type: none"> ■ Pressing the key briefly: <ul style="list-style-type: none"> – Opens the selected menu, submenu or parameter. – Starts the wizard. – If help text is open, closes the help text of the parameter. ■ Pressing the key for 2 s for parameter: <ul style="list-style-type: none"> – If present, opens the help text for the function of the parameter. <p><i>With a Wizard</i> Opens the editing view of the parameter.</p> <p><i>With a text and numeric editor</i></p> <ul style="list-style-type: none"> ■ Pressing the key briefly: <ul style="list-style-type: none"> – Opens the selected group. – Carries out the selected action. ■ Pressing the key for 2 s confirms the edited parameter value.
 <small>A0013971</small>	<p>Escape key combination (press keys simultaneously)</p> <p><i>In a menu, submenu</i></p> <ul style="list-style-type: none"> ■ Pressing the key briefly: <ul style="list-style-type: none"> – Exits the current menu level and takes you to the next higher level. – If help text is open, closes the help text of the parameter. ■ Pressing the key for 2 s returns you to the operational display ("home position"). <p><i>With a Wizard</i> Exits the wizard and takes you to the next higher level.</p> <p><i>With a text and numeric editor</i> Closes the text or numeric editor without applying changes.</p>
 <small>A0013953</small>	<p>Minus/Enter key combination (press the keys simultaneously)</p> <p>Reduces the contrast (brighter setting).</p>
 <small>A0013954</small>	<p>Plus/Enter key combination (press and hold down the keys simultaneously)</p> <p>Increases the contrast (darker setting).</p>
 <small>A0013955</small>	<p>Minus/Plus/Enter key combination (press the keys simultaneously)</p> <p><i>For operational display</i> Enables or disables the keypad lock.</p>

 
8.3.5 Opening the context menu


Using the context menu, the user can call up the following three menus quickly and directly from the measured value display:

- Setup
- Conf. backup disp.
- Simulation

Calling up and closing the context menu

The user is in the measured value display.

1. Press  for 2 s.
 - ✓ The context menu opens.

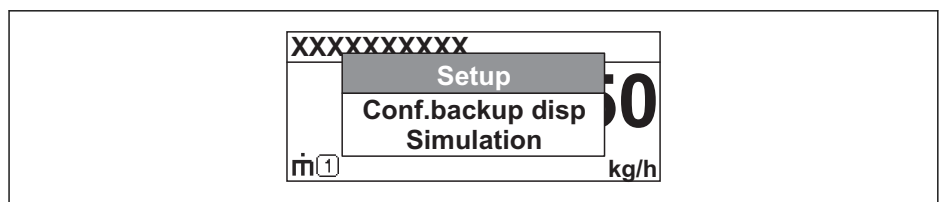

A0014003-EN



2. Press \square + \square simultaneously.
 - ✓ The context menu is closed and the measured value display appears.

Calling up the menu via the context menu


1. Open the context menu.
2. Press \square to navigate to the desired menu.
3. Press \square to confirm the selection.
 - ✓ The selected menu opens.

8.3.6 Navigating and selecting from list

Different operating elements are used to navigate through the operating menu. The navigation path is displayed on the left in the header. Icons are displayed in front of the individual menus. These icons are also shown in the header during navigation.

 For an explanation of the navigation view with symbols and operating elements (→  31)

Example: Setting the number of displayed measured values to "2 values"

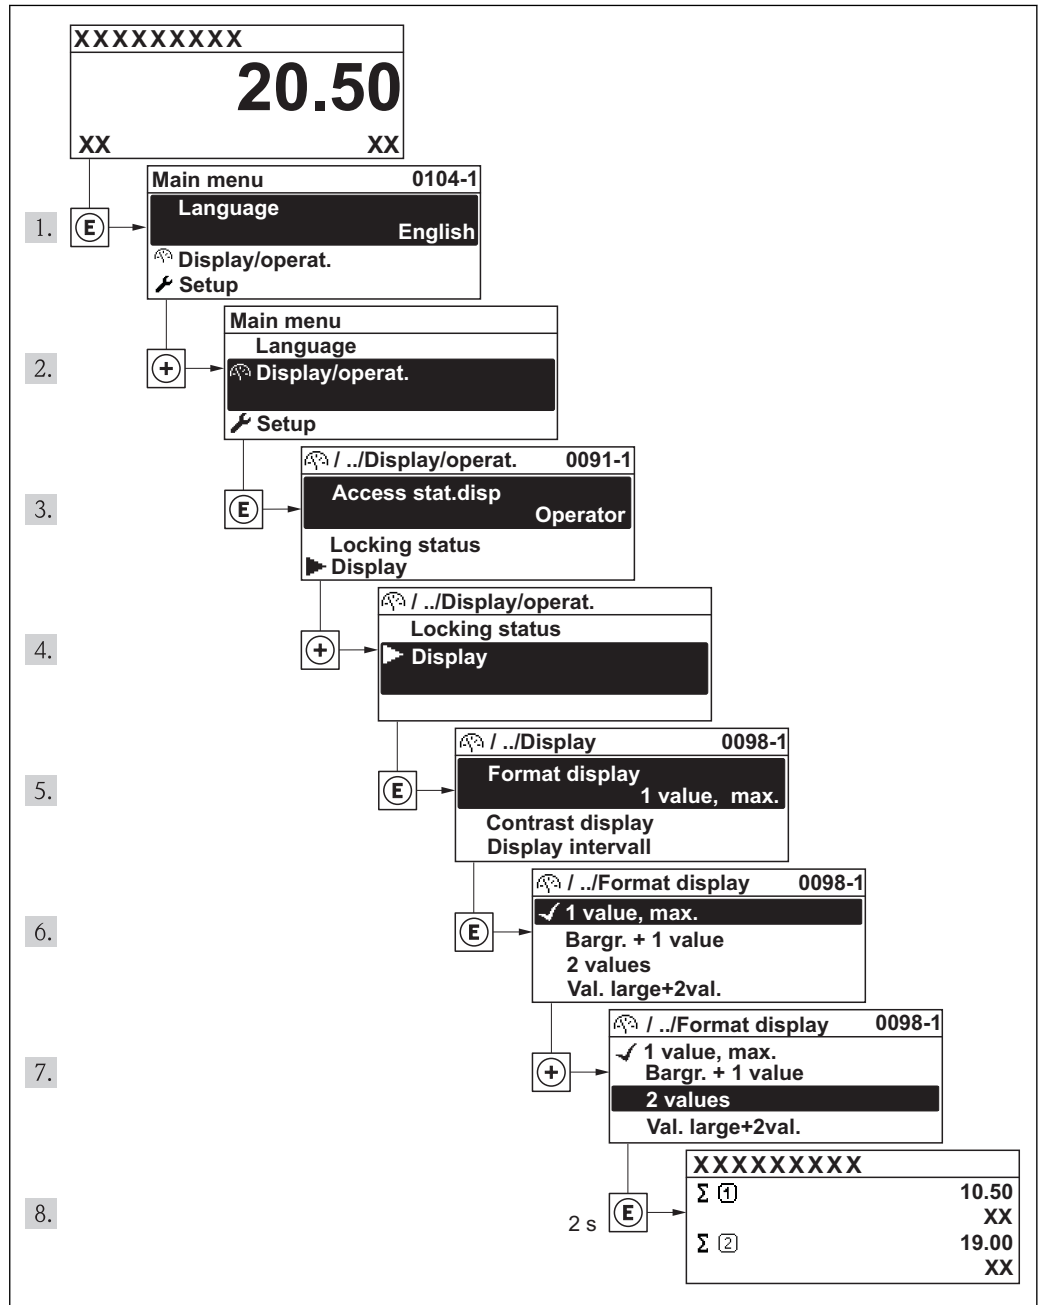

A0014010-EN


8.3.7 Calling the parameter directly

A parameter number is assigned to every parameter to be able to access a parameter directly via the onsite display. Entering this access code in the **Direct access** parameter calls up the desired parameter directly.

Navigation path

"Expert" menu → Direct access

The direct access code consists of a 4-digit number and the channel number, which identifies the channel of a process variable: e.g. 0914-1. In the navigation view, this appears on the right-hand side in the header of the selected parameter.

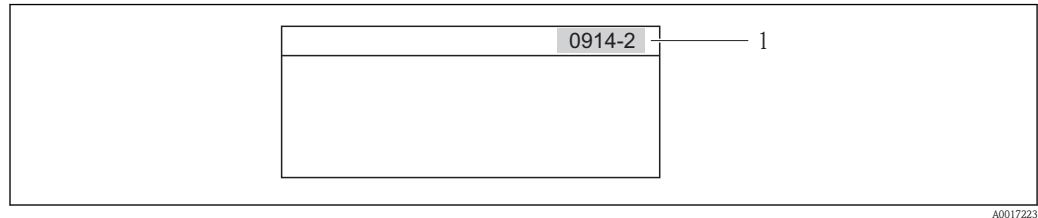

1 Direct access code

Note the following when entering the direct access code:

- The leading zeros in the direct access code do not have to be entered.
Example: Input of "914" instead of "0914"
- If no channel number is entered, channel 1 is jumped to automatically.
Example: Input of "0914" → Parameter **Totalizer 1**
- If a different channel is jumped to: Enter the direct access code with the corresponding channel number.
Example: Input of "0914-2" → Parameter **Totalizer 2**


 For the direct access codes of the individual parameters (→  109)(→  109)


8.3.8 Calling up help text


Help text is available for some parameters and can be called up from the navigation view. The help text provides a brief explanation of the parameter function and thereby supports swift and safe commissioning.



Calling up and closing the help text

The user is in the navigation view and the selection bar is on a parameter.

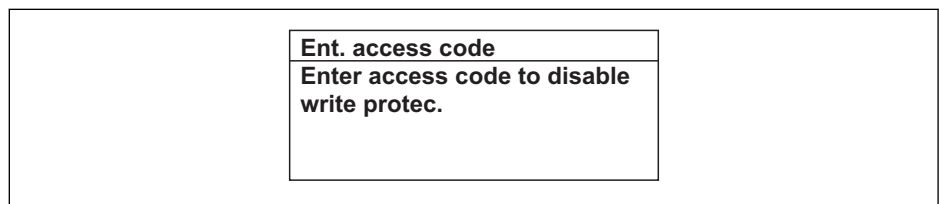


1. Press  for 2 s.
 - ✓ The help text for the selected parameter opens.




 4 Example: Help text for parameter "Enter access code"

2. Press  +  simultaneously.
 - ✓ The help text is closed.

8.3.9 Changing the parameters


 For a description of the editing display - consisting of text editor and numeric editor - with symbols (→ ) 33), for a description of the operating elements (→ ) 29)

Example: Changing the parameter "20 mA value" to 20 kg/s

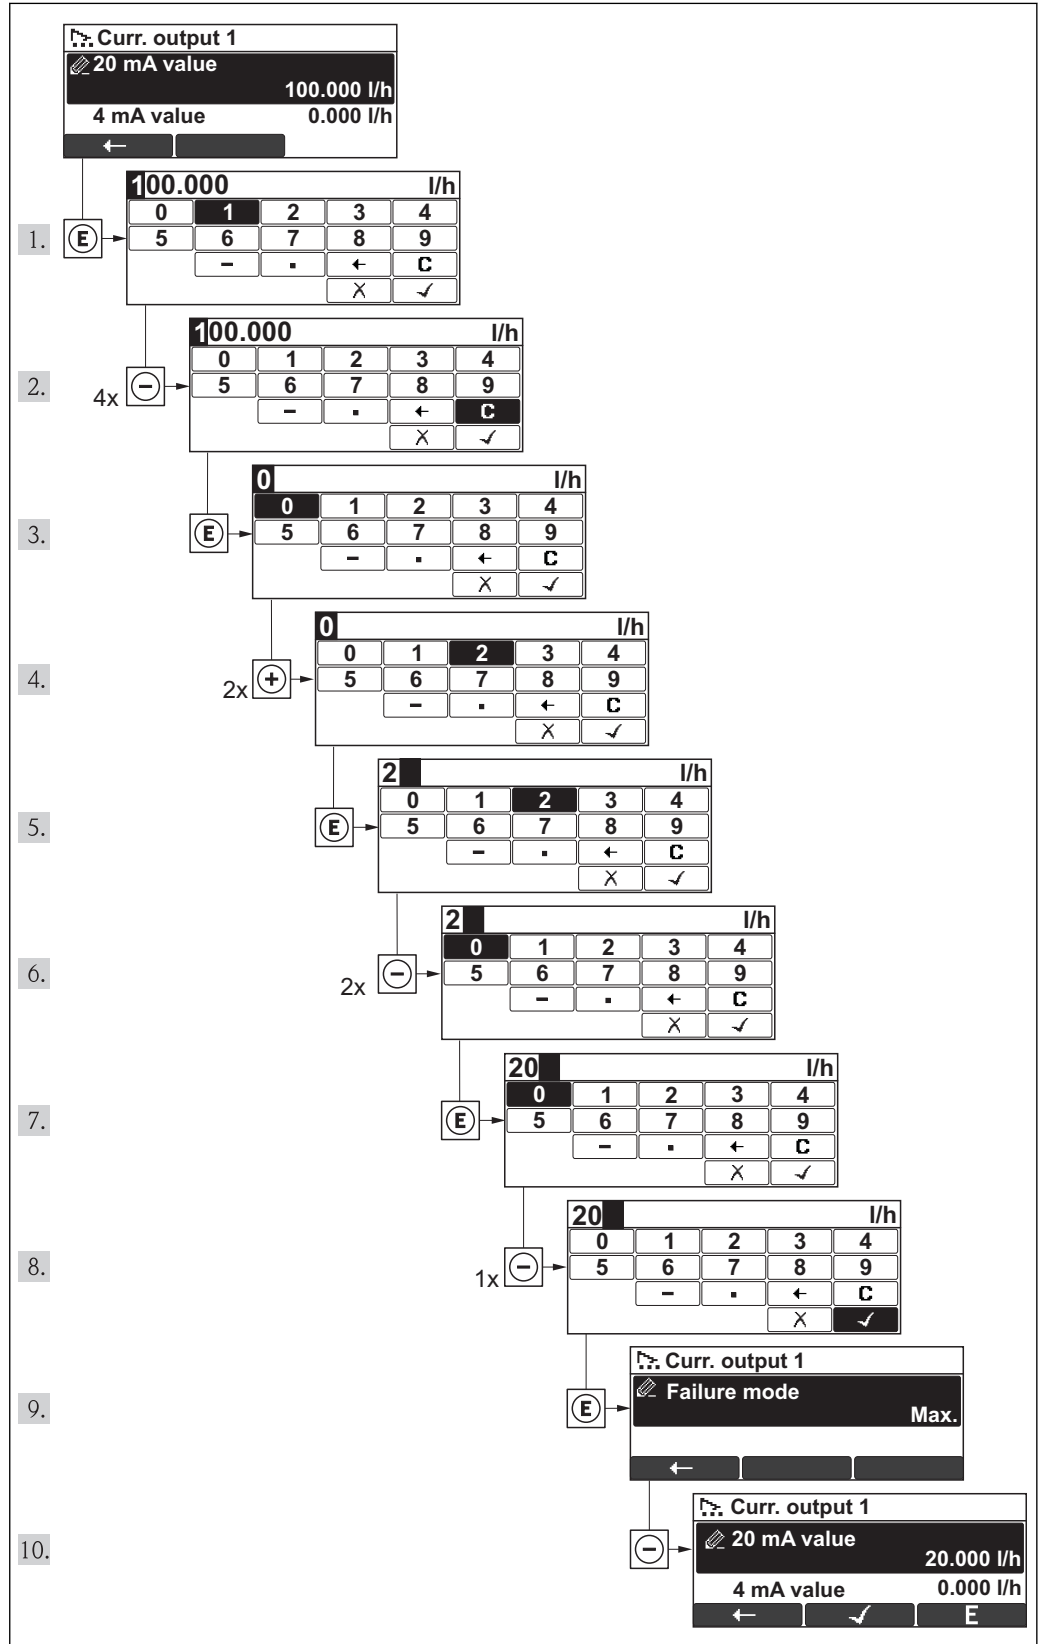

A0016332-EN

A message is displayed if the value entered is outside the permitted value range.

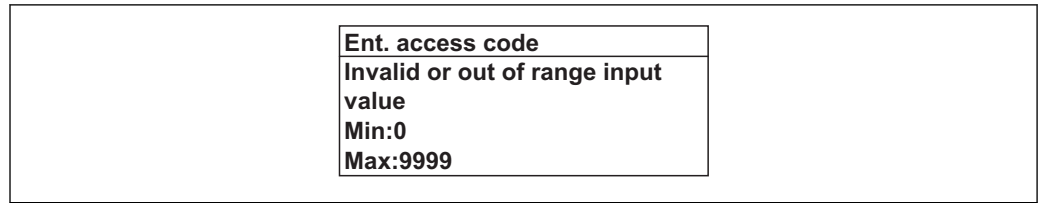

A0014049-EN

8.3.10 User roles and related access authorization

The two user roles "Operator" and "Maintenance" have different write access to the parameters if the customer defines a user-specific access code. This protects the device configuration via the local display from unauthorized access (→ 70).

Access authorization to parameters

User role	Read access		Write access	
	Without access code (from the factory)	With access code	Without access code (from the factory)	With access code
Operator	✓	✓	✓	– ¹⁾
Maintenance	✓	✓	✓	✓

1) Despite the defined access code, certain parameters can always be modified and thus are excepted from the write protection, as they do not affect the measurement. Refer to the "Write protection via access code" section

If an incorrect access code is entered, the user obtains the access rights of the "Operator" role.

i The user role with which the user is currently logged on is indicated by the **Access status display** parameter. Navigation path: Display/operation → Access status display

8.3.11 Disabling write protection via access code

If the -symbol appears on the local display in front of a parameter, the parameter is write-protected by a user-specific access code and its value cannot be changed at the moment using the local display(→ 70).

The locking of the write access via local operation can be disabled by entering the customer-defined access code via the respective access option.

1. After you press , the input prompt for the access code appears.
2. Enter the access code.
 - ✓ The -symbol in front of the parameters disappears; all previously write-protected parameters are now re-enabled.

8.3.12 Enabling and disabling the keypad lock


The keypad lock makes it possible to block access to the entire operating menu via local operation. As a result, it is no longer possible to navigate through the operating menu or change the values of individual parameters. Users can only read the measured values on the operational display.

The keypad lock is enabled and disabled in the same way:

The user is in the operational display.


- ▶ By simultaneously pressing the + + keys.

- ✓ After enabling the keypad lock:

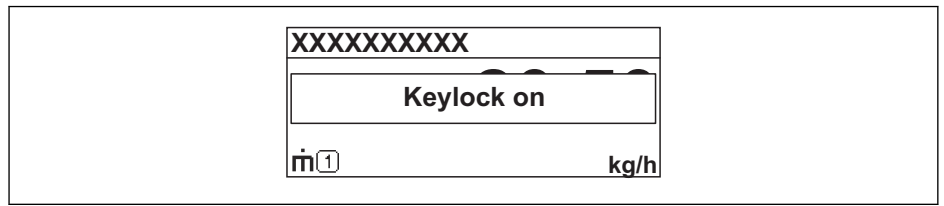

A0014000-EN

- After disabling the keypad lock:

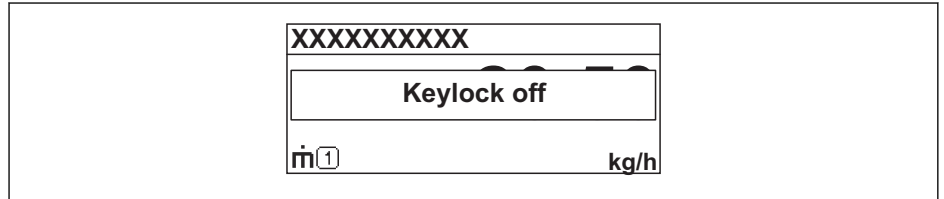

A0014001-EN

-  If the user attempts to access the operating menu while the keylock is enabled, the message "Keylock on" also appears.

8.4 Access to the operating menu via the operating tool

The structure of the operating menu in the operating tools is the same as for operation via the local display.


8.4.1 Field Xpert SFX100

Function range

Compact, flexible and robust industrial handheld terminal for remote configuration and measured value display via HART protocol.

 For details, see Operating Instructions BA00060S

Source for device description files

See data (→  45)

8.4.2 FieldCare

Function range

FDT-based plant asset management tool from Endress+Hauser. It can configure all smart field devices in a system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.

Access takes place via:


- HART protocol
- Service interface

Typical functions:

- Configuring parameters of transmitters
- Loading and saving device data (upload/download)
- Documentation of the measuring point
- Visualization of the measured value memory (line recorder) and event logbook

 For details, see Operating Instructions BA00027S and BA00059S

Source for device description files

See data (→  45)


User interface

8.4.3 AMS Device Manager

Function range

Program from Emerson Process Management for operating and configuring measuring devices via HART protocol.

Source for device description files


See data (→  45)

8.4.4 SIMATIC PDM

Function range

SIMATIC PDM is a standardized, manufacturer-independent program from Siemens for the operation, configuration, maintenance and diagnosis of intelligent field devices via HART protocol.

Source for device description files


See data (→  45)

8.4.5 Field Communicator 475

Function scope


Industrial handheld terminal from Emerson Process Management for remote configuration and measured value display via HART protocol.

Source for device description files

See data (→  45)


8.4.6 Connecting operating tools

Via HART protocol

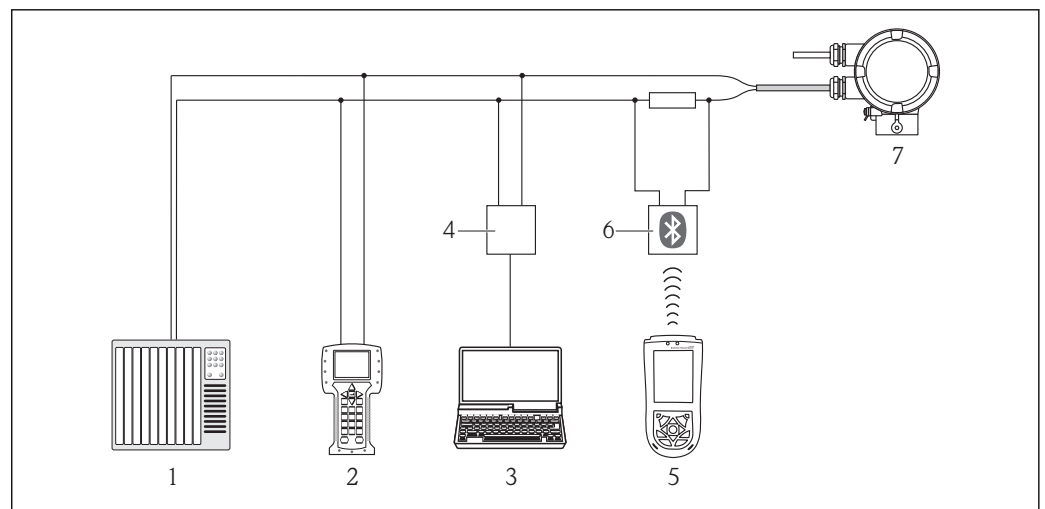

- 1 Control system (e.g. PLC)
- 2 Field Communicator 475
- 3 Computer with operating tool (e.g. FieldCare, AMS Device Manager, SIMATIC PDM)
- 4 Commubox FXA195 (USB)
- 5 Field Xpert SFX100
- 6 VIATOR Bluetooth modem with connecting cable
- 7 Transmitter

A0017373

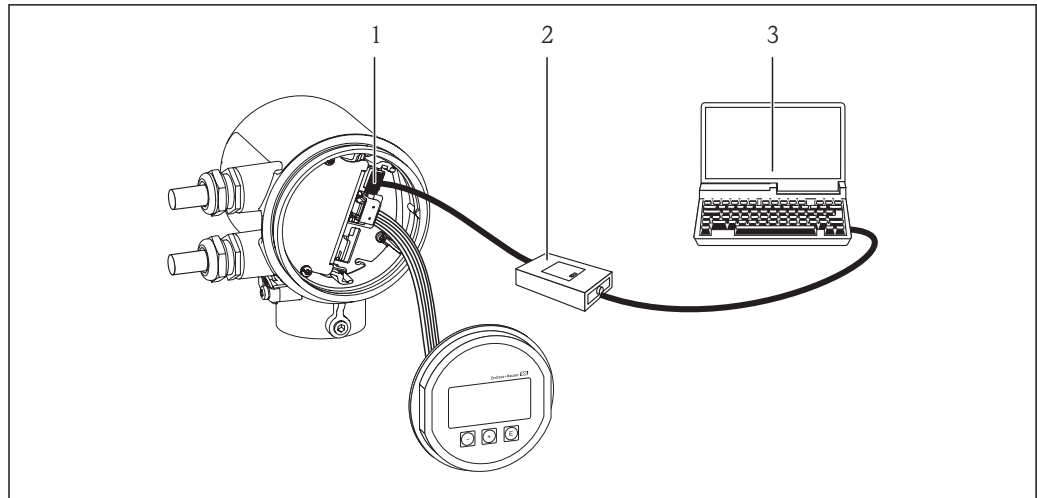Via service interface (CDI)

A0017253

- 1 Service interface (CDI) of the measuring device (= Endress+Hauser Common Data Interface)
- 2 Commubox FXA291
- 3 Computer with "FieldCare" operating tool

9 System integration

9.1 Overview of device description files

9.1.1 Current version data for the device

Firmware version	01.00.zz	<ul style="list-style-type: none"> ■ On the title page of the Operating instructions ■ On transmitter nameplate(→ 12) ■ Parameter firmware version Diagnostics → Device info → Firmware version
Release date of firmware version	04.2012	—
Manufacturer ID	0x11	Manufacturer ID parameter Diagnostics → Device info → Manufacturer ID
Device type ID	0x66	Device type parameter Diagnostics → Device info → Device type
HART protocol revision	6.0	—
Device revision	1	<ul style="list-style-type: none"> ■ On transmitter nameplate(→ 12) ■ Device revision parameter Diagnostics → Device info → Device revision

9.1.2 Operating tools

The suitable device description file for the individual operating tools is listed in the table below, along with information on where the file can be acquired.

Operating tool via HART protocol	Sources for obtaining device descriptions
Field Xpert SFX100	Use update function of handheld terminal
FieldCare	<ul style="list-style-type: none"> ■ www.endress.com → Download Area ■ CD-ROM (contact Endress+Hauser) ■ DVD (contact Endress+Hauser)
AMS Device Manager (Emerson Process Management)	www.endress.com → Download Area
SIMATIC PDM (Siemens)	www.endress.com → Download Area
Field Communicator 375, 475 (Emerson Process Management)	Use update function of handheld terminal

9.2 Measured variables via HART protocol

The following measured variables (HART device variables) are assigned to the dynamic variables at the factory:

Dynamic variables	Measured variables (HART device variables)
Primary dynamic variable (PV)	Mass flow
Secondary dynamic variable (SV)	Totalizer
Tertiary dynamic variable (TV)	Temperature
Quaternary dynamic variable (QV)	Totalizer

The assignment of the measured variables to the dynamic variables can be modified and assigned as desired via local operation and the operating tool using the following parameters:

- Expert → Communication → HART output → Output → Assign PV
- Expert → Communication → HART output → Output → Assign SV
- Expert → Communication → HART output → Output → Assign TV
- Expert → Communication → HART output → Output → Assign QV

The following measured variables can be assigned to the dynamic variables:

Measured variables for PV (primary dynamic variable)

- Mass flow
- Corrected volume flow
- FAD volume flow
- Temperature

Measured variables for SV, TV, QV (secondary, tertiary and quaternary dynamic variable)

- None
- Mass flow
- Corrected volume flow
- FAD volume flow
- Temperature
- Totalizer

9.3 Other settings

In the **Configuration** submenu, you can configure other settings for the HART protocol (e.g. Burst mode)

Navigation path

"Expert" menu → Communication → HART output → Configuration

10 Commissioning

10.1 Function check


Before commissioning the device, make sure that the post-installation and post-connection checks have been performed.

- "Post-mounting check" checklist (→ 21)
- "Post-connection check" checklist (→ 25)

10.2 Switching on the measuring device


After a successful function check, switch on the measuring device.

After a successful startup, the local display switches automatically from the startup display to the measured value display.

-  If nothing appears on the local display or a diagnostic message is displayed, refer to the section on "Diagnostics and troubleshooting" (→ 79).

10.3 Setting the operating language

Factory setting: English or ordered local language

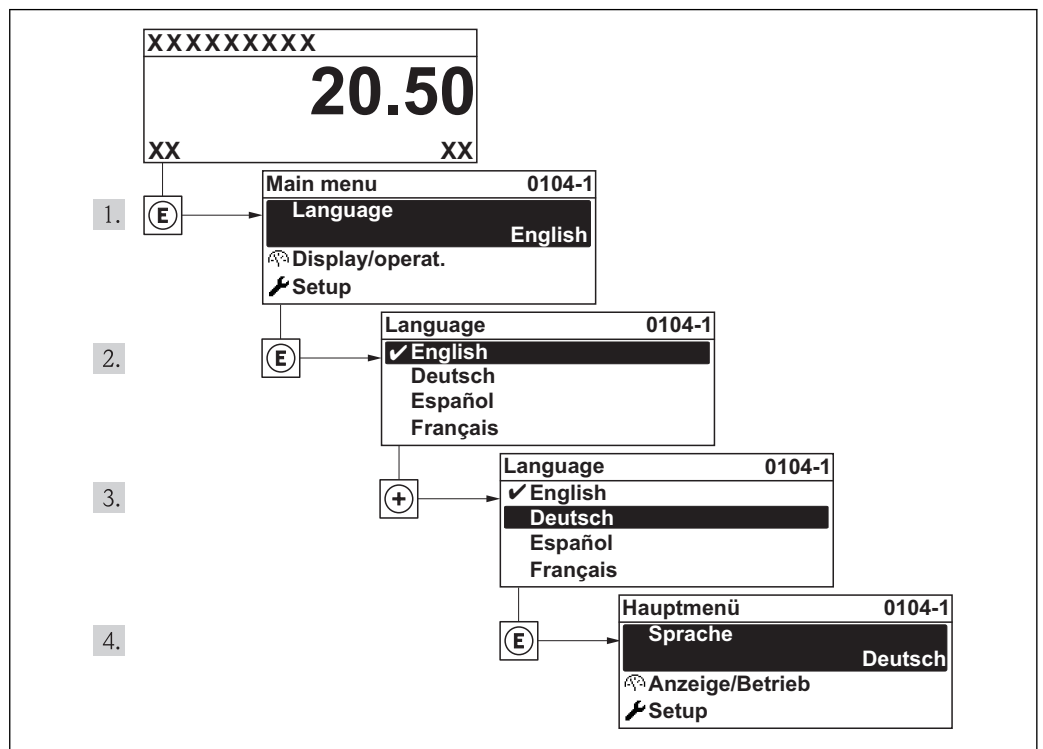


A0013996


10.4 Configuring the measuring device

The **Setup** menu with its guided wizards contains all parameters needed for standard operation.

Navigation to the "Setup" menu

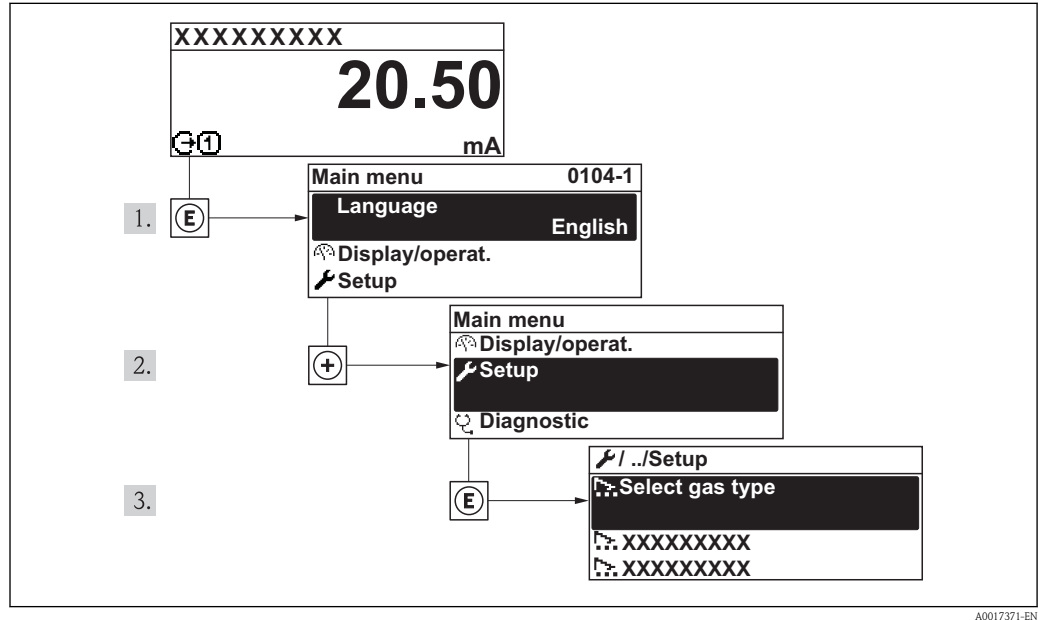

Overview of the "Setup" menu

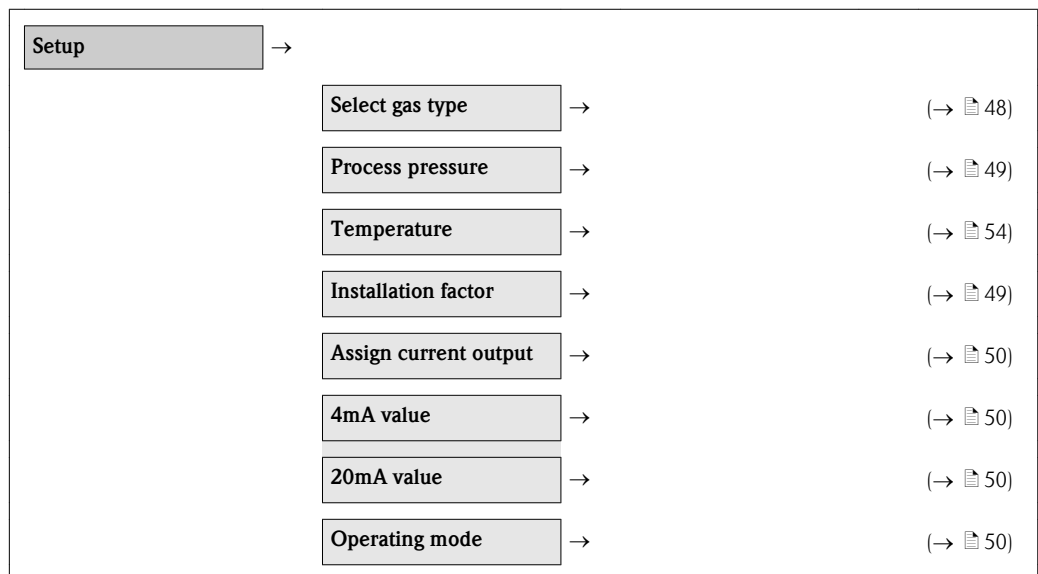

10.4.1 Selecting the gas type

Navigation path

"Setup" menu → Select gas type

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Select gas type	Select the gas type for the measurement application.	Gas type choose list <ul style="list-style-type: none"> ■ Air ■ Argon Ar ■ Carbon dioxide CO2 ■ Nitrogen N2 	Air

10.4.2 Specifying the process pressure**Navigation path**

"Setup" menu → Process pressure

Parameter overview with brief description

Parameter/	Description	Selection/ User entry	Factory setting
Process pressure	Process pressure value for calculating pressure-dependent gas properties	0.5 to 41.6 bar a (7.3 to 603 psi a)	Country-dependent: 1.0130 bar a (14.692 psi a)

10.4.3 Determining the installation factor**Navigation path**

"Setup" menu → Installation factor

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Installation factor	The factor is multiplied by the mass flow to correct sub-optimum installations	0 to 9	1

10.4.4 Configuring the current output

Navigation path

"Setup" menu →Assign current output

"Setup" menu →4mA value

"Setup" menu →20mA value

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Assign current output	Use this function to assign a measured variable or process variable to the current output	Mass flow Corrected volume flow FAD volume flow Temperature	Mass flow
4mA value	Enter the value for the 4 mA current. The value can be larger than or smaller than the 20 mA value assigned. Positive and negative values are permitted depending on the measured variable (e.g. mass flow) assigned.	Number with up to 3 decimal places from - to +. The unit depends on the measured variable assigned.	0
20mA value	Enter the value for the 20 mA current. The value can be larger than or smaller than the 4 mA value assigned. Positive and negative values are permitted depending on the measured variable (e.g. mass flow) assigned.	Number with up to 3 decimal places from - to +. The unit depends on the measured variable assigned.	Maximum calibrated full scale value

10.4.5 Configuring the pulse/frequency/switch output

Navigation path

- "Setup" menu →Operating mode
- "Setup" menu →Assign frequency output
- "Setup" menu →Switch output function
- "Setup" menu →Assign pulse output

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Operating mode	Specify the output as a pulse, frequency or switch output.	<ul style="list-style-type: none"> ■ Pulse ■ Frequency ■ Switch 	Pulse
Assign frequency output	Select the process variable for the frequency output.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature 	Off
Measuring value at minimum frequency	Enter the measured value at the minimum frequency.	Depends on the process variable selected	-
Measuring value at maximum frequency	Specify the measured value at maximum frequency.	Depends on the process variable selected	-

Switch output function	Select the function for the switch output.	<ul style="list-style-type: none"> ■ Off ■ On ■ Diagnostic behavior ■ Limit value ■ Status 	Off
Assign limit	Select the process variable for the limit function.	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer 	Mass flow
Switch-off value	Enter the measured value for the switch-off value.	Depends on the process variable selected	-
Switch-on value	Enter the measured value for the switch-on value.	Depends on the process variable selected	-
Assign diagnostic behavior	Select the diagnostic behavior for the switch output.	<ul style="list-style-type: none"> ■ Alarm ■ Alarm or warning ■ Warning 	Alarm
Assign status	Select the device status for the switch output.	Low flow cut off	Low flow cut off
Assign pulse output	Select the process variable for the pulse output.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Off
Pulse value	Enter the measured value for the pulse output.	Depends on the process variable selected	-


10.5 Advanced settings

The **Advanced setup** menu with its submenus contains all parameters needed for specific settings.

Navigation path


"Setup" menu → Advanced setup

Navigation to the "Advanced setup" submenu

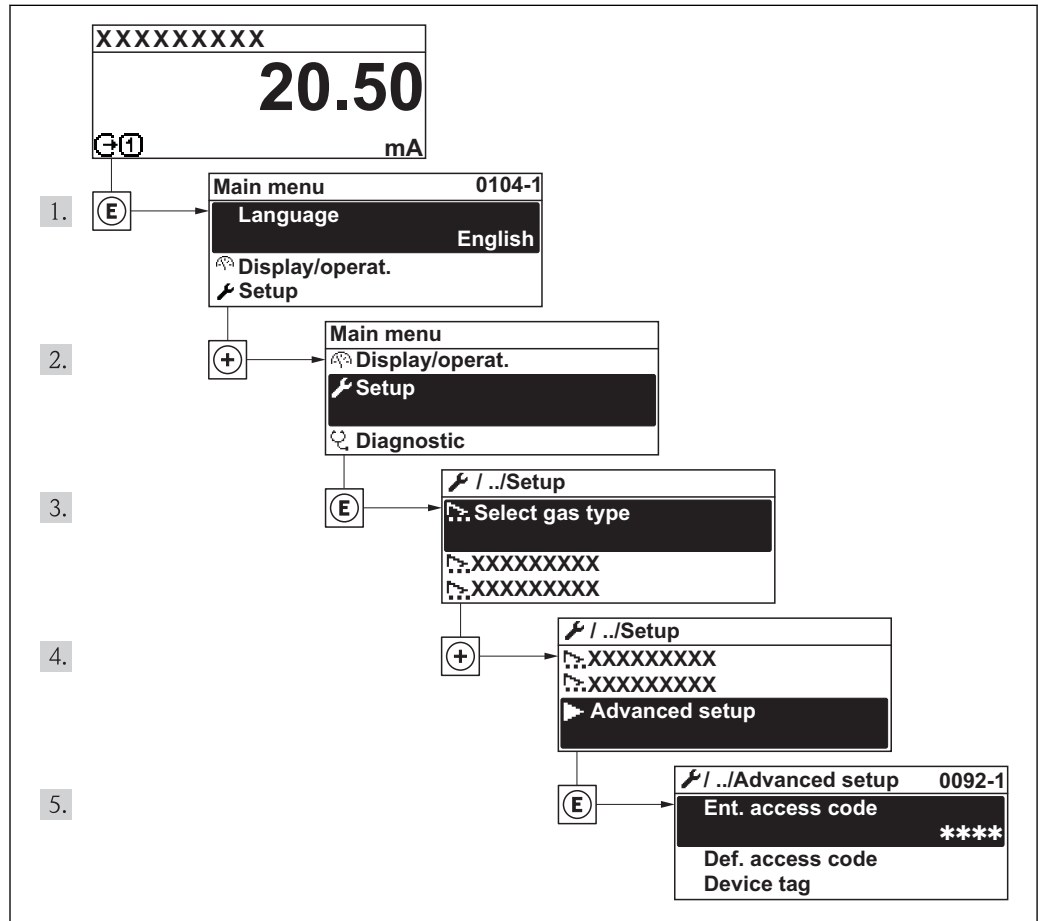


A0017372-EN

Overview of the parameters and submenus in the "Advanced setup" menu

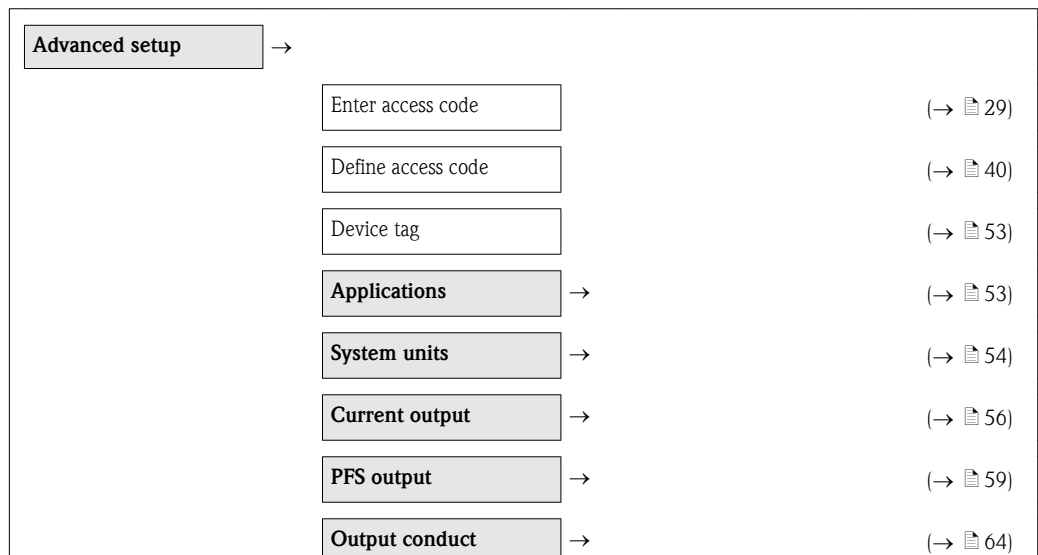

Low flow cut off	→	(→ ⓘ 65)
Totalizer	→	(→ ⓘ 66)
Display	→	(→ ⓘ 48)
Conf. backup disp.	→	(→ ⓘ 47)

10.5.1 Defining the tag name

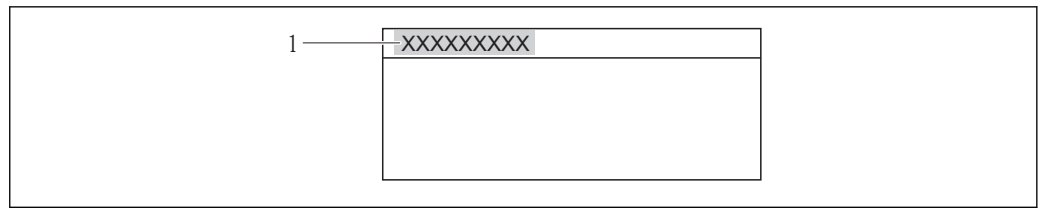

A0013375

1 Device tag

 The number of characters displayed depends on the characters used.

10.5.2 Configuring applications

Navigation path

"Setup" menu → "Advanced setup" → Applications

Parameter overview with brief description

A screenshot of the 'Applications' configuration screen. At the top left, there is a button labeled 'Applications' with a right-pointing arrow. Below it, a list of parameters is shown in rectangular boxes: 'Select gas type', 'Process pressure', 'Temperature', 'Reference operating conditions', 'Reference pressure', and 'Reference temperature'. Below these is a button labeled 'FAD conditions' with a right-pointing arrow. To the right of the 'FAD conditions' button, three more parameters are listed in boxes: 'FAD conditions', 'FAD pressure', and 'FAD temperature'.

Parameter	Description	Selection/ User entry	Factory setting
-----------	-------------	--------------------------	-----------------

Select gas type	Select the gas type for the measurement application.	Gas type choose list <ul style="list-style-type: none"> ■ Air ■ Argon Ar ■ Carbon dioxide CO2 ■ Nitrogen N2 	Air
Process pressure	Process pressure value for calculating pressure-dependent gas properties	0.5 to 41.6 bar a (7.3 to 603 psi a)	Country-dependent: <ul style="list-style-type: none"> ■ 1.01325 bar a ■ 14.696 psi a
Temperature	Use this function to view the process temperature currently measured.	None	-
Reference operating conditions	Select reference operating conditions for calculating the reference density	1013.25 mbar a, 0°C 1013.25 mbar a, 15°C 1013.25 mbar a, 20°C 1013.25 mbar a, 25°C 1000 mbar a, 0°C 1000 mbar a, 15°C 1000 mbar a, 20°C 1000 mbar a, 25°C 14.696 psi a, 59°F 14.696 psi a, 60°F 14.730 psi a, 60°F User-defined	Country-dependent: <ul style="list-style-type: none"> ■ 1 013.25 mbar a, 0 °C ■ 14.696 psi a, 59 °F
Reference pressure	Enter the reference pressure for calculating the reference density	0.1 to 99 bar a (1.5 to 1 436 psi a)	Country-dependent: 1.0130 bar a (14.696 psi a)
Reference temperature	Enter the reference temperature for calculating the reference density	-50 to 150 °C (-58 to 423 °F°)	Country-dependent: <ul style="list-style-type: none"> ■ 0.0 °C ■ 32 °F
FAD conditions	Select reference operating conditions for calculating the FAD density (FAD = free air delivery)	1 000 mbar a, 20 °C 14.504 psi a, 68 °F User-defined	Country-dependent: <ul style="list-style-type: none"> ■ 1 000 mbar a, 20 °C ■ 14.504 psi a, 68 °F
FAD pressure	Enter the reference pressure for calculating the FAD density	0.1 to 99 bar a (1.5 to 1 436 psi a)	Country-dependent: <ul style="list-style-type: none"> ■ 1.000 bar a ■ 14.504 psi a
FAD temperature	Enter the reference temperature for calculating the FAD density	-50 to 150 °C (-58 to 423 °F°)	Country-dependent: <ul style="list-style-type: none"> ■ 20 °C ■ 68 °F


10.5.3 Setting the system units

In the **System units** submenu, you can configure the units of all measured values.

Navigation path

"Setup" menu → Advanced setup → System units

Structure of the submenu

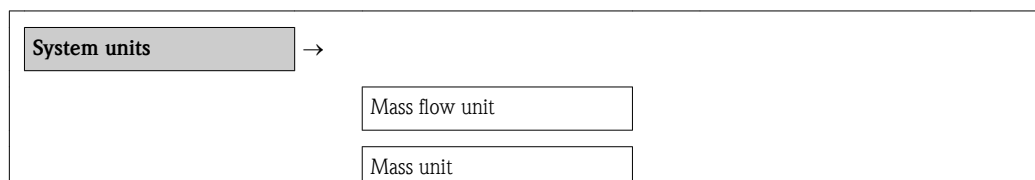

Corrected volume flow unit
Corrected volume unit
FAD volume flow unit
FAD volume unit
Density unit
Pressure unit
Temperature unit
Length unit

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Mass flow unit	Select the unit for mass flow. <i>Result</i> The selected unit applies for all outputs	Metric: Gram: g/s; g/min; g/h; g/day Kilogram: kg/s; kg/min; kg/h; kg/day Metric ton: t/s; t/min; t/h; t/day US: Ounce: oz/s; oz/min; oz/h; oz/day Pound: lb/s; lb/min; lb/h; lb/day ton: LTon/s; LTon/min; LTon/h; LTon/day ton: STon/s; STon/min; STon/h; STon/day Arbitrary unit (see text mass unit function): ___/s; ___/min; ___/h; ___/day	Country-dependent: ■ kg/h ■ lb/h
Mass unit	Select the unit for mass.	g kg t oz lb STon LTon User-defined	Country-dependent: ■ kg ■ lb

Parameter	Description	Selection/ User entry	Factory setting
Corrected volume flow unit	Select the unit for corrected volume flow. <i>Result</i> The selected unit applies for all outputs	NI/s NI/min NI/h NI/d Nm ³ /s Nm ³ /min Nm ³ /h Nm ³ /d Sl/s Sl/min Sl/h Sl/d Sm ³ /s Sm ³ /min Sm ³ /h Sm ³ /d Scf/s Scf/min Scf/h Scf/d	Country-dependent: ■ Nm ³ /h ■ Scf/min
Corrected volume unit	Select the unit for volume.	NI Nm ³ Sl Sm ³ Scf	Country-dependent ■ Nm ³ ■ Scf
FAD volume flow unit	Select the unit for the FAD volume flow. <i>Result</i> The selected unit applies for all outputs	1 FAD/s 1 FAD/min 1 FAD/h 1 FAD/d m ³ FAD/s m ³ FAD/min m ³ FAD/h m ³ FAD/d cf FAD/s cf FAD/min cf FAD/h cf FAD/d	Country-dependent ■ m ³ FAD/h ■ cf FAD/min
FAD volume unit	Select the unit for standard volume.	1 FAD m ³ FAD cf FAD	Country-dependent: ■ m ³ FAD ■ cf FAD
Density unit	Select the unit for density. <i>Result</i> The selected unit applies for all outputs	g/cm ³ kg/dm ³ kg/l kg/m ³ lb/cf	Country-dependent ■ kg/m ³ ■ lb/cf
Pressure unit	Select the unit for process pressure.	kPa a MPa a bar a psi a mbar	Country-dependent: ■ bar a ■ psi a
Temperature unit	Select the unit for temperature. <i>Result</i> The selected unit applies for all outputs	°C °F K °R	Country-dependent: ■ °C (Celsius) ■ °F (Fahrenheit)
Length unit	Select the unit of length for the nominal diameter.	mm m in ft	Country-dependent: ■ mm ■ in


10.5.4 Configuring the current output

In the **Current output** submenu, you can configure the values for the current output.

Navigation path

"Setup" menu → Advanced setup → Current output

Structure of the submenu

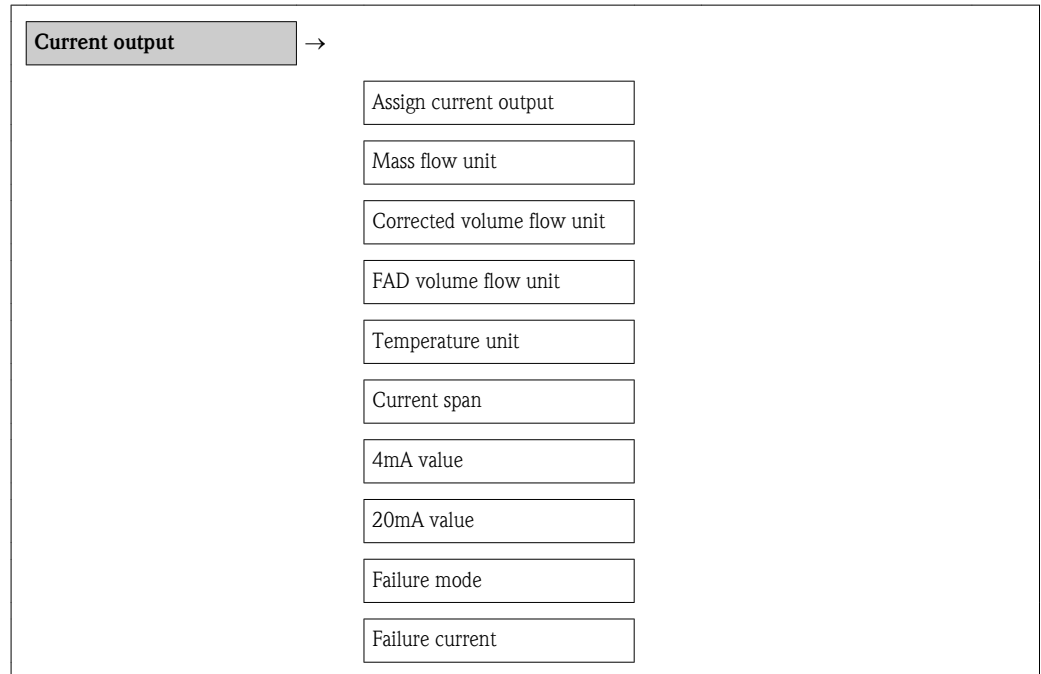

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Assign current output	Use this function to assign a measured variable or process variable to the current output	Mass flow Corrected volume flow FAD volume flow Temperature	Mass flow
Mass flow unit	Select the unit for mass.	Metric: Gram: g/s; g/min; g/h; g/day Kilogram: kg/s; kg/min; kg/h; kg/day Metric ton: t/s; t/min; t/h; t/day US: Ounce: oz/s; oz/min; oz/h; oz/day Pound: lb/s; lb/min; lb/h; lb/day ton: LTon/s; LTon/min; LTon/h; LTon/day ton: STon/s; STon/min; STon/h; STon/day Arbitrary unit (see TEXT mass unit function): ___ _/s; ___/min; ___ _/h; ___/day	Country-dependent: ■ kg/h ■ lb/h

Parameter	Description	Selection/ User entry	Factory setting
Corrected volume flow unit	Select the unit for corrected volume flow. <i>Result</i> The selected unit applies for all outputs	Unit choose list NI/s NI/min NI/h NI/d Nm ³ /s Nm ³ /min Nm ³ /h Nm ³ /d Sl/s Sl/min Sl/h Sl/d Sm ³ /s Sm ³ /min Sm ³ /h Sm ³ /d Scf/s Scf/min Scf/h Scf/d	Country-dependent: ■ Nm ³ /h ■ Scf/min
FAD volume flow unit	Select the unit for the FAD volume flow. <i>Result</i> The selected unit applies for all outputs	Unit choose list 1 FAD/s 1 FAD/min 1 FAD/h 1 FAD/d m ³ FAD/s m ³ FAD/min m ³ FAD/h m ³ FAD/d cf FAD/s cf FAD/min cf FAD/h cf FAD/d	Country-dependent: ■ m ³ FAD/h ■ cf FAD/min
Temperature unit	Select the unit for temperature. <i>Result</i> The selected unit applies for all outputs	°C °F K °R	Country-dependent: ■ °C (Celsius) ■ °F (Fahrenheit)
Current span	Select the current range for the process value output and for the upper/lower level for signal on alarm	Options 4 to 20mA HART NAMUR 4 to 20mA HART US 4 to 20mA FIXED CURRENT	4 to 20mA HART NAMUR
4mA value	Enter the value for the 4 mA current. The value can be larger than or smaller than the 20 mA value assigned. Positive and negative values are permitted depending on the measured variable (e.g. mass flow) assigned.	Number with up to 3 decimal places from - to +. The unit depends on the measured variable assigned.	0
20mA value	Enter the value for the 20 mA current. The value can be larger than or smaller than the 4 mA value assigned. Positive and negative values are permitted depending on the measured variable (e.g. mass flow) assigned.	Number with up to 3 decimal places from - to +. The unit depends on the measured variable assigned.	Nominal size dependent

Parameter	Description	Selection/ User entry	Factory setting
Failure mode	Select the value the current output adopts in an alarm condition. Prerequisite: The "FIXED CURRENT" option was not selected in the CURRENT SPAN function (xxxx).	<ul style="list-style-type: none"> ■ Min. current ■ Max. current ■ Last valid value ■ Actual value ■ Defined value 	Max. current
Failure current	Select the current value the current output adopts in an alarm condition.	Floating point number with 2 decimal places in the range 3.6 to 22.5 mA	22.5 mA


10.5.5 Configuring the PFS output

In the **PFS output** submenu, you can configure the values for the current output.

Navigation path

"Setup" menu → Advanced setup → PFS output

Structure of the submenu

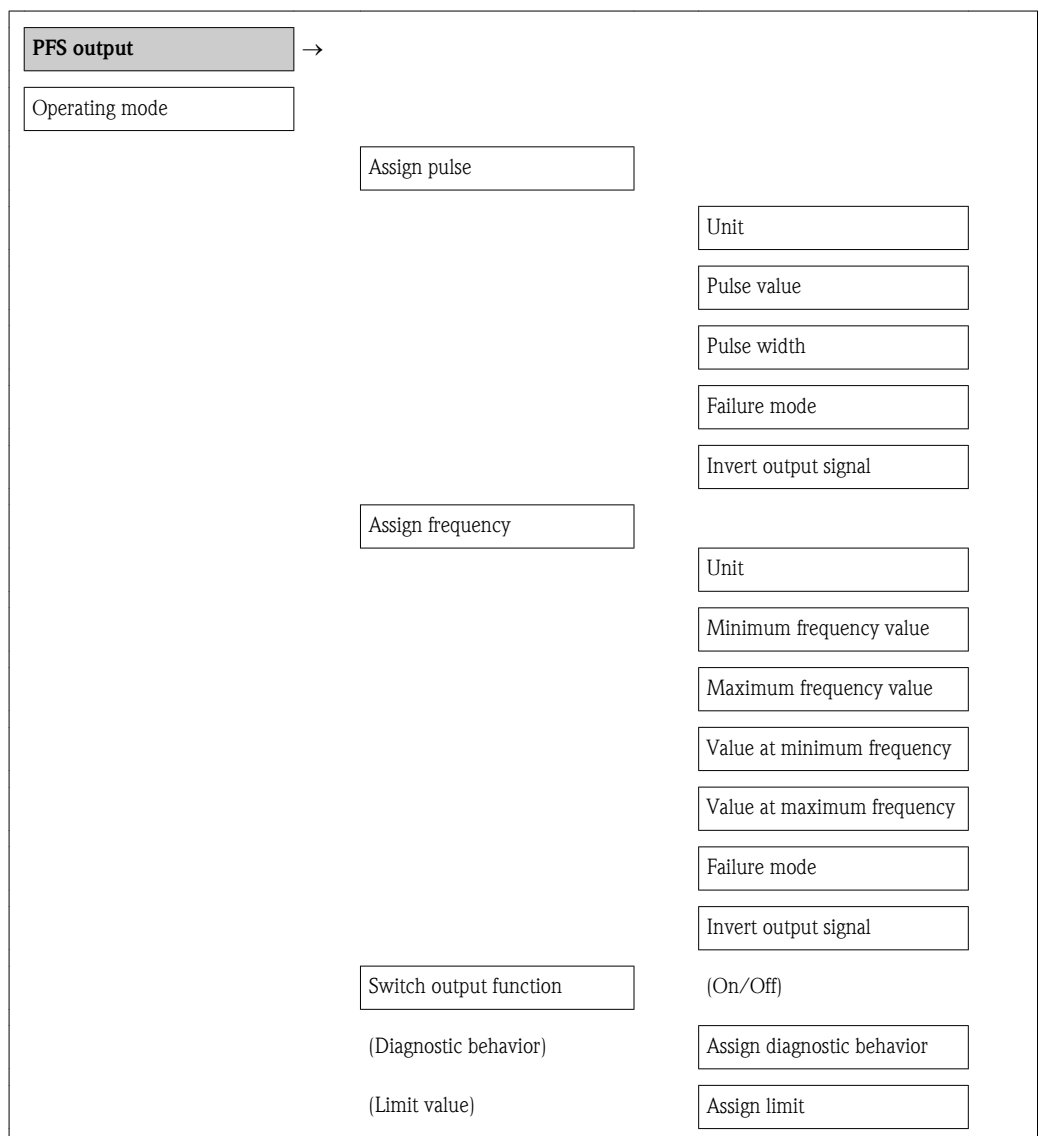

(Status)	Switch-on value
	Switch-off value
	Assign status
	Switch-on delay
	Switch-off delay
	Failure mode
	Switch status
	Invert output signal

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Operating mode	Specify the output as a pulse, frequency or switch output.	<ul style="list-style-type: none"> ■ Pulse ■ Frequency ■ Switch 	Pulse
Assign pulse output	Select the process variable for the pulse output.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Off
Assign frequency output	Select the process variable for the frequency output.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature 	Off
Assign switch output	Select the function for the switch output.	<ul style="list-style-type: none"> ■ Off ■ On ■ Diagnostic behavior ■ Limit value ■ Status 	Off
Assign diagnostic behavior	Select the diagnostic behavior for the switch output.	<ul style="list-style-type: none"> ■ Alarm ■ Alarm or warning ■ Warning 	Alarm
Assign limit	Select the process variable for the limit function.	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Totalizer 	Mass flow
Assign status	Select the device status for the switch output.	Low flow cut off	Low flow cut off

Parameter	Description	Selection/ User entry	Factory setting
Mass flow unit	Select the unit for mass flow. <i>Result</i> The selected unit applies for all outputs	Metric: Gram: g/s; g/min; g/h; g/day Kilogram: kg/s; kg/min; kg/h; kg/day Metric ton: t/s; t/min; t/h; t/day US: Ounce: oz/s; oz/min; oz/h; oz/day Pound: lb/s; lb/min; lb/h; lb/day ton: LTon/s; LTon/min; LTon/h; LTon/day ton: STon/s; STon/min; STon/h; STon/day Arbitrary unit (see Text mass unit function: ___ _/s; ___/min; ___ _/h; ___/day	Country-dependent: ■ kg/h ■ lb/h
Mass unit	Select the unit for mass. <i>Result</i> The selected unit is taken from: Mass flow unit	g kg t oz lb STon LTon User-defined	Country-dependent: ■ kg ■ lb
FAD volume flow unit	Use this function to select the preferred unit that is to be displayed for the FAD volume flow. The following time units can be selected: s = second, m = minute, h = hour, d = day Select the unit for the FAD volume flow. <i>Result</i> The selected unit applies for all outputs	1 FAD/s 1 FAD/min 1 FAD/h 1 FAD/d m ³ FAD/s m ³ FAD/min m ³ FAD/h m ³ FAD/d cf FAD/s cf FAD/min cf FAD/h cf FAD/d	Country-dependent: ■ m ³ FAD/h ■ cf FAD/min
FAD volume unit	Select the unit for the FAD volume unit.	1 FAD m ³ FAD cf FAD	Country-dependent: ■ m ³ FAD ■ cf FAD
Corrected volume flow unit	Select the unit for corrected volume flow. <i>Result</i> The selected unit applies for all outputs	NI/s NI/min NI/h NI/d Nm ³ /s Nm ³ /min Nm ³ /h Nm ³ /d Sl/s Sl/min Sl/h Sl/d Sm ³ /s Sm ³ /min Sm ³ /h Sm ³ /d Scf/s Scf/min Scf/h Scf/d	Country-dependent: ■ Nm ³ /h ■ scf/min (us)

Parameter	Description	Selection/ User entry	Factory setting
Corrected volume unit	Select the unit for standard volume. The unit selected here also applies for all outputs	Nl Nm ³ Sl Sm ³ Scf	Country-dependent: ■ Nm ³ ■ Scf
Temperature unit	Select the unit for temperature. <i>Result</i> The selected unit applies for: – Current outputs – Reference temperature – Simulation process variable	°C °F K °R	Country-dependent: ■ °C (Celsius) ■ °F (Fahrenheit)
Pulse value	Enter the measured value for the pulse output.	Depends on the process variable selected	–
Pulse width	Specify the duration of the output pulse.	0.5 to 2 000 msec	20 msec
Failure mode	Select the value the current output adopts in an alarm condition. Prerequisite: The "FIXED CURRENT" option was not selected in the CURRENT SPAN function (xxxx).	■ Min. current ■ Max. current ■ Last valid value ■ Actual value ■ Defined value	Max. current
Minimum frequency value	Enter the minimum frequency value.	0 to 1 000 Hertz	0 Hertz
Maximum frequency value	Enter the maximum frequency value.	0 to 1 000 Hertz	1 000 Hertz
Measuring value at minimum frequency	Enter the measured value at the minimum frequency.	Depends on the process variable selected	–
Measuring value at maximum frequency	Specify the measured value at maximum frequency.	Depends on the process variable selected	–
Failure mode	Specify the output behavior in the event of a device alarm	■ 0 Hertz ■ Actual value ■ Defined value	0 Hertz
Failure frequency	Enter the value for the frequency output in the event of a device alarm	0 to 1 250 Hertz	0 Hertz
Switch-on value	Enter the measured value for the switch-on value.	Depends on the process variable selected	–
Switch-off value	Enter the measured value for the switch-off value.	Depends on the process variable selected	–
Switch-on delay	Specify the delay time for switching on the switch output	0.0 to 100.0 sec	0 sec
Switch-off delay	Specify the delay time for switching off the switch output	0.0 to 100.0 sec	0 sec

Parameter	Description	Selection/ User entry	Factory setting
Failure mode	Specify the output behavior in the event of a device alarm Failsafe mode, The failsafe mode defines how the pulse output responds to a status message which is supposed to act on the status output.	Current status Open Closed	Open
Invert output signal	Invert the output signal	Yes No	No


10.5.6 Configuring the output conditioning

The damping and the step response time can be configured in the **Display behavior** submenu.

Navigation path

"Setup" menu → Advanced setup → Output conditioning

Structure of the submenu

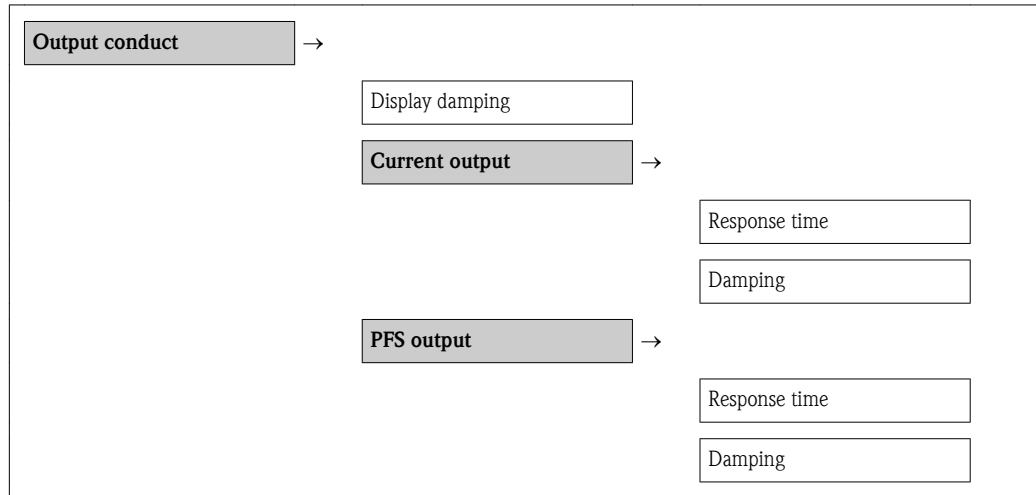

Parameter overview with brief description


Parameter	Description	Selection/ User entry	Factory setting
Display damping	Set the reaction time of the local display to fluctuations in the measured value.	0.0 to 999.9 sec	0.0
Response time Output	Displays the calculated step response time	-	0
Output damping	Set the reaction time of the output signal to fluctuations in the measured value.	0.0 to 999.9 sec	0.0

10.5.7 Configuring the low flow cut off

Navigation path

"Setup" menu → "Advanced setup" menu → Low flow cut off

Structure of the submenu

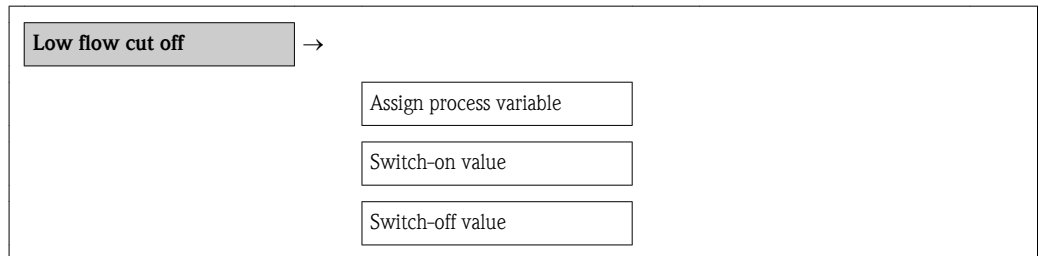

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Assign process variable	Select the process variable for low flow cut off.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Off
On-value, low flow cut off	Enter the on value for low flow cut off	Max. 15-digit, positive floating-point number	Nominal size dependent 1 % of calibrated full scale value
Off value low flow cutoff	Enter the off value for low flow cut off	0 to 100 %	50 %


10.5.8 Configuring the totalizer

You can configure the totalizer in the **Totalizer** submenu.

Navigation path

"Setup" menu → Advanced setup → Totalizer

Structure of the submenu

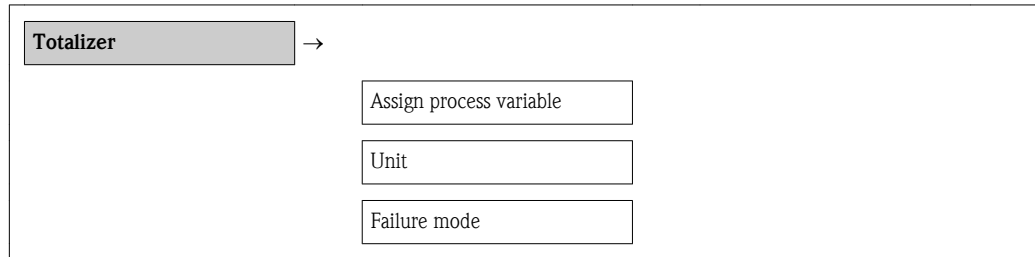

Parameter overview with brief description

Parameter	Prerequisite	Description	Selection/ User entry	Factory setting
Assign process variable	-	Select process variable for totalizer. <i>Result</i> The selection determines the choose list of the Unit parameter.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Mass flow
Unit	One of the following options is selected in the Assign process variable parameter: <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Select the unit for the process variable of the totalizer.	Unit choose list	Country-dependent: <ul style="list-style-type: none"> ■ kg ■ lb
Failure mode	One of the following options is selected in the Assign process variable parameter: <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Define how the totalizer behaves in an alarm condition.	<ul style="list-style-type: none"> ■ Stop ■ Actual value ■ Last valid value 	Stop

10.5.9 Configuring the local display

Navigation path

"Setup" menu → "Advanced setup" menu → "Display" menu

Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Format display	Select how measured values are shown on the display.	<ul style="list-style-type: none"> ■ 1 value, max. size ■ 1 bargraph + 1 value ■ 2 values ■ 1 value large + 2 values ■ 4 values 	1 value, max. size

Value 1 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer ■ Current output 	Mass flow
0% bargraph value 1	Enter the 0% value to be shown on the bargraph display for the measured value 1.	Floating-point number with sign	0
100% bargraph value 1	Enter the 100% value to be shown on the bargraph display for the measured value 1.	Floating-point number with sign	1
Decimal places 1	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> x x.x x.xx x.xxx x.xxxx 	x.xx
Value 2 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ■ None ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer ■ Current output 	None
Decimal places 2	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> x x.x x.xx x.xxx x.xxxx 	x.xx
Value 3 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ■ None ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer ■ Current output 	None
0% bargraph value 3	Enter the 0% value to be shown on the bargraph display for the measured value 3.	Floating-point number with sign	0
100% bargraph value 3	Enter the 100% value to be shown on the bargraph display for the measured value 3.	Floating-point number with sign	0
Decimal places 3	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> x x.x x.xx x.xxx x.xxxx 	x.xx
Value 4 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ■ None ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer ■ Current output 	None

Decimal places 4	Select the number of decimal places for the display value.	x x.X x.XX x.XXX x.XXXX	x.xx
Display interval	Set time measured values are shown on display if display alternates between values.	1 to 10	5
Display damping	Set the reaction time of the local display to fluctuations in the measured value.	0.0 to 999.9	0
Header	Select header contents on local display.	Device tag Free text	Device tag
Header text	Select text for header on local display.	Free text	–
Separator	Select decimal separator for displaying numerical values.	. ,	.


10.6 Configuration management

After commissioning, you can save the current device configuration, copy it to another measuring point or restore the previous device configuration.


You can do so using the **Configuration management** parameter and the related options found in the **Conf. backup display** submenu.

Navigation path

"Setup" menu → Advanced setup → Conf. backup disp.

 While this action is in progress, the configuration cannot be edited via the local display and a message on the processing status appears on the display.

Structure of the submenu

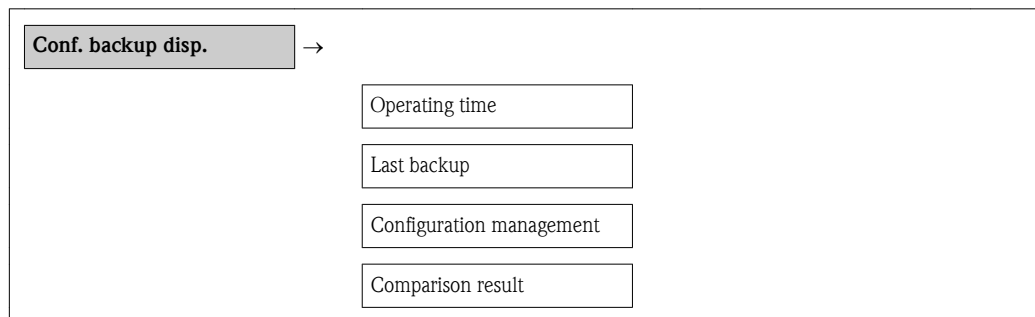

Parameter overview with brief description

Parameter	Description	Selection/Display	Factory setting
Operating time	Indicates how long the device has been in operation up to this point.	Days (d), hours (h), minutes (m), seconds (s)	–
Last backup	Indicates when the last data backup was saved to the display module	Days (d), hours (h), minutes (m), seconds (s)	–

Configuration management	Select action for managing the device data in the display module	<ul style="list-style-type: none"> ■ Cancel ■ Execute backup ■ Restore ■ Duplicate ■ Compare ■ Clear backup data 	Cancel
Comparison result	Comparison between present device data and display backup	<ul style="list-style-type: none"> ■ Settings identical ■ Settings not identical ■ No backup available ■ Backup settings corrupt ■ Check not done ■ Dataset incompatible 	Check not done


10.7 Simulation

The **Simulation** submenu enables you to simulate, without a real flow situation, various process variables in the process and the device alarm mode and to verify downstream signal chains (switching valves or closed-control loops).

Navigation path

"Diagnostics" menu → Simulation

Structure of the submenu

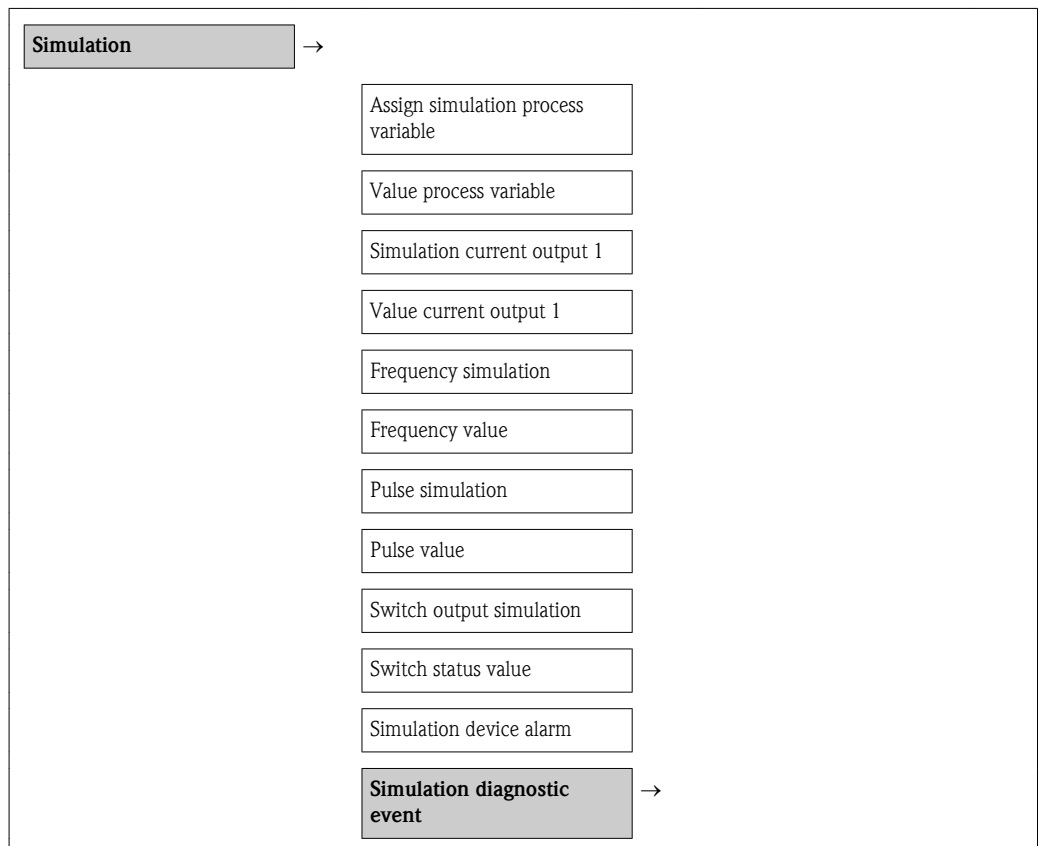

Parameter overview with brief description

Parameter	Prerequisite	Description	Selection/ User entry	Factory setting
-----------	--------------	-------------	--------------------------	-----------------

Assign simulation process variable	-	Select a process variable for the simulation process that is activated.	<ul style="list-style-type: none"> ■ Off ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature 	Off
Value process variable	One of the following options must be selected in the Assign simulation process variable parameter: <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature 	Enter the simulation value for the selected process variable.	Depends on the process variable selected	-
Simulation current output	-	Switch simulation of the current output on and off.	<ul style="list-style-type: none"> ■ On ■ Off 	Off
Value current output	The On option is selected in the Simulation current output parameter.	Enter the current value for simulation.	3.6 to 22.5 mA	Current value currently measured
Frequency simulation	Frequency must be selected in the Operating mode parameter.	Switch simulation of the frequency output on and off.	<ul style="list-style-type: none"> ■ On ■ Off 	Off
Frequency value	The On option is selected in the Frequency simulation parameter.	Enter the frequency for simulation.	0.0 to 1 250 Hz	Frequency currently measured
Pulse simulation	Pulse must be selected in the Operating mode parameter.	Pulse output simulation can be switched on and off in this way.	<ul style="list-style-type: none"> ■ On ■ Off 	Off
Pulse value	The On option is selected in the Pulse simulation parameter.	Enter the pulse counter value for the simulation and display the current counter value	<ul style="list-style-type: none"> ■ Off ■ Fixed value ■ Down-count. value 	0
Switch output simulation	Switch must be selected in the Operating mode parameter.	Switch simulation of the switch output on and off.	<ul style="list-style-type: none"> ■ On ■ Off 	Off
Switch value	The On option is selected in the Switch output simulation parameter.	Enter the current value for simulation.	Open Closed	Open
Simulation device alarm	-	Switch the device alarm on and off.	<ul style="list-style-type: none"> ■ On ■ Off 	Off

10.8 Protecting settings from unauthorized access


The following options exist for protecting the configuration of the measuring device from unintentional modification after commissioning:

- Write protection via access code (→ [70](#))
- Write protection via write protection switch (→ [70](#))
- Write protection via keypad lock (→ [29](#))

10.8.1 Write protection via access code


Using the customer-specific access code, the parameters for the measuring device configuration are write-protected and their values can no longer be changed via local operation.

Define access code



1. Navigating to the "Define access code" parameter: Setup → Advanced setup → Def. access code
2. Define a max. 4-digit numeric code as an access code.
 - ✓ The -symbol appears in front of all write-protected parameters.

Parameters that can always be changed

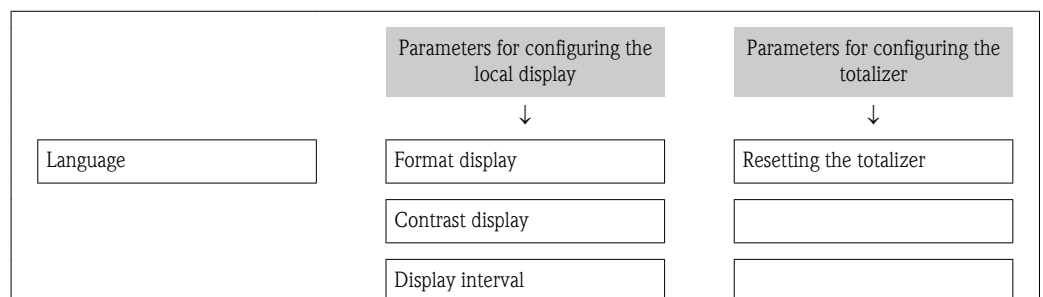The write protection does not include certain parameters that do not affect the measurement. Despite the defined access code, these parameters can always be modified even if the other parameters are locked.




The device automatically locks the write-protected parameters again if a key is not pressed for 10 minutes in the navigation and editing view. The device locks the write-protected parameters automatically after 60 s if the user skips back to the measured value display mode from the navigation and editing view.

-  If write access is activated via access code, it can be also be deactivated only via the access code (→ [40](#)).
- In the "Description of Device Parameters" documents, each write-protected parameter is identified with the .

10.8.2 Write protection via write protection switch


Unlike write protection via user-specific access code, this allows write access to the entire operating menu - other than the **Contrast display** parameter - to be locked.

The values of the parameters are still visible, but can no longer be changed (except for **Contrast display**), either via the local display, the service interface (CDI) or HART protocol.

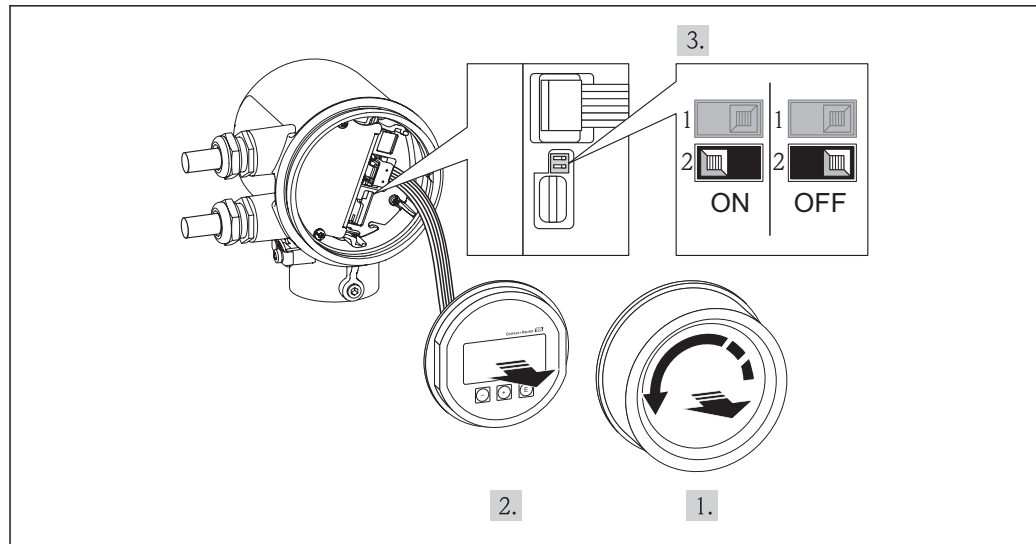


A0017255


1. Unscrew the electronics compartment cover.
2. Pull out the display module with a gentle rotational movement.
- 3.

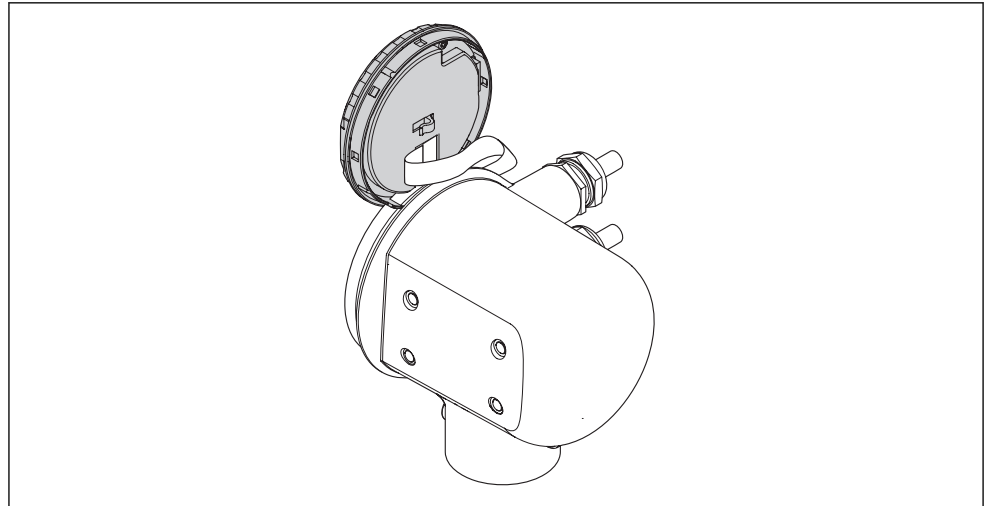


A0017375

To make it easier to access the lock switch, attach the display module to the edge of the electronics compartment.

4. Setting the write protection switch (WP) on the main electronics module to the ON position enables the hardware write protection. Setting the write protection switch (WP) on the main electronics module to the OFF position (factory setting) disables the hardware write protection.
 - ✓ If the hardware write protection is enabled, the  symbol appears before the parameters in the header of the measured value display and in the navigation view.

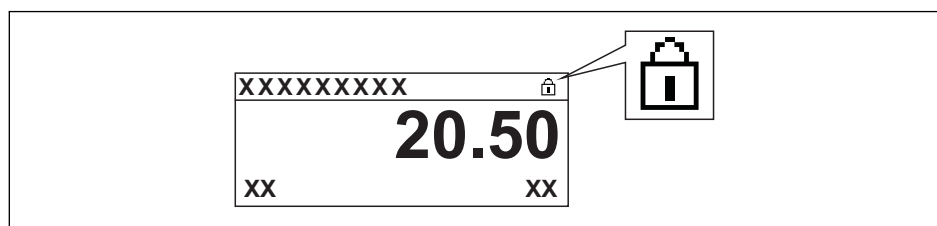

A0015870

If the hardware write protection is disabled, the  symbol does not appear before the parameters in the header of the measured value display and in the navigation view.

5. Feed the ribbon cable into the gap between the housing and electronics module and plug the display module into the electronics compartment in the desired direction until it engages.
6. Screw down the electronics compartment cover

11 Operation

11.1 Adjusting the operating language

See the "Commissioning" section for information on how to set the operating language (→ 47).


11.2 Configuring the display

- Basic settings for local display
- Advanced settings for local display (→ 52)

11.2.1 Navigation path

"Display/operat." menu

"Display" submenu

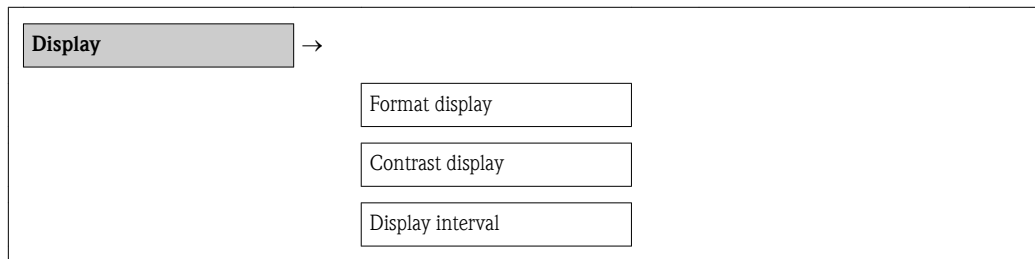

11.2.2 Parameter overview with brief description

Parameter	Description	Selection/ User entry	Factory setting
Format display	Select how measured values are shown on the display.	<ul style="list-style-type: none"> ■ 1 value, max. size ■ 1 bargraph + 1 value ■ 2 values ■ 1 value large + 2 values ■ 4 values 	1 value, max. size
Contrast display	Adjust the contrast of the local display to ambient conditions (reading angle).	20 to 50 %	30 %
Display interval	Set time measured values are shown on display if display alternates between values.	1 to 10	5

11.3 Reading measured values

You can read all measured values using the **Measured values** menu.

Navigation path

Diagnostics → Measured values

11.3.1 Process variables

The **Process variables** submenu contains all the parameters needed to display the current measured values for every process variable.

Navigation path


"Diagnostics" menu → Measured values → Process variables

Temperature display navigation path

The temperature display can also be viewed directly in the Setup menu:

"Setup" menu → Temperature

Structure of the submenu

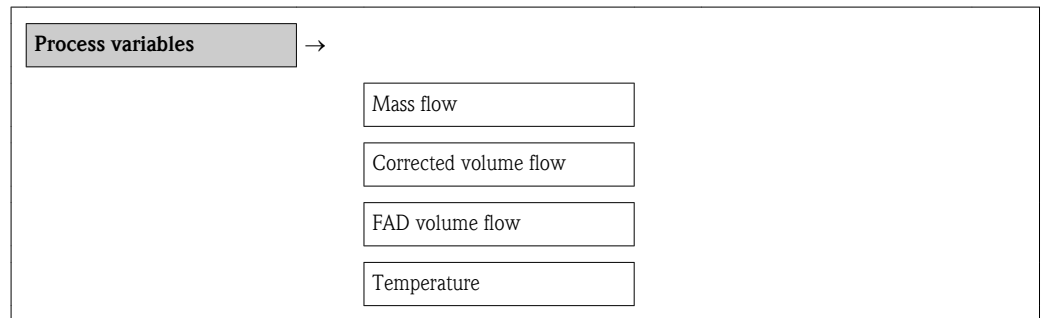

Parameter overview with brief description

Parameter	Description	Display
Mass flow	Displays the mass flow currently calculated	Floating-point number with sign
Corrected volume flow	Displays the calculated volume flow	Floating-point number with sign
FAD volume flow	Displays the FAD volume flow currently calculated	Floating-point number with sign
Temperature	Displays the current process temperature	Floating-point number with sign


11.3.2 Totalizer

The **Totalizer** submenu contains all the parameters needed to display the current measured values for every totalizer.

Navigation path

"Diagnostics" menu → Measured values → Totalizer

Structure of the submenu

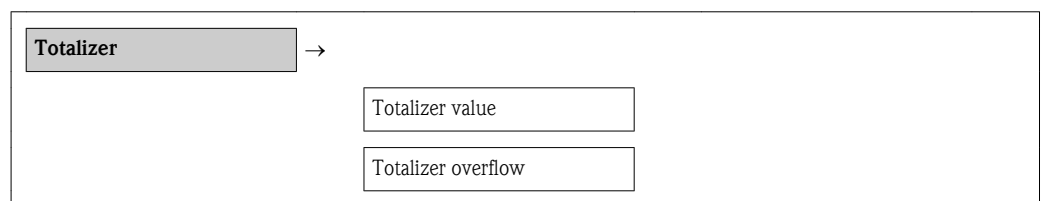

Parameter overview with brief description

Parameter	Prerequisite	Description	Display
-----------	--------------	-------------	---------

Totalizer value	One of the following options is selected in the Assign process variable parameter of the Totalizer submenu: <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Displays the current totalizer counter value.	Floating-point number with sign
Totalizer overflow	One of the following options is selected in the Assign process variable parameter of the Totalizer submenu: <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow 	Displays the number of totalizer overflows. Value range:0 to 32 000	Integer


11.3.3 Output values

The **Output values** submenu contains all the parameters needed to display the current measured values for every output.

Navigation path

"Diagnostics" menu → Measured values → Output values

Structure of the submenu

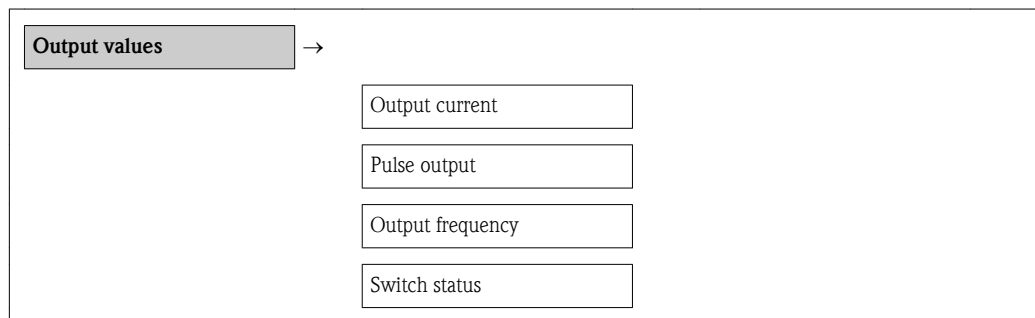

Parameter overview with brief description

Parameter	Prerequisite	Description	Display
Output current	-	Displays the current current value of the current output.	3.6 to 22.5 mA
Pulse output	Pulse must be selected as the operating mode.	Displays the current value of the pulse output.	Positive floating-point number
Output frequency	Frequency must be selected as the operating mode.	Displays the current value of the frequency output.	0.0 to 1 000 Hz (Up to 1 250 Hz in the error mode)
Switch status	Switch must be selected as the operating mode.	Displays the current switch output status.	<ul style="list-style-type: none"> ■ Open ■ Closed

11.4 Adapting the measuring device to the process conditions

The following are available for this purpose:

- Basic settings using the **Setup** (→ 48) menu
- Advanced settings using the **Advanced setup** (→ 52) menu

11.5 Performing a totalizer reset

In the **Operation** submenu, 2 parameters with various options for resetting the totalizers are available:

- Control totalizer
- Preset value
- Resetting the totalizer

Navigation path

"Display/operat." menu → Operation


Function scope of the "Control totalizer" parameter

Options	Description
Reset + hold	The totaling process is stopped and the totalizer is reset to 0.
Preset + hold	The totaling process is stopped and the totalizer is set to the defined start value in the Preset parameter.
Reset + totalize	The totalizer is reset to 0 and the totaling process is restarted.
Preset + totalize	The totalizer is set to the defined start value in the Preset parameter and the totaling process is restarted.

Function scope of the "Reset totalizer" parameter

Options	Description
Reset + totalize	Resets the totalizer to 0 and restarts the totaling process. This deletes all the flow values previously totalized.

"Operation" submenu

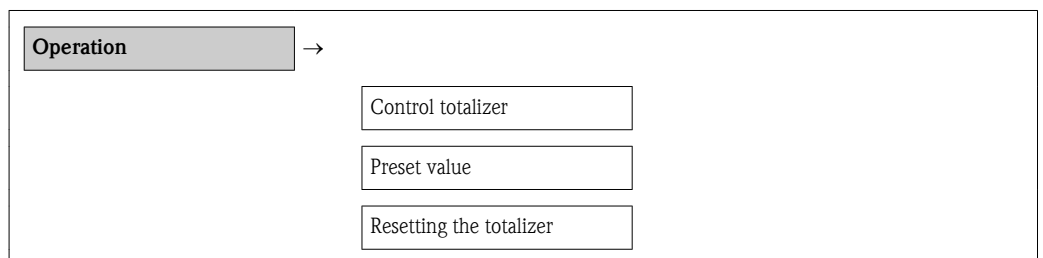

Parameter overview with brief description

Parameter	Prerequisite	Description	Selection/ User entry	Factory setting
Control totalizer		Control totalizer value.	<ul style="list-style-type: none"> ■ Totalize ■ Reset + hold ■ Preset + hold ■ Reset + totalize ■ Preset + totalize 	Totalize
Preset value		Specify start value for totalizer.	Floating-point number with sign	0

Reset all totalizers	-	Reset the totalizer to 0 and start.	<ul style="list-style-type: none"> ■ Cancel ■ Reset + totalize 	Cancel
----------------------	---	-------------------------------------	--	--------


11.6 Showing data logging

In the device, the extended function of the HistoROM must be enabled (order option) so that the **Data logging** submenu appears. This contains all the parameters for the measured value history.

Navigation path


Diagnostics → Data logging


"Data logging" submenu

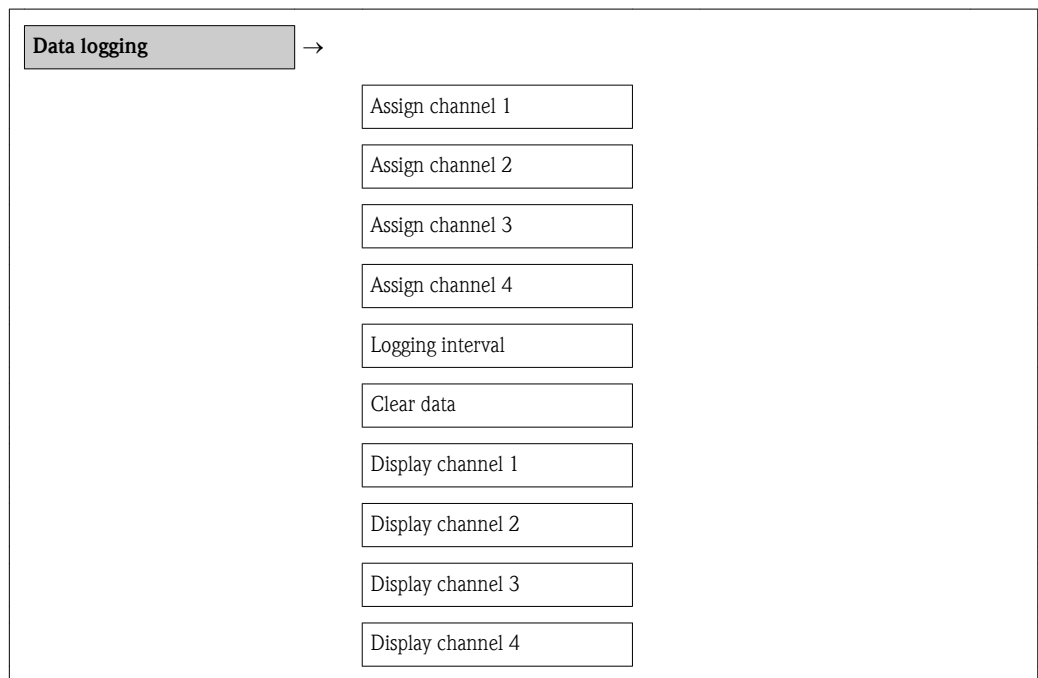

Function range


- A total of 1000 measured values can be stored
- 4 logging channels
- Adjustable logging interval for data logging
- Display of the measured value trend for each logging channel in the form of a chart

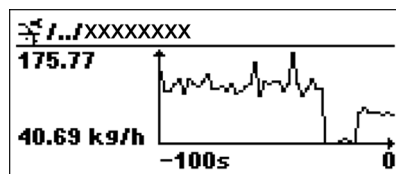

 5 Chart of a measured value trend


 
 



 
 





A0013859


- x-axis: depending on the number of channels selected displays 250 to 1000 measured values of a process variable.
- y-axis: displays the approximate measured value span and constantly adapts this to the ongoing measurement.

 If the length of the logging interval or the assignment of the process variables to the channels is changed, the content of the data logging is deleted.

12 Diagnostics and troubleshooting

  12.1 General troubleshooting


Problem	Possible cause	Remedy
Local display dark and no signal output at current output (0 mA)	Supply voltage does not match that specified on the nameplate.	Apply the correct supply voltage (→  22).
Local display dark and no signal output at current output (0 mA)	Supply voltage has incorrect polarity.	Reverse polarity of supply voltage.
Local display dark and no signal output at current output (0 mA)	No contact between connecting cables and terminals.	Check the connection of the cables and correct if necessary.
Local display dark and no signal output at current output (0 mA)	Terminals are not plugged into the electronics module correctly.	Check terminals.
Local display dark and no signal output at current output (0 mA)	Electronics module is defective.	Order spare part (→  90).
Local display is dark, but signal output is within the valid current range (3.6 to 22 mA)	Display is set too bright or too dark.	<ul style="list-style-type: none"> ■ Set the display brighter by simultaneously pressing  + . ■ Set the display darker by simultaneously pressing  + .
Local display is dark, but signal output is within the valid current range (3.6 to 22 mA)	Ribbon cable of the display module is not plugged in correctly.	Insert the plug correctly into the main electronics module and display module.
Local display is dark, but signal output is within the valid current range (3.6 to 22 mA)	Display module is defective.	Order spare part (→  90).
Signal output outside the valid current range (< 3.6 mA or > 22 mA)	Main electronics module is defective.	Order spare part (→  90).
Device shows correct value on local display, but signal output is incorrect, though in the valid current range.	Configuration error	Check and correct parameter configuration.
Device measures incorrectly.	Configuration error or device is operated outside the application.	<ol style="list-style-type: none"> 1. Check and correct parameter configuration. 2. Observe limit values specified in the "Technical Data".
Text on measured value display and in navigation view appears in a foreign language and cannot be understood.	Incorrect operating language is configured.	<ol style="list-style-type: none"> 1. Press  +  for 2 s ("home position"). 2. Press . 3. Set the desired language in the Language parameter.
No connection via HART protocol	Missing or incorrectly installed communication resistor.	Install the communication resistor (250 Ω) correctly. Observe the maximum load (→  22).
No connection via HART protocol	Commubox <ul style="list-style-type: none"> ■ Connected incorrectly ■ Configured incorrectly ■ Drivers not installed correctly ■ USB or COM interface on computer configured incorrectly 	Observe the documentation for the Commubox. <ul style="list-style-type: none">  ■ FXA 191 HART: Document "Technical Information" T100237F ■ FXA 195 HART: Document "Technical Information" T100404F

No connection via service interface (CDI)	Incorrect configuration of USB interface on PC or driver not installed correctly.	Observe the documentation for the Commubox.  FXA 291 HART: Document "Technical Information" TI00405C
---	---	--

12.2 Diagnostic information on local display

12.2.1 Diagnostic message

Faults detected by the self-monitoring system of the measuring device are displayed as a diagnostic message in alternation with the operational display.

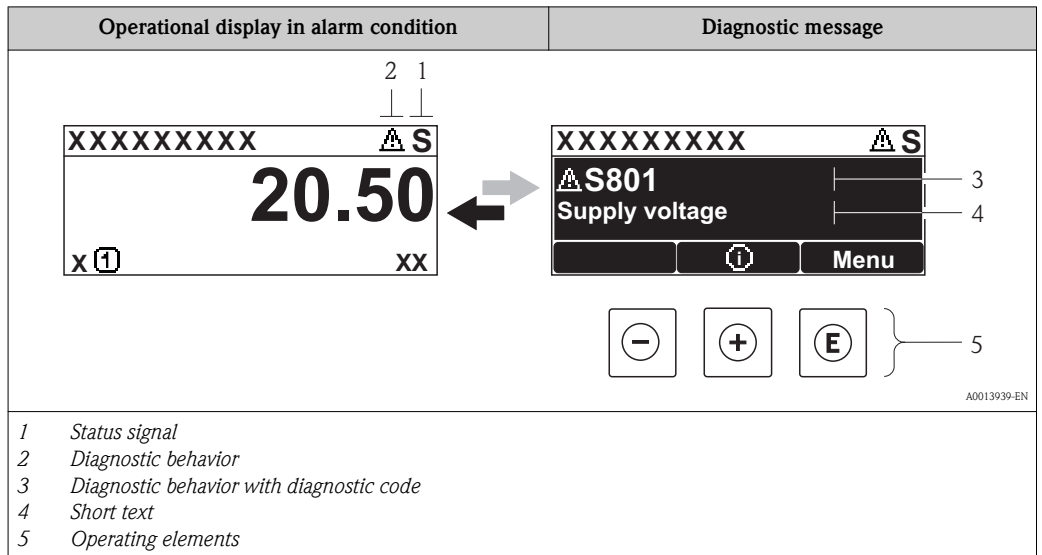

Status signals

Symbol	Meaning
F <small>A0013956</small>	Failure A device error has occurred. The measured value is no longer valid.
C <small>A0013959</small>	Function check The device is in service mode (e.g. during a simulation).
S <small>A0013958</small>	Out of specification The device is being operated: <ul style="list-style-type: none"> ■ Outside its technical specification limits (e.g. outside the process temperature range) ■ Outside of the configuration carried out by the user (e.g. maximum flow in parameter 20 mA value)
M <small>A0013957</small>	Maintenance required Maintenance is required. The measured value is still valid.


The status signals are categorized according to VDI/VDE 2650 and NAMUR Recommendation NE 107: F = Failure, C = Function Check, S = Out of Specification, M = Maintenance Required

Diagnostic behavior

Symbol	Meaning
 <small>A0013901</small>	Alarm Measurement is interrupted. The signal outputs and totalizers assume the defined alarm condition. A diagnostic message is generated.
 <small>A0013902</small>	Warning Measurement is resumed. The signal outputs and totalizers are not affected. A diagnostic message is generated.

Diagnostic information

The fault can be identified using the diagnostic information. The short text helps you by providing information about the fault. In addition, the corresponding symbol for the diagnostic behavior is displayed in front of the diagnostic information.

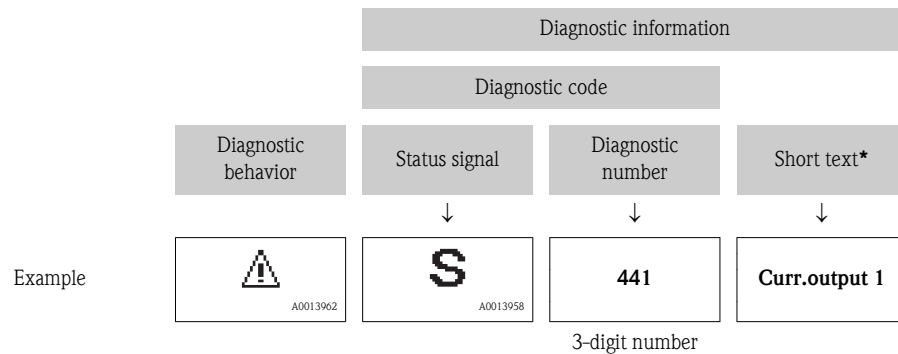


If two or more diagnostic events are pending simultaneously, only the message with the highest priority is shown. Other diagnostic messages that are pending can be viewed in the **Diagnostic list** submenu (→ 79).

Past diagnostic messages that are no longer pending are shown in the **Event logbook** submenu (→ 79).

Operating elements

Key	Meaning
 <small>A0013970</small>	Plus key <i>In a menu, submenu</i> Opens the message about the remedy information.
 <small>A0013952</small>	Enter key <i>In a menu, submenu</i> Opens the operating menu.

12.2.2 Calling up remedial measures

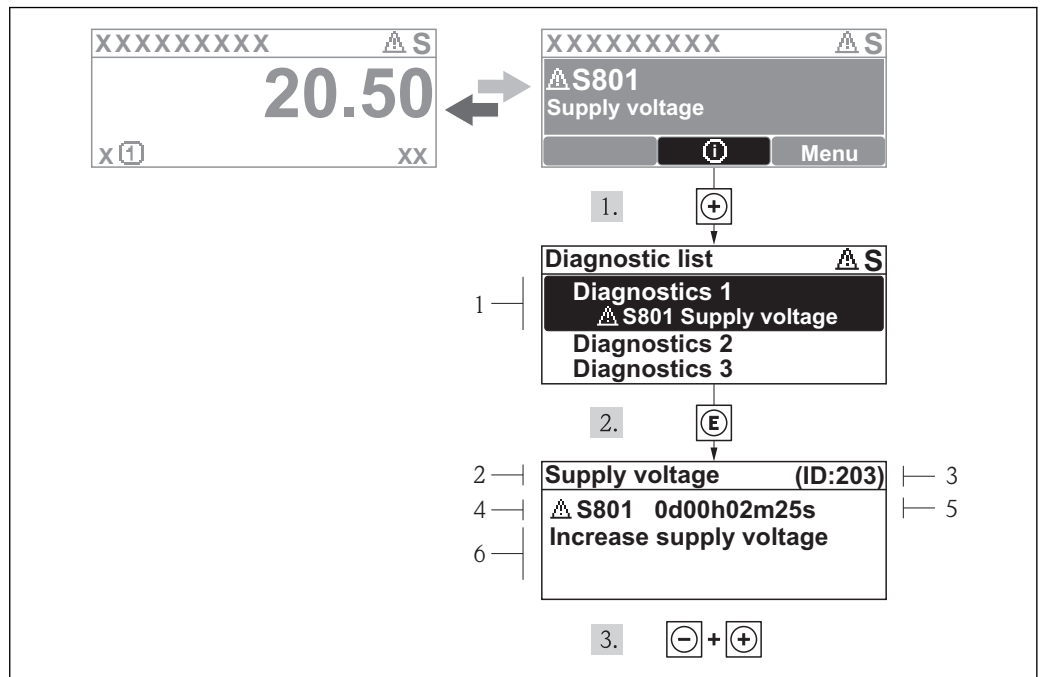

A0013940-EN

6 Message for remedial measures

- 1 Short text
- 2 Diagnostic behavior with diagnostic code
- 3 Service ID
- 4 Operation time of occurrence
- 5 Remedial measures

The user is in the diagnostic message.

1. Press \oplus (i symbol).
 - ✓ The **Diagnostic list** submenu opens.
2. Select the desired diagnostic event with \ominus or \oplus and press E .
 - ✓ The message for the remedial measures for the selected diagnostic event opens.
3. Press $\ominus + \oplus$ simultaneously.
 - ✓ The message about the remedial measures closes.


The user is in the **Diagnostics** menu at an entry for a diagnostics event, e.g. in the **Diagnostic list** submenu or the **Previous diagnostics** parameter.

1. Press E .
 - ✓ The message for the remedial measures for the selected diagnostic event opens.
2. Press $\ominus + \oplus$ simultaneously.
 - ✓ The message about the remedial measures closes.

12.3 Diagnostic information in the operating tool

If diagnostic information is present in the operating tool, the status signal appears in the top left status area along with the corresponding symbol in accordance with VDI/VDE 2650 and NAMUR Recommendation NE 107:

- Failure (F)
- Function check (C)
- Out of specification (S)
- Maintenance required (M)

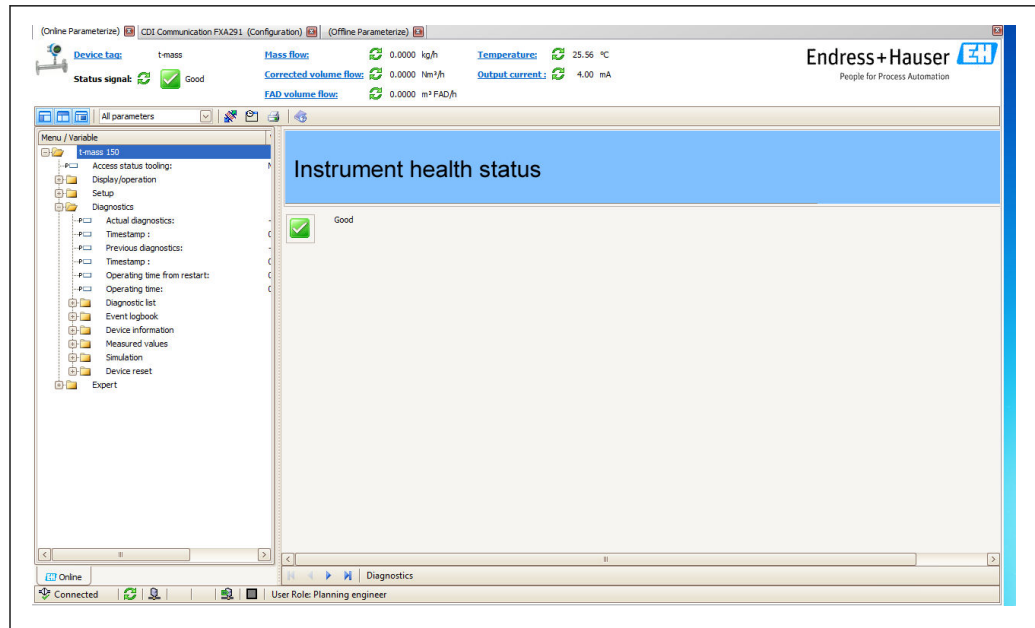

A0017300-EN

Calling up remedy information

1. Navigate to the "Diagnostics" menu.
 - ✓ In the "Actual diagnostics" parameter, the diagnostic code is shown with a short text.
2. On the right in the display range, hover the cursor over the "Actual diagnostics" parameter.
 - ✓ A tool tip with remedial measures for the diagnostic number appears.


12.4 Adapting the diagnostic information

12.4.1 Adapting the diagnostic behavior

Each diagnostic number is assigned a specific diagnostic behavior at the factory. The user can change this assignment for specific diagnostic numbers via the **Diagnosics No. xxx** parameter.

Navigation path

"Expert" menu → System → Diagnostic handling → Diagnostic behavior → Assign behavior of diagnostic no. xxx

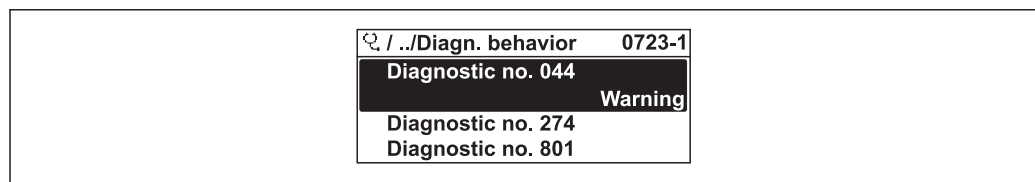

A0014048-EN

You can assign the following options to the diagnostic number as the diagnostic behavior:

Options	Description
Alarm	Measurement is interrupted. The signal outputs assume the defined alarm condition. A diagnostic message is generated.
Warning	The device continues to measure. A diagnostic message is generated.
Logbook entry only	The device continues to measure. The diagnostic message is entered in the Event logbook (events list) submenu only and is not displayed in alternation with the measured value display.
Off	The diagnostic event is ignored, and no diagnostic message is generated or entered.

12.5 Overview of diagnostic information

Diagnostic number	Short text	Remedy information	Status signal from the factory	Diagnostic behavior from the factory
Diagnostics for the sensor				
004	Sensor	Change sensor	F	Alarm*
082	Data storage	1. Change main electronic module. 2. Change sensor.	F	Alarm*
083	Memory content	1. Restart device. 2. Restore data. 3. Change sensor.	F	Alarm*

Diagnostic number	Short text	Remedy information	Status signal from the factory	Diagnostic behavior from the factory
Diagnostics for the electronics				
270	Main electronic failure	Change main electronic module.	F	Alarm
271	Main electronic failure	1. Restart device. 2. Change main electronic module.	F	Alarm
272	Main electronic failure	1. Restart device. 2. Contact service.	F	Alarm*
273	Main electronic failure	1. Emergency operation via display. 2. Change main electronics.	F	Alarm*
282	Data storage	1. Restart device. 2. Contact service.	F	Alarm
283	Memory content	1. Transfer data or reset device. 2. Contact service.	F	Alarm*
311	Electronic failure	1. Transfer data or reset device. 2. Contact service.	F	Alarm*
311	Electronic failure	Maintenance required! 1. Do not perform reset. 2. Contact service.	M	Warning

* Diagnostic behavior can be changed: Section 12.4 "Adapting the diagnostic behavior"

Diagnostic number	Short text	Remedy information	Status signal from the factory	Diagnostic behavior from the factory
Diagnostics for the configuration				
410	Data transfer	1. Check connection. 2. Retry data transfer.	F	Alarm*
411	Upload/download	1. Check connection. 2. Retry data transfer.	F	Alarm*
411	Up-/download active	Up-/download active, please wait	C	Warning*

431	Trim	Carry out trim.	C	Warning*
437	Incompatible configuration	1. Restart device. 2. Contact service.	F	Alarm*
437	Incompatible configuration	1. Transfer data or reset device. 2. Contact service.	C	Alarm
438	Dataset	1. Check data set file. 2. Check device configuration. 3. Up- and download new configuration.	M	Warning*
441	Current output	1. Check process. 2. Check current output settings.	S	Warning*
442	Frequency output	1. Check process. 2. Check frequency output setting.	S	Warning*
443	Pulse output	1. Check process. 2. Check pulse output setting.	S	Warning*
453	Flow override	Deactivate flow override.	C	Warning*
484	Simulation failsafe mode	Deactivate simulation.	C	Alarm
485	Simulation process variable	Deactivate simulation.	C	Warning*
491	Simulation current output	Deactivate simulation.	C	Warning*
492	Frequency simulation	Deactivate simulation.	C	Warning*
493	Simulation pulse output	Deactivate simulation.	C	Warning
494	Switch output simulation	Deactivate simulation.	C	Warning

* Diagnostic behavior can be changed: Section 12.4 "Adapting the diagnostic behavior"

Diagnostic number	Short text	Remedy information	Status signal from the factory	Diagnostic behavior from the factory
Diagnostics for the process				
832	Ambient temperature	Reduce ambient temperature.	S	Warning*
833	Ambient temperature	Increase ambient temperature.	S	Warning*
834	Process temperature	Reduce process temperature.	S	Warning*
835	Process temperature	Increase process temperature.	S	Warning*
841	Flow velocity	1. Check process conditions. 2. Increase system pressure	S	Alarm
842	Process limit	Low flow cut off active! Check low flow cut off configuration.	S	Logbook entry only
861	Temperature differential	1. Check process conditions. 2. Check signal path.	S	Alarm

* Diagnostic behavior can be changed: Section 12.4 "Adapting the diagnostic behavior"


12.6 Resetting the measuring device

Using the **Device reset** parameter it is possible to reset the entire device configuration or some of the configuration to a defined state.

Navigation path

"Diagnostics" menu → Device reset → Device reset

Function scope of the "Device reset" parameter


Options	Description
Cancel	The user can exit the parameter. No action is performed.
To factory defaults	Every parameter is reset to the factory setting.
To delivery settings	Every parameter for which a customer-specific default setting was ordered is reset to this customer-specific value. All other parameters are reset to the factory setting.  This option is not visible if no customer-specific settings have been ordered.
Restart device	The restart resets every parameter whose data are in the volatile memory (RAM) to the factory setting (e.g. measured value data). The device configuration remains unchanged.

12.7 Diagnostics list

In the **Diagnostic list** submenu, up to 5 currently pending diagnostic messages can be displayed. If more than 5 messages are pending, the messages with the highest priority are shown on the display.




Navigation path

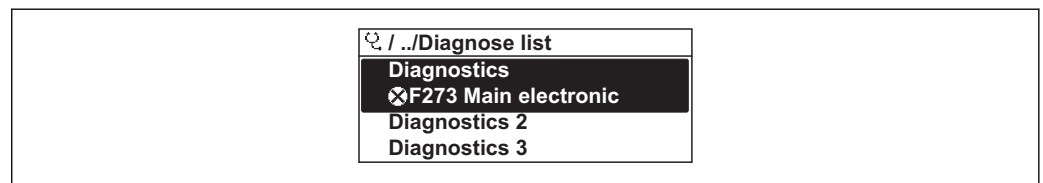"Diagnostics" menu → Diagnostic list



A0014006-EN

Calling up and closing remedial measures

1. Press .
 - ✓ The message for the remedial measures for the selected diagnostic number opens.
2. Press  +  simultaneously.
 - ✓ The message about the remedy information closes.

 For the structure of the remedial measure message (→  81)


12.8 Event logbook

12.8.1 Event history

A chronological overview of the event messages that have occurred is provided in the **Events list** submenu.

Navigation path

"Diagnostics" menu → Event logbook → Events list

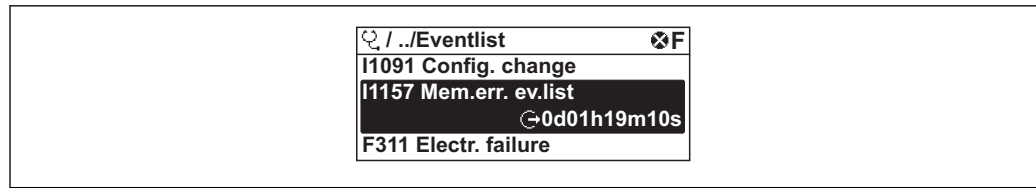

A0014008-EN

A maximum of 20 event messages can be displayed in chronological order. If the advanced HistoROM function is enabled in the device (order option), up to 1000 entries can be displayed.

The event history includes entries for:

- Diagnostic events (→ 79)
- Information events (→ 79)

In addition to the operation time of its occurrence, each event is also assigned a symbol that indicates whether the event has occurred or is ended:

- Diagnostics event
 - : Event has occurred
 - : Event has ended
- Information event
 - : Event has occurred

Calling up and closing remedial measures

1. Press .
 - ✓ The message for the remedial measures for the selected diagnostic number opens.
 2. Press + simultaneously.
 - ✓ The message about the remedy information closes.
- For the structure of the remedial measure message (→ 81)
- For filtering the displayed event messages (→ 87)

12.8.2 Filtering the event logbook

Using the **Filter options** parameter, you can define which category of event messages is displayed in the **Events list** submenu.

Navigation path

"Diagnostics" menu → Event logbook → Filter options

Filter categories

- All
- Failure (F)
- Function check (C)
- Out of specification (S)
- Maintenance required (M)
- Information (I)

12.8.3 Overview of information events

Unlike a diagnostic event, an information event is displayed in the event logbook only and not in the diagnostic list.

Information event	Event text
I1000	—— (device ok)
I1089	Power on

I1090	Configuration reset
I1091	Configuration changed
I1092	Trend data deleted
I1110	Write protection switch changed
I1151	History reset
I1155	Reset electronic temperature
I1156	Memory error trend
I1157	Memory error event list
I1185	Display backup done
I1186	Restore via display done
I1187	Settings downloaded with display
I1188	Display data cleared
I1189	Backup compared
I335	Firmware changed

13 Repair

13.1 General notes

Repair and conversion concept

The Endress+Hauser repair and conversion concept provides for the following:

- The measuring devices have a modular design.
- Spare parts are grouped into logical kits with the associated Installation Instructions.
- Repairs are carried out by Endress+Hauser Service or by correspondingly trained customers.
- Certified devices can be converted into other certified devices only by Endress+Hauser Service or at the factory.

Notes for repair and conversion

For repair and modification of a measuring device, observe the following notes:

- Use only original Endress+Hauser spare parts.
- Carry out the repair according to the Installation Instructions.
- Observe the applicable standards, federal/national regulations, Ex documentation (XA) and certificates.
- Document every repair and each conversion and enter them into the *W@M* life cycle management database.

13.2 Spare parts

- Some interchangeable measuring device components are identified by an overview sign. This contains information about the spare part.
- The spare part overview sign is located in the connection compartment cover of the device and contains the following information:
 - A list of the most important spare parts for the measuring device, including their ordering information.
 - The URL for the *W@M Device Viewer* (www.endress.com/deviceviewer):
All the spare parts for the measuring device, along with the order code, are listed here and can be ordered. If available, users can also download the associated Installation Instructions.



Measuring device serial number:

- Is located on the device nameplate and the spare part overview sign.
- Can be read out via the "Serial number" parameter in the "Device information" submenu.

13.3 Endress+Hauser services



For information about service and spare parts, contact your Endress+Hauser distributor.

14 Maintenance

14.1 Maintenance tasks

No special maintenance work is required.

14.1.1 Exterior cleaning

When cleaning the exterior of measuring devices, always use cleaning agents that do not attack the surface of the housing or the seals.

14.1.2 Interior cleaning

Cleaning the transducer

In applications with dirty gases, it is advisable to inspect and clean the device regularly to minimize measured errors caused by fouling or buildup.


The inspection and cleaning intervals depend on experience and the field of application.

NOTICE

The use of unsuitable equipment or cleaning liquids can damage the transducer.


- ▶ Do not use pigs to clean the pipe.
- ▶ Use an oil-free cleaning agent that does not form a film to clean the sensor. Gently clean the surface using a soft brush.
- ▶ When cleaning make sure that the transducers are not damaged.
- ▶ Never use cleaning agents that can corrode the material and the seal.


Sensor-specific information:

- If the sensor gland is opened, the accuracy specifications of the measuring device no longer apply. In such situations, the measuring device must be removed and returned for recalibration and to the manufacturer.
- Follow the safety instructions when removing the sensor (→  8).

14.2 Measuring and test equipment

Endress+Hauser offers a wide variety of measuring and test equipment, such as W@M or device tests.

 Your Endress+Hauser representative can provide detailed information on the services.

 For a list of some of the measuring and test equipment, refer to the "Accessories" chapter of the "Technical Information" document for the device.

14.3 Endress+Hauser services

Endress+Hauser offers a wide variety of services for maintenance such as recalibration, maintenance service or device tests.

 Your Endress+Hauser representative can provide detailed information on the services.

15 Return

Observe the following points for returning the device:

- Contact your Endress+Hauser Sales Center to obtain information about the procedure and basic conditions.
- Enclose the completed "Decontamination declaration" form with the device.



The form is available:
As a photocopy master at the end of this manual

16 Disposal

16.1 Removing the measuring device

1. Switch off the device.
2. **WARNING!** Danger to persons from process conditions. Beware of hazardous process conditions such as pressure in the measuring device, high temperatures or aggressive fluids. Carry out the mounting and connection steps from the chapters "Mounting the measuring device" and "Connecting the measuring device" in the logically reverse sequence. Observe the safety instructions.

16.2 Disposing of the measuring device

⚠ WARNING

Danger to personnel and environment from fluids that are hazardous to health.

- ▶ Ensure that the measuring device and all cavities are free of fluid residues that are hazardous to health or the environment, e.g. substances that have permeated into crevices or diffused through plastic.

Observe the following notes during disposal:

- Observe valid local site rules and federal/national regulations.
- Ensure proper separation and reuse of the device components.

17 Technical data

17.1 Application

The measuring device is suitable for flow measurement of gases only.

To ensure that the device remains in proper operating condition for its service life, use the measuring device only for media against which the process-wetted materials are adequately resistant.


17.2 Function and system design

Measuring principle

Mass flow measurement based on thermal measuring principle

Measuring system

The device consists of a transmitter and a sensor.

One device version is available: compact version - transmitter and sensor form a mechanical unit. For information on the structure of the device (→  10)

17.3 Characteristic values

Measured variable

Direct measured variables


- Mass flow
- Gas temperature

Calculated measured variables

- Corrected volume flow
- FAD (free air delivery) volume flow


Measuring range

The available measuring range depends on the choice of gas, the size of the pipe and the use of a flow conditioner. The measuring device is calibrated with air (under ambient conditions) and the value is converted in order to adapt it to the customer's gas if necessary.

 To obtain information on other gases and process conditions, please contact your Endress +Hauser sales office.

The following tables list the ranges available for air (without flow conditioner).

Measuring range "Calibration flow", option G and H

Specified measuring range up to 100% (→  100)

SI units for EN (DIN) flange versions

DN [mm]	[kg/h]		[Nm ³ /h] at 0 °C (1.013 bar a)		[Nm ³ /h] at 15 °C (1.013 bar a)	
	min.	Max.	min.	Max.	min.	Max.
15	0.5	53	0.38	41	0.4	43
25	2	200	1.5	155	1.6	164
40	6	555	4.6	429	4.9	453
50	10	910	7.7	704	8.2	744

US units for ASME flange versions

DN	[lb/h]		[Scf/min] at 32 °F (14.7 psi a)		[Scf/min] at 59 °F (14.7 psi a)	
[in]	min.	Max.	min.	Max.	min.	Max.
½	1.1	116	0.23	24	0.24	25
1	4.4	440	0.9	91	1.0	96
1½	13.2	1 220	2.7	252	2.9	266
2	22.0	2 002	4.5	413	4.8	436

Measuring range "Calibration flow" option KSpecified measuring range up to 150% (→  100)*SI units for EN (DIN) flange versions*

DN	[kg/h]		[Nm³/h] at 0 °C (1.013 bar a)		[Nm³/h] at 15 °C (1.013 bar a)	
[mm]	min.	Max.	min.	Max.	min.	Max.
15	0.5	80	0.38	62	0.24	65
25	2	300	1.5	232	1.0	245
40	6	833	4.6	644	2.3	681
50	10	1 365	7.7	1 056	4.8	1 116

US units for ASME flange versions

DN	[lb/h]		[Scf/min] at 32 °F (14.7 psi a)		[Scf/min] at 59 °F (14.7 psi a)	
[in]	min.	Max.	min.	Max.	min.	Max.
½	1.1	174	0.23	36	0.24	38
1	4.4	660	0.9	136	1.0	144
1½	13.2	1 830	2.7	378	2.9	399
2	22.0	3 003	4.5	620	4.8	656

Operable flow range


Over 100:1 (over 150:1 for calibration option code K).

Even in the extended measuring range (above the specified end value), the flow rate is captured and provided as an output signal. However, the extended range is not subject to the specified measuring uncertainty.

17.4 Output

Output signal

Current output

Current output	4-20 mA HART, active
Maximum output values	<ul style="list-style-type: none"> ■ DC 24 V (when idle) ■ 22 mA  If the option Defined value is selected in the Failure mode parameter : 22.5 mA
Load	0 to 750 Ω
Resolution	16 Bit or 0.38 µA

Damping	Adjustable:0 to 999 s
Assignable measured variables	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature

Pulse/frequency/switch output

Function	Can be set to pulse, frequency or switching output
Version	Passive, open collector
Maximum input values	<ul style="list-style-type: none"> ■ DC30 V ■ 25 mA
Voltage drop	For 25 mA: ≤ DC2 V
Pulse output	
Pulse width	Adjustable: 0.5 to 2000 ms → pulse rate:0 to 1000 Pulse/s
Pulse value	Adjustable
Assignable measured variables	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow
Frequency output	
Maximum frequency	Adjustable:0 to 1000 Hz
Damping	Adjustable:0 to 999 s
Pulse/pause ratio	1:1
Assignable measured variables	<ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature
Switching output	
Switching behavior	Binary, conductive or non-conductive
Switching delay	Adjustable:0 to 100 s
Number of switching cycles	Unlimited
Assignable functions	<ul style="list-style-type: none"> ■ Off ■ On ■ Diagnostic behavior ■ Limit value ■ Status

Signal on alarm

Depending on the interface, failure information is displayed as follows:

Current output

Failure mode	Can be selected (as per NAMUR recommendation NE 43)
Minimum alarm	3.6 mA
Maximum alarm	22 mA
Adjustable value	3.6 to 22.5 mA

Pulse/frequency/switch output

Pulse output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Actual value ■ No pulses
Frequency output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Actual value ■ Defined value: 0 to 1250 Hz ■ 0 Hz
Switching output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Current status ■ Open ■ Closed

Local display

Plain text display	With information on cause and remedial measures
--------------------	---

 Status signal as per NAMUR recommendation NE 107

Operating tool

- Via digital communication: HART protocol
- Via service interface

Plain text display	With information on cause and remedial measures
--------------------	---

Low flow cut off The switch point for low flow cut off is programmable.

Galvanic isolation The following connections are galvanically isolated from each other:

- Outputs
- Power supply

Protocol-specific data

HART

Manufacturer ID	0x11
Device type ID	0x66
HART protocol revision	6.0
Device description files (DTM, DD)	Information and files under: www.endress.com


HART load	Min. 250 Ω
Dynamic variables	<p>The measured variables can be freely assigned to the dynamic variables.</p> <p>Measured variables for PV (primary dynamic variable)</p> <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature <p>Measured variables for SV, TV, QV (secondary, tertiary and quaternary dynamic variable)</p> <ul style="list-style-type: none"> ■ Mass flow ■ Corrected volume flow ■ FAD volume flow ■ Temperature ■ Totalizer

17.5 Power supply

Terminal assignment

Transmitter

Connection version 4-20 mA HART, pulse/frequency/switching output

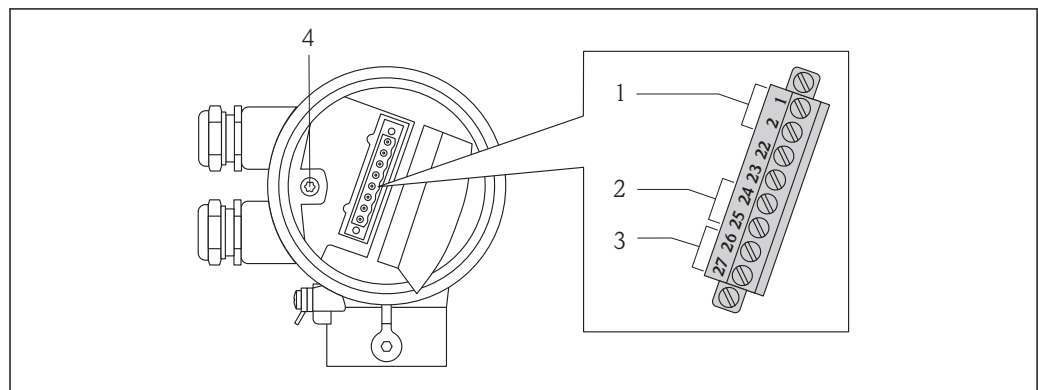

A0017178

- 1 Supply voltage
- 2 Signal transmission: Pulse/frequency/switching output
- 3 Signal transmission: 4-20 mA HART
- 4 Ground terminal for cable shield

Supply voltage

Order code for "Power supply"	Terminal numbers	
	1 (L+)	2 (L-)
Option D	DC 24 V (18 to 30 V)	

Signal transmission

Order code for "Output"	Terminal numbers			
	Output 1		Output 2	
	26 (+)	27 (-)	24 (+)	25 (-)
Option A	4-20 mA HART active		-	
Option B	4-20 mA HART active		Pulse/frequency/switch output	

Option K	-	Pulse/frequency/switch output
-----------------	---	-------------------------------

Supply voltage

DC 24 V (18 to 30 V)


The power supply circuit must comply with SELV/PELV requirements.

Power consumption	Order code for "Output"	Maximum power consumption
	<ul style="list-style-type: none"> ■ Option A: 4-20mA HART ■ Option B: 4-20mA HART, pulse/frequency/switching output ■ Option K: Pulse/frequency/switching output 	3.1 W

Current consumption	Order code for "Output"	Maximum current consumption	Maximum switch-on current
	<ul style="list-style-type: none"> ■ Option A: 4-20mA HART ■ Option B: 4-20mA HART, pulse/frequency/switching output ■ Option K: Pulse/frequency/switching output 	185 mA	< 2.5 A

- Power supply failure
- Totalizers stop at the last value measured.
 - Configuration is retained in the device memory.
 - Error messages (incl. total operated hours) are stored.

Electrical connection **Connecting the transmitter**

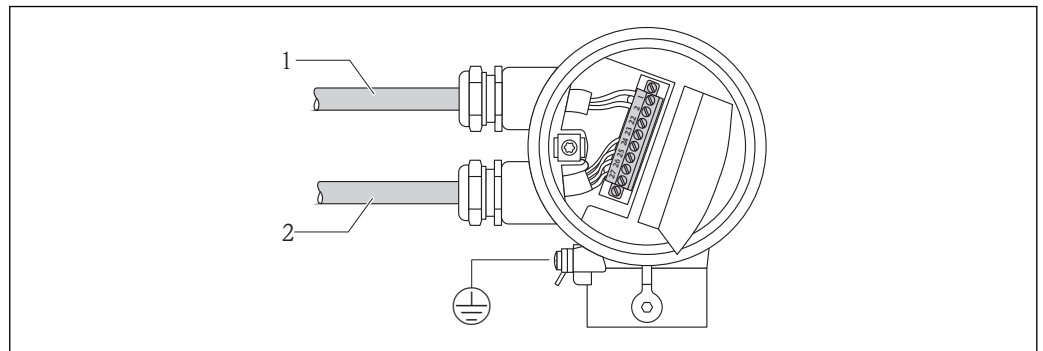

- 1 Cable entry for supply voltage
 2 Cable entry for signal transmission

Potential equalization No special measures for potential equalization are required.

Terminals Plug-in screw terminals for specified wire cross-sections

- Cable entries
- Cable gland: M20 × 1.5 with cable Ø6 to 12 mm (0.24 to 0.47 in)
 - Thread for cable entry:
 - NPT 1/2"
 - G 1/2"

Cable specification

Wire cross-sectional area

0.5 to 1.5 mm² (21 to 16 AWG)

Permitted temperature range

- -40 °C (-40 °F)...≥ 80 °C (176 °F)
- Minimum requirement: cable temperature range ≥ ambient temperature +20 K

Signal cable*Current output*

For 4-20 mA HART: Shielded cable recommended. Observe grounding concept of the plant.

Pulse/frequency/switch output

Standard installation cable is sufficient.

Supply voltage cable

Standard installation cable is sufficient.



17.6 Performance characteristics


Reference operating conditions

- Calibration systems traceable to national standards
- Accredited in accordance with ISO/IEC 17025
- Air controlled to 24 °C ± 0.5 °C (75.2 °F ± 0.9 °F) at atmospheric pressure
- Humidity controlled < 40 % RH

Maximum measured error

o.r. = of reading; o.f.s. = of full scale value

- 
 ■ The full scale value depends upon the nominal diameter of the measuring device and the max. flow of the calibration rig.
 - Full scale values of the specified measuring range.(→  94)

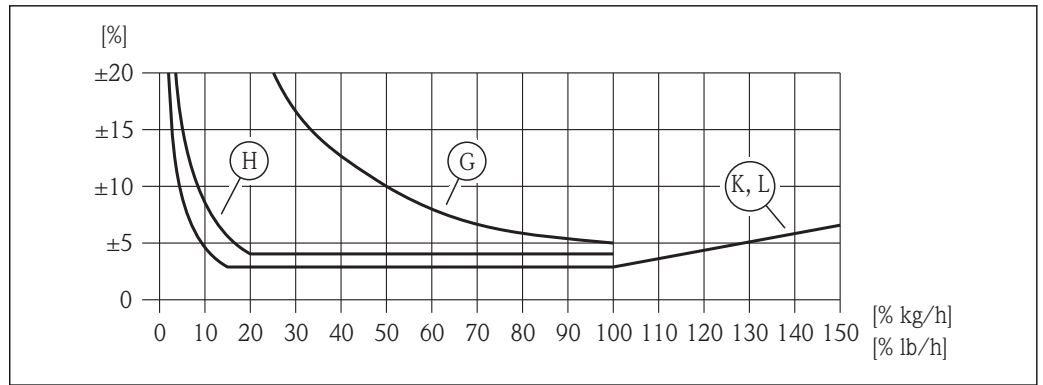

A0016921

7 Maximum measured error (% mass flow) as % of measured value/full scale value. G, H, K, L: Order code options for "Calibration flow", see the following table

Order code option for "Calibration flow"	Accuracy	Description
K L	<ul style="list-style-type: none"> ■ Q = 100 to 150 %: from ±3 % to ±6.5 % of the current measured value increasing linearly as expressed in the following equation: $\pm 3 \pm (X_n - 100) \times 0.07$ [% o.r.] (100 % < X_n ≤ 150 %; X_n = current flow as a % o.f.s.) ■ Q = 15 to 100 %: ±3 % of current measured value ■ Q = 1 to 15 % ±0.45 % o.f.s. (all data under reference conditions)	The measuring device is calibrated and adjusted on an accredited and traceable calibration rig . The accuracy is certified with a calibration protocol.
H	<ul style="list-style-type: none"> ■ Q = 20 to 100 % ±4 % of current measured value ■ Q = 1 to 20 % ±0.8 % o.f.s. (all data under reference conditions)	The measuring performance of the device is tested, and a verification protocol confirms that the device measures within the specified tolerance.
G	Q = 1 to 100 % ±5 % o.f.s. (under reference conditions)	This version is subject to neither a calibration nor a verification of measuring performance.

Accuracy of outputs

Current output

Accuracy	Max. ±0.05 % o.f.s. or ±10 µA
-----------------	-------------------------------

Repeatability ±0.5 % of value for velocities > 1.0 m/s (3.3 ft/s)

Response time Typically < 3 s for 63 % of a given step change (in both directions)

Influence of medium pressure Air: 0.35 % of value per bar (0.02 % per psi) of process pressure change

17.7 Installation

"Mounting requirements" (→  15)

17.8 Environment

Ambient temperature range	Measuring device	-40 to +60 °C (-40 to +140 °F)
	Local display	-20 to +60 °C (-4 to +140 °F), the readability of the display may be impaired at temperatures outside the temperature range.

- ▶ If operating outdoors:
Avoid direct sunlight, particularly in warm climatic regions.

Storage temperature -40 to +80 °C (-40 to +176 °F), preferably at +20 °C (+68 °F)

Degree of protection


Transmitter

- As standard: IP66/67, type 4X enclosure
- When housing is open: IP20, type 1 enclosure
- Display module: IP20, type 1 enclosure

Sensor
IP66/67, type 4X enclosure


Shock resistance As per IEC/EN 60068-2-31

Vibration resistance Acceleration up to 2 g, 10 to 150 Hz, as per IEC/EN 60068-2-6

Electromagnetic compatibility (EMC) As per IEC/EN 61326 and NAMUR Recommendation 21 (NE 21).
 Details are provided in the Declaration of Conformity.

17.9 Process

Medium temperature range **Sensor**
-40 to +100 °C (-40 to +212 °F)

Flow limit See "Measuring range" (→  94) section
The velocity in the measuring tube should not exceed 70 m/s (230 ft/s).

Pressure loss Negligible (without flow conditioner).
For a precise calculation, use the Applicator.

System pressure **Sensor**
Depending on the version, please note the details on the name plate .
Max. 40 bar g (580 psi g)


Thermal insulation

If the gas is very humid or saturated with water, the pipe and the sensor housing should be insulated to prevent water droplets condensing on the transducer.

NOTICE

Electronics overheating on account of thermal insulation!


- Observe maximum permitted insulation height of the transmitter neck so that the transmitter head is completely free.

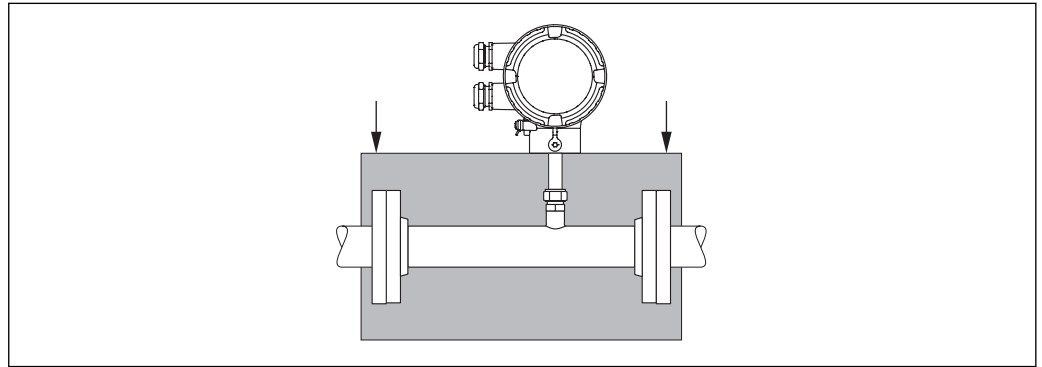

A0015521

17.10 Mechanical construction

Design, dimensions

 For the dimensions and installation lengths of the device, see the "Technical Information" document, "Mechanical construction" section

Weight

Weight in SI units

Compact version

DN [mm]	Weight [kg]					
	Fixed flange		Lap joint flange			Threaded version
	CL300	PN40	PN16	PN10	CL150	
15	4.0	3.9	4.1	3.2	3.4	2.6
25	5.5	4.8	5.0	3.5	4.3	2.6
40	7.9	7.0	7.5	4.9	6.1	3.1
50	9.9	9.3	9.4	5.9	8.0	3.8

Weight in US units

Compact version

DN [mm]	Weight [lbs]					
	Fixed flange		Lap joint flange			Threaded version
	CL300	PN40	PN16	PN10	CL150	
15	8.8	8.6	9.0	7.1	7.5	5.7
25	12.1	10.6	11.0	7.7	9.5	5.7

DN [mm]	Weight [lbs]					
	Fixed flange		Lap joint flange			Threaded version
	CL300	PN40	PN16	PN10	CL150	
40	17.4	15.4	16.5	10.8	13.5	6.8
50	21.8	20.5	20.7	13.0	17.6	8.4

Materials

Transmitter housing

- Order characteristic for "Housing", option **A**: aluminum costing AlSi10Mg
- Window material: glass

Sensor

Process connections

Fixed flanges: EN 1092-1/ ASME B16.5

- Stainless steel 1.4404 as per EN 10222-5
- Stainless steel F316/F316L as per ASTM A182

Lap joint flanges: EN 1092-1/ ASME B16.5

- Stub end:
 - Stainless steel 1.4404/1.4435 as per EN 10216-5; cold worked
 - Stainless steel 316L as per ASTM A312; cold worked
- Lap-joint flange:
 - Carbon steel, zinc-plated 1.0038 as per EN 10025-2
 - Stainless steel 1.4301/1.4307 as per EN 10028-7

Threaded version: R external thread as per EN 10226-1, ISO 7/1 and NPT external thread as per ASME B1.20.1

- Stainless steel 1.4404/1.4435 as per EN 10216-5
- Stainless steel 316L as per ASTM A312

Measuring tube

- DN 15(½ in)
 - Stainless steel 1.4404 as per EN 10272/EN10216-5
 - Stainless steel 316/316L as per ASTM A479/ ASTM A312
- DN 25 to 50 (1 to 2 in)
 - Stainless steel 1.4404 as per EN 10216-5
 - Stainless steel 316/316L as per ASTM A312

Transducer

- Stainless steel 1.4404/1.4435 as per EN 10216-5/ EN10272/ EN 10028-7
- Stainless steel 316L as per ASTM A269/ ASTM A479/ ASTM A240

Cable entries

Order characteristic for "Housing", option A: compact, aluminum coating

Electrical connection	Type of protection	Material
Cable gland M20 × 1.5	For non-hazardous areas	Plastic
Thread G ½" via adapter	For non-Ex and Ex	Nickel-plated brass
Thread NPT ½" via adapter		

Accessories

Flow conditioner as per EN(DIN)/ASME

1.4404 as per EN 10272 and 316L as per A479

1.4404 as per EN 10216-5 and 316L as per A312

Process connections

- Lap joint flanges, fixed flanges
 - as per EN 1092-1
 - as per ASME B16.5
- External thread
 - R external thread as per EN 10226-1
 - NPT external thread as per ASME B1.20.1



For information on the materials of the process connections (→ 104)

17.11 Operability

Operating concept

Operator-oriented menu structure for user-specific tasks

- Commissioning
- Operation
- Diagnostics
- Expert level

Quick and safe commissioning

Menu guidance with brief explanations of the individual parameter functions

Reliable operation

- Operation in different languages: (→ 107)
 - Via local display
 - Via operating tools
- Uniform operating philosophy applied to device and operating tools

Efficient diagnostics increase measurement reliability

- Remedial information is integrated in plain text
- Diverse simulation options and optional line recorder functions

Local operation

"Display; Operation" Order code option C

Display elements

- 4-line display
- Format for displaying measured variables and status variables can be individually configured
- Permitted ambient temperature for the display: –20 to +60 °C (–4 to +140 °F)
The readability of the display may be impaired at temperatures outside the temperature range.

Operating elements

Local operation with 3 push buttons (, ,)

Additional functionality


- Data backup function
The device configuration can be saved in the display module.
- Data comparison function
The device configuration saved in the display module can be compared to the current device configuration.
- Data transfer function
The transmitter configuration can be transmitted to another device using the display module.

Remote operation

Via HART protocol

This communication interface is present in the following device version:

- Order code for "Outlet", option **A**: 4-20 mA HART
- Order code for "Outlet", option **B**: 4-20 mA HART, pulse/frequency/switching output

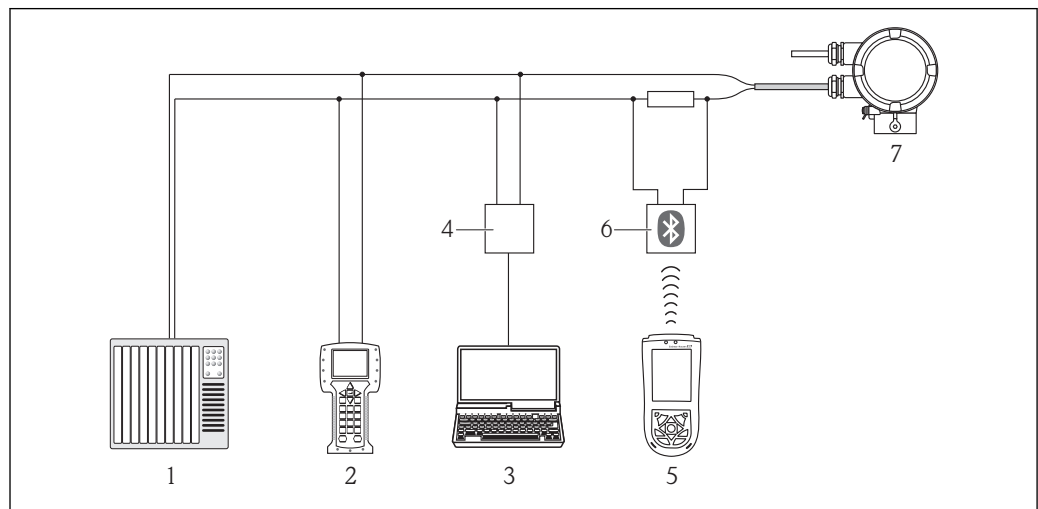


A0017373

8 Options for remote operation via HART protocol

- 1 Control system (e.g. PLC)
- 2 Field Communicator 475
- 3 Computer with operating tool (e.g. FieldCare, AMS Device Manager, SIMATIC PDM)
- 4 Commubox FXA195 (USB)
- 5 Field Xpert SFX100
- 6 VIATOR Bluetooth modem with connecting cable
- 7 Transmitter

Via service interface (CDI)

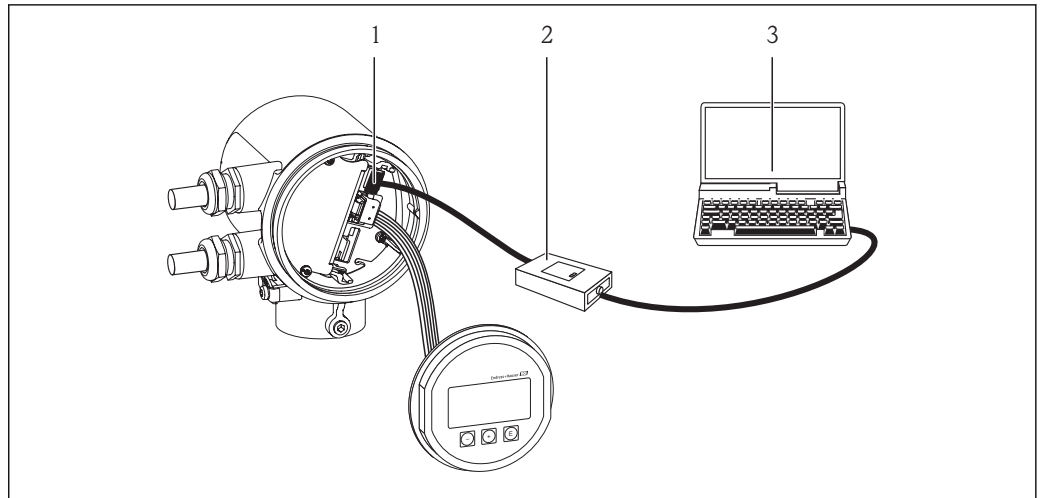

- 1 Service interface (CDI) of the measuring device
 2 Commubox FXA291
 3 Computer with "FieldCare" operating tool

A0017253

Languages

Can be operated in the following languages:

- Via local display:
English, German, French, Spanish, Italian, Dutch, Portuguese, Polish, Russian, Turkish, Japanese, Chinese, Korean, Bahasa (Indonesian), Vietnamese, Czech
- Via operating tools:
English, German, French, Spanish, Italian, Dutch, Portuguese, Polish, Russian, Turkish, Japanese, Chinese, Korean, Bahasa (Indonesian), Vietnamese, Czech

17.12 Certificates and approvals

CE mark

The measuring system is in conformity with the statutory requirements of the applicable EC Directives. These are listed in the corresponding EC Declaration of Conformity along with the standards applied.

Endress+Hauser confirms successful testing of the device by affixing to it the CE mark.

C-Tick symbol

The measuring system meets the EMC requirements of the "Australian Communications and Media Authority (ACMA)".

Ex approval

cCSA_{US}

The following hazardous area version is currently available:

NI

Class 1, Division 2, Groups A, B, C and D T4 or Class I


Pressure Equipment Directive

- With the PED/G1/x (x = category) marking on the sensor nameplate, Endress+Hauser confirms compliance with the "Essential Safety Requirements" specified in Annex I of the Pressure Equipment Directive 97/23/EC.
- Devices not bearing this marking (PED) are designed and manufactured according to good engineering practice. They meet the requirements of Art.3 Section 3 of the Pressure Equipment Directive 97/23/EC. The range of application is indicated in tables 6 to 9 in Annex II of the Pressure Equipment Directive.


Other standards and guidelines

- EN 60529
Degrees of protection provided by enclosures (IP code)
- EN 61010-1
Protection Measures for Electrical Equipment for Measurement, Control, Regulation and Laboratory Procedures
- IEC/EN 61326
Emission in accordance with Class A requirements. Electromagnetic compatibility (EMC requirements)
- NAMUR NE 21
Electromagnetic compatibility (EMC) of industrial process and laboratory control equipment
- NAMUR NE 32
Data retention in the event of a power failure in field and control instruments with microprocessors
- NAMUR NE 43
Standardization of the signal level for the breakdown information of digital transmitters with analog output signal.
- NAMUR NE 53
Software of field devices and signal-processing devices with digital electronics
- NAMUR NE 105
Specifications for integrating fieldbus devices in engineering tools for field devices
- NAMUR NE 107
Status classification as per NE107

17.13 Accessories

 For an overview of the accessories that can be ordered, see the "Technical Information" document


17.14 Documentation

-  The following document types are available:
- On the CD-ROM supplied with the device
 - In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download

Standard documentation

Communication	Document type	Documentation code
----	Brief Operating Instructions	KA01103D
----	Technical Information	TI01019D

Supplementary device-dependent documentation

 
 
 
 
 

 
 
 

 
 
 


 
 
 



 



 


Document type	Documentation code
Information on the Pressure Equipment Directive	SD00155D
Installation Instructions	Specified for each individual accessory  For an overview of the accessories that can be ordered, see the "Technical Information" document

18 Appendix

18.1 Overview of the Operator/Maintenance operating menu


 





















 




The following table provides an overview of the operating menu structure with the specific parameters for operators, maintenance staff and experts. The page reference indicates where a description of the parameter can be found in the manual.

Language (0104)		(→ 47)
Display/operat.	→	(→ 26)
Display	→	(→ 74)
Format display (0098)		(→ 74)
Contrast display (0105)		(→ 74)
Display interval (0096)		(→ 74)
Operation	→	(→ 74)
Control totalizer (0912)		(→ 77)
Preset value (0913)		(→ 77)
Reset all totalizers (2806)		(→ 77)
Setup	→	(→ 48)
Select gas type (3381)		(→ 48)
Process pressure (3376)		(→ 49)
Temperature (1853)		(→ 75)
Installation factor (3470)		(→ 49)
Assign current output (0359)		(→ 50)
4 mA value (0367)		(→ 50)
20 mA value (0372)		(→ 50)
Operating mode (0469)		(→ 50)
Assign frequency output (0478)		(→ 50)
Measuring value at minimum frequency (0476)		(→ 50)
Measuring value at maximum frequency (0475)		(→ 50)

Switch output function (0481)		(→  51)
Assign limit (0483)		(→  51)
Switch-off value (0464)		(→  51)
Switch-on value (0466)		(→  51)
Assign pulse output (0460)		(→  51)
Value per pulse (0455)		(→  51)
Advanced setup	→	(→  52)
Enter access code (0092)		(→  71)
Define access code (0093)		(→  71)
Device tag (0215)		(→  53)
Applications	→	(→  53)
Select gas type (3381)		(→  54)
Process pressure (3376)		(→  54)
Temperature (1853)		(→  54)
Reference conditions (3439)		(→  54)
Reference pressure (3378)		(→  54)
Reference temperature (3379)		(→  54)
FAD conditions	→	(→  53)
FAD conditions (3438)		(→  54)
FAD pressure (3373)		(→  54)
FAD temperature (3374)		(→  54)
System units	→	(→  54)
Mass flow unit (0554)		(→  55)
Mass unit (0574)		(→  55)
Corrected volume flow unit (0558)		(→  55)
Corrected volume unit (0575)		(→  55)
FAD volume flow unit (0601)		(→  55)
FAD volume unit (0591)		(→  55)

	Density unit (0555)	(→ 55)
	Pressure unit (0564)	(→ 55)
	Temperature unit (0557)	(→ 55)
Damping output (0477)	Length unit (0551)	(→ 55)
	Current output →	(→ 56)
	Assign current output (0359)	(→ 57)
	Mass flow unit (0554)	(→ 57)
	Corrected volume flow unit (0558)	(→ 57)
	FAD volume flow unit (0601)	(→ 57)
	Temperature unit (0557)	(→ 57)
	Current span (353)	(→ 57)
	4mA value (367)	(→ 57)
	20mA value (372)	(→ 57)
	Failure mode (364)	(→ 57)
	Failure current (352)	(→ 57)
	PFS output →	(→ 59)
	Operating mode (0469)	(→ 60)
	Assign pulse (0460)	(→ 60)
	Assign frequency (0478)	(→ 60)
	Switch output function (0481)	(→ 60)
	Assign diagnostic behavior (0482)	(→ 60)
	Assign limit (0483)	(→ 60)
	Assign status (0485)	(→ 60)
	Mass flow unit (0554)	(→ 60)
	Mass unit (0574)	(→ 60)
	FAD volume flow unit (0601)	(→ 60)
	FAD volume unit (0591)	(→ 60)


Corrected volume flow unit (0558)	(→  60)
Corrected volume unit (0575)	(→  60)
Unit (0915)	(→  60)
Temperature unit (0557)	(→  60)
Value per pulse (0455)	(→  60)
Pulse width (0452)	(→  60)
Failure mode (0480)	(→  60)
Minimum frequency value (0453)	(→  60)
Maximum frequency value (0454)	(→  60)
Maximum frequency value (0454)	(→  60)
Minimum frequency value (0453)	(→  60)
Measuring value at minimum frequency (0476)	(→  60)
Measuring value at maximum frequency (0475)	(→  60)
Measuring value at maximum frequency (0475)	(→  60)
Measuring value at minimum frequency (0476)	(→  60)
Failure mode (0451)	(→  60)
Failure frequency (0474)	(→  60)
Switch-on value (0466)	(→  60)
Switch-off value (0464)	(→  60)
Switch-off value (0464)	(→  60)
Switch-on value (0466)	(→  60)
Switch-on delay (0467)	(→  60)
Switch-off delay (0465)	(→  60)
Failure mode (0486)	(→  60)
Invert output signal (0470)	(→  60)

	Decimal places 3 (0118)	(→  67)
	Value 4 display (0109)	(→  67)
	Decimal places 4 (0119)	(→  68)
	Display interval (0096)	(→  68)
	Display damping (0094)	(→  68)
	Header (0097)	(→  68)
	Header text (0112)	(→  68)
	Separator (0101)	(→  68)
	Conf. backup disp. →	(→  68)
	Operating time (0652)	(→  68)
	Last backup (0102)	(→  68)
	Configuration management (0100)	(→  69)
	Comparison result (0103)	(→  69)
Diagnostics →		(→  79)
	Actual diagnostics (0691)	(→  79)
	Previous diagnostics (0690)	(→  79)
	Operating time from restart (0653)	-
	Operating time (0652)	(→  68)
	Diagnostics list →	(→  87)
	Diagnostics 1 to 5(0696)	(→  87)
	Event logbook →	(→  87)
	Filter options (0705)	(→  88)
	Events list →	(→  88)
	Device info →	(→  45)
	Device tag (0011)	(→  90)
	Serial number (0009)	(→  90)
	Firmware version (0010)	(→  45)
	Device name (0013)	(→  45)
	Order code (0008)	(→  45)

Extended order code 1 (0023)		(→ 45)
Extended order code 2 (0021)		(→ 45)
Extended order code 3 (0022)		(→ 45)
ENP version (0012)		(→ 45)
Device revision (0204)		(→ 45)
Device ID (0221)		(→ 45)
Device type (0222)		(→ 45)
Manufacturer ID (0223)		(→ 45)
Measured values	→	(→ 74)
	Process variables	→ (→ 75)
	Mass flow (1838)	(→ 75)
	Corrected volume flow (1847)	(→ 75)
	FAD volume flow (1851)	(→ 75)
	Temperature (1853)	(→ 75)
	Totalizer	→ (→ 75)
	Totalizer value (0911)	(→ 76)
	Totalizer overflow (0910)	(→ 76)
	Output values	→ (→ 76)
	Output current (0361)	(→ 76)
	Pulse output (0456)	(→ 76)
	Output frequency (0471)	(→ 76)
	Switch status (0461)	(→ 76)
	Data logging	→ (→ 78)
	Assign channel 1 (0851)	(→ 78)
	Assign channel 2 (0852)	(→ 78)
	Assign channel 3 (0853)	(→ 78)
	Assign channel 4 (0854)	(→ 78)
	Logging interval (0856)	(→ 78)
	Clear logging data (0855)	(→ 78)


	Display channel 1	→	(→ 78)
	Display channel 2	→	(→ 78)
	Display channel 3	→	(→ 78)
	Display channel 4	→	(→ 78)
	Simulation	→	(→ 69)
	Assign simulation process variable (1810)		(→ 70)
	Value process variable (1811)		(→ 70)
	Simulation current output 1 (0354)		(→ 70)
	Value current output 1 (0355)		(→ 70)
	Frequency simulation (0472)		(→ 70)
	Frequency value (0473)		(→ 70)
	Pulse simulation (0458)		(→ 70)
	Pulse value (0459)		(→ 70)
	Switch output simulation (0462)		(→ 70)
	Switch status (0463)		(→ 70)
	Simulation device alarm (0654)		(→ 70)
	Device reset	→	(→ 87)
	Device reset		(→ 87)
	Expert	→	
	Direct access (0106)		(→ 31)
	Locking status (0122)		(→ 29)
	Access stat.display (0091)		
	System	→	
	Enter access code (0003)		(→ 71)
	Define access code (0093)		(→ 71)
	Display	→	(→ 74)
	Language (0104)		(→ 47)
	Format display (0098)		(→ 66)

Value 1 display (0107)		(→ 67)
0% bargraph value 1 (0123)		(→ 67)
100% bargraph value 1 (0125)		(→ 67)
Decimal places 1 (0095)		(→ 67)
Value 2 display (0108)		(→ 67)
Decimal places 2 (0117)		(→ 67)
Value 3 display (0110)		(→ 67)
0% bargraph value 3 (0124)		(→ 67)
100% bargraph value 3 (0126)		(→ 67)
Decimal places 3 (0118)		(→ 67)
Value 4 display (0109)		(→ 67)
Decimal places 4 (0119)		(→ 68)
Display interval (0096)		(→ 68)
Display damping (0094)		(→ 68)
Header (0097)		(→ 68)
Header text (0112)		(→ 68)
Separator (0101)		(→ 68)
Contrast display (0105)		(→ 74)
Access status display (0091)		(→ 40)
Conf. backup disp.	→	(→ 68)
Operating time		(→ 68)
Last backup		(→ 68)
Configuration management		(→ 69)
Comparison result		(→ 69)
Diagnostic behavior	→	
Alarm delay	→	
		Diagnostic behavior →
Management	→	
Device reset (0000)		(→ 87)

 
 
 
 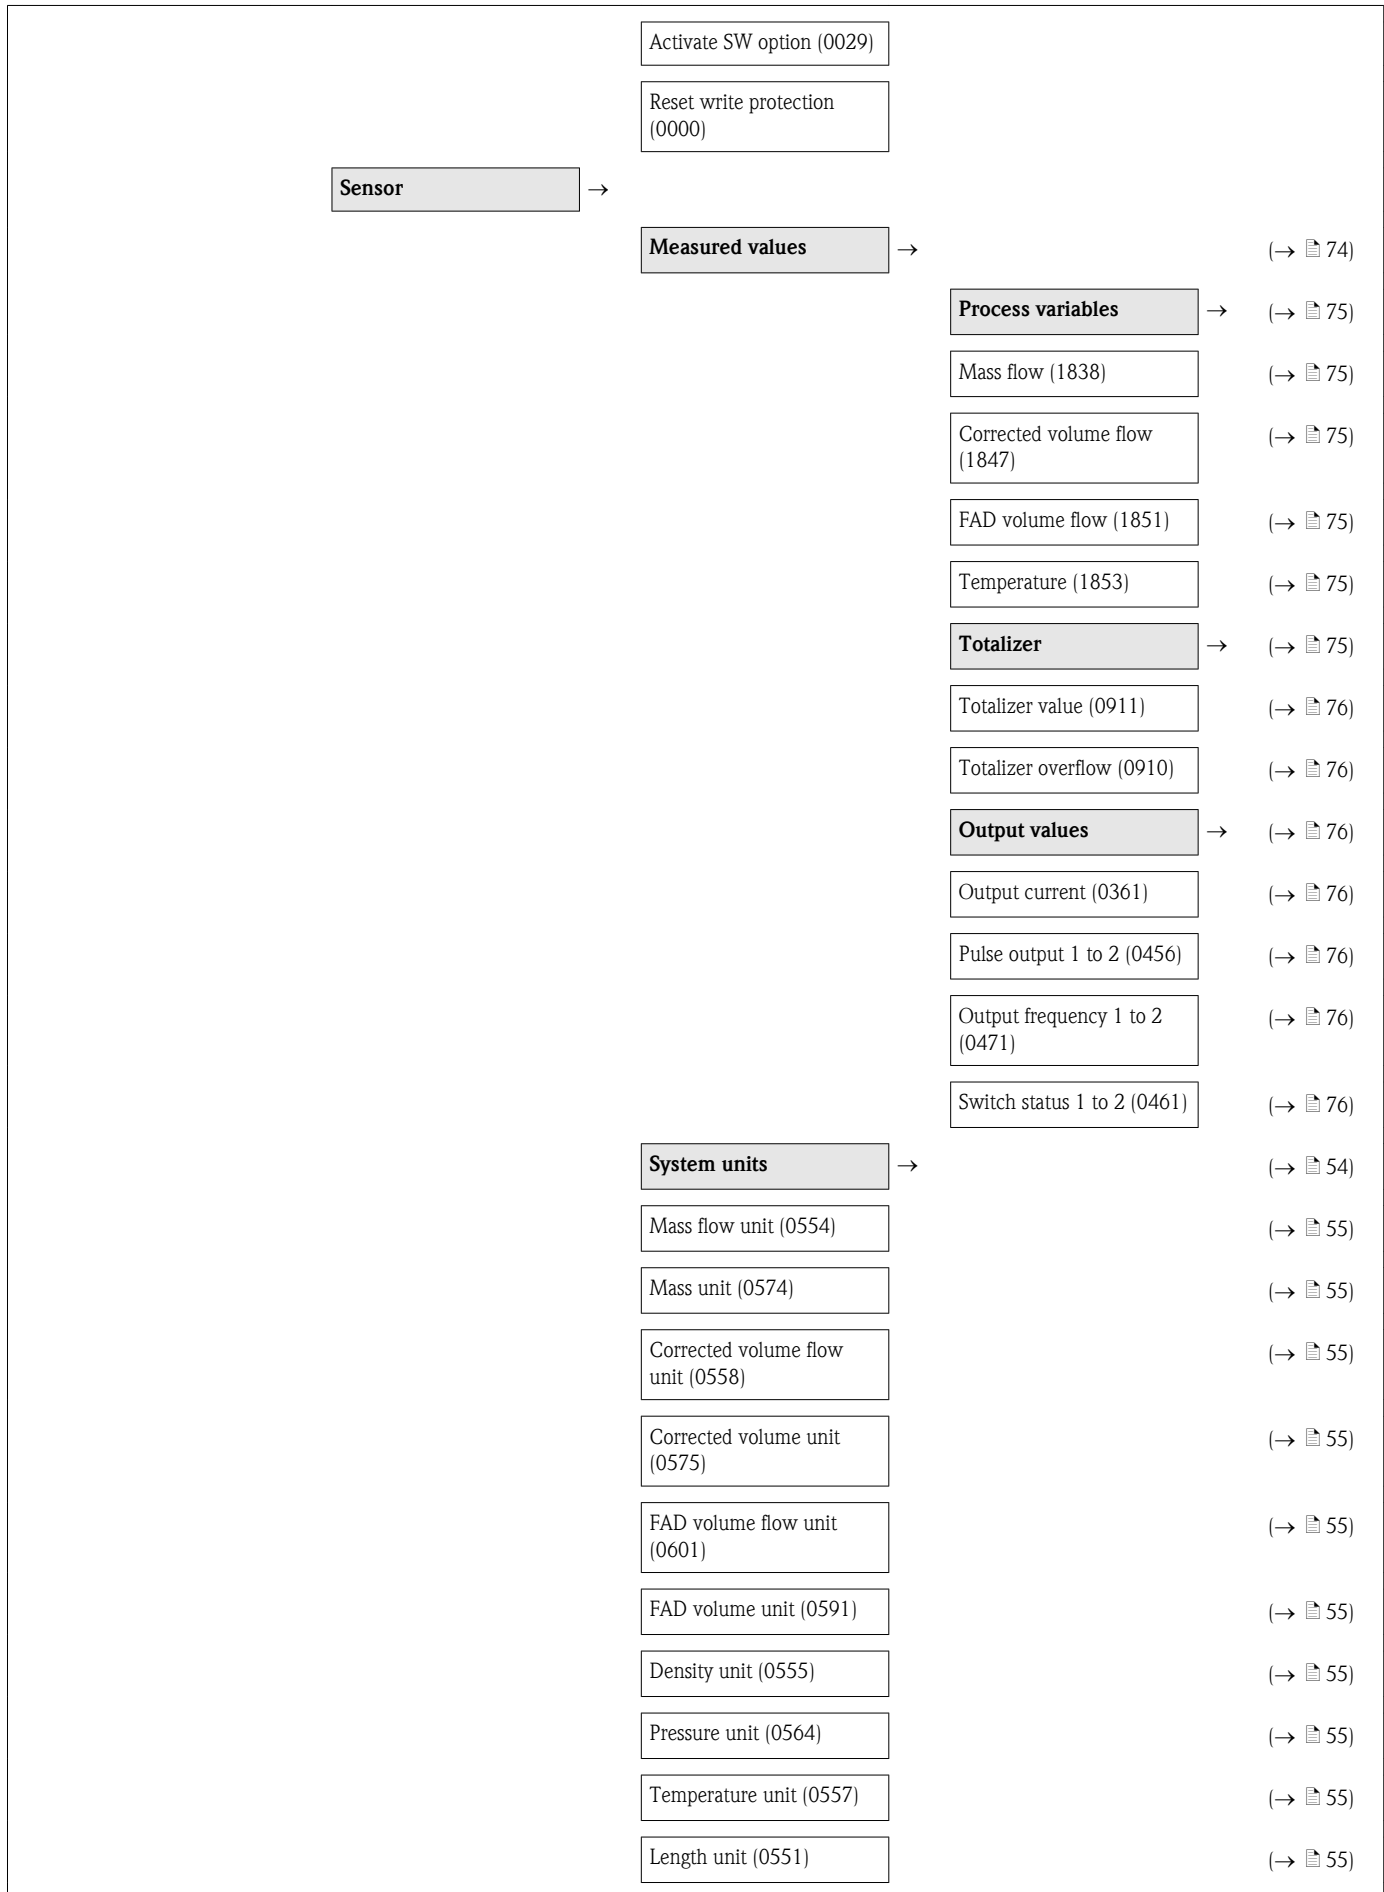

 
 
 
 
 
 
 
 
 


Date/time format (2812)		
	User spec. units	→
	User mass text (560)	
	User mass offset (562)	
	User mass factor (561)	
	Process param.	→
	Flow override (1839)	
	Flow damping (1802)	
	Low flow cut off	→ (→ 65)
	Assign process variable (1837)	(→ 65)
	On value low flow cutoff (1805)	(→ 65)
	Off value low flow cutoff (1804)	(→ 65)
	Calculated value	→
	Reference values	→
	Reference conditions (3439)	(→ 54)
	Reference pressure (3378)	(→ 54)
	Reference temperature (3379)	(→ 54)
	Reference density (3377)	
	FAD conditions (3438)	(→ 54)
	FAD pressure (3473)	(→ 54)
	FAD temperature (3474)	(→ 54)
	FAD density (3372)	
	Fluid properties	→
	Density (3462)	
	Reference density (3377)	
	FAD density (3372)	
	Sensor adjustment	→
	Installation settings	→
	Installation factor (3470)	(→ 49)



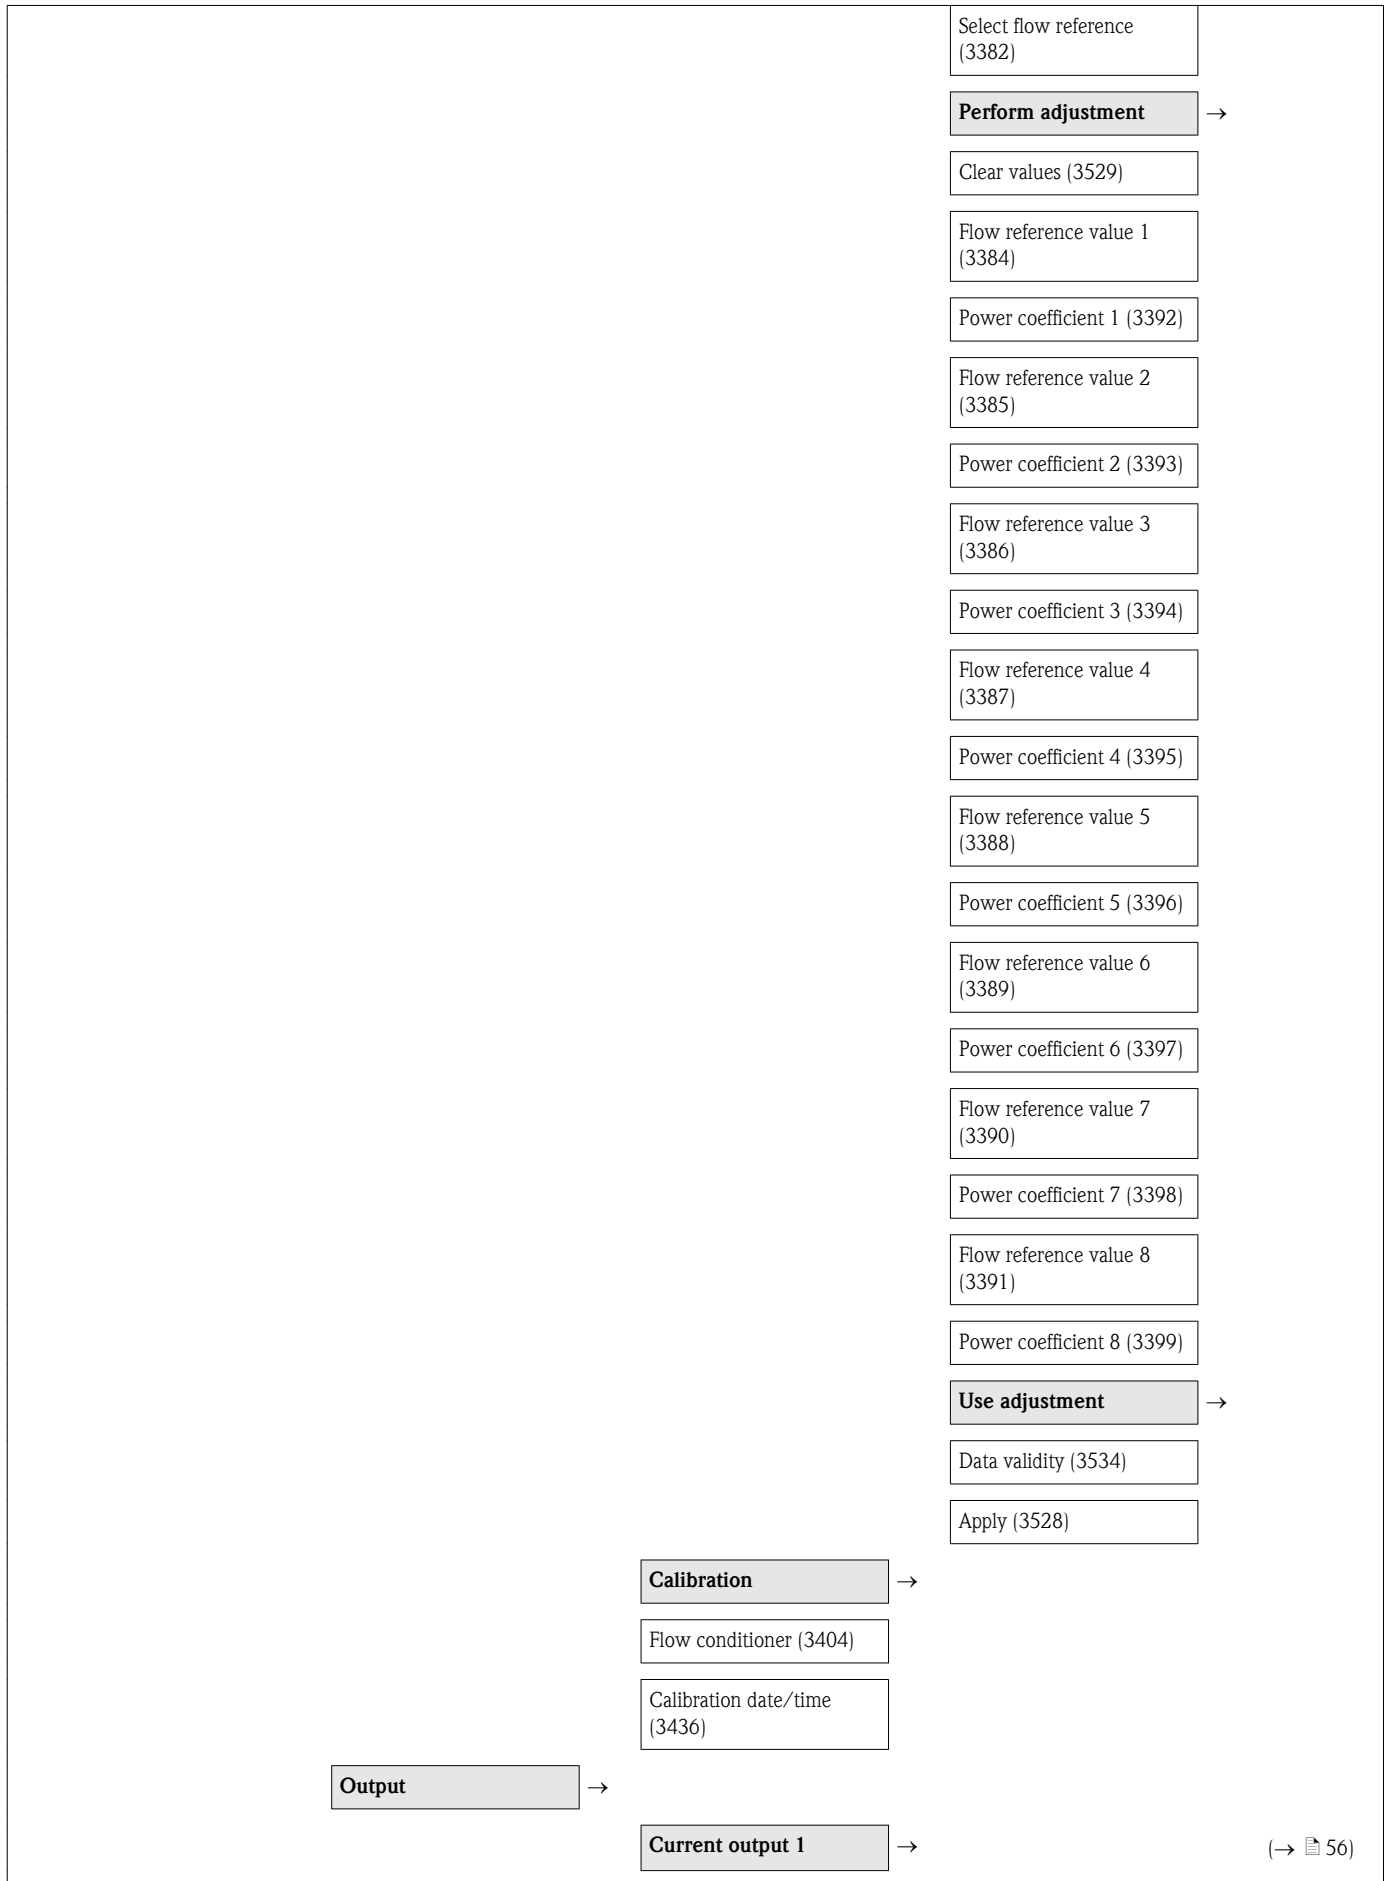






















Orientation (3437)	
Pipe wall thickness (3409)	
Mounting set height (3435)	
In-situ adjustment	→
Operating mode (3400)	
Values in use	→
Flow reference in use (3440)	
Flow reference value 1 (3401)	
Power coefficient 1 (3425)	
Flow reference value 2 (3418)	
Power coefficient 2 (3426)	
Flow reference value 3 (3419)	
Power coefficient 3 (3427)	
Flow reference value 4 (3420)	
Power coefficient 4 (3428)	
Flow reference value 5 (3421)	
Power coefficient 5 (3429)	
Flow reference value 6 (3422)	
Power coefficient 6 (3430)	
Flow reference value 7 (3423)	
Power coefficient 7 (3431)	
Flow reference value 8 (3424)	
Power coefficient 8 (3432)	
Flow reference value 9 (3474)	
Power coefficient 9 (3475)	
New adjustment	→


 






 
























(→ 56)

Assign current output (359)	(→  57)
Current span (353)	
Fixed current (365)	
4mA value (367)	
20mA value (372)	
Damping (363)	(→  64)
Response time (378)	(→  64)
Failure mode (364)	
Output current (361)	(→  76)
Start-up mode (368)	
PFS output 1	→
Operating mode (469)	(→  50)
Assign pulse (460)	(→  51)
Value per pulse (455)	(→  51)
Pulse width (452)	(→  60)
Failure mode (480)	(→  60)
Pulse output (456)	(→  76)
Assign frequency (478)	(→  50)
Minimum frequency value (453)	(→  60)
Maximum frequency value (454)	(→  60)
Measuring value at minimum frequency (476)	(→  60)
Measuring value at maximum frequency (475)	(→  60)
Damping output (477)	(→  64)
Response time (491)	(→  64)
Failure mode (451)	(→  60)
Output frequency (471)	(→  76)
Switch output function (481)	(→  51)
Assign diagnostic behavior (482)	(→  60)

	Assign limit (483)	(→ 60)
	Switch-on value (466)	(→ 51)
	Switch-off value (464)	(→ 51)
	Assign status (485)	(→ 51)
	Switch-on delay (467)	(→ 60)
	Switch-off delay (465)	(→ 60)
	Failure mode (486)	(→ 60)
	Switch status (461)	(→ 76)
	Invert output signal (470)	(→ 60)
Communication →		
	HART output →	
		Configuration →
		Burst mode (208)
		Burst command (207)
		HART address (219)
		No. of preambles (217)
		HART short tag (220)
		Information
		Device revision (204) (→ 45)
		Device ID (221) (→ 45)
		Device type (222) (→ 45)
		Manufacturer ID (223) (→ 45)
		HART revision (205)
		HART descriptor (212)
		HART message (216)
		HART date code (202)
		Hardware revision (206)
		Software revision (224)
		Output (→ 45)
		Assign PV (234) (→ 45)
		Primary variable (PV) (201) (→ 45)

		Assign SV (235)	(→  45)
		Secondary variable (SV) (226)	(→  45)
		Assign TV (236)	(→  45)
		Tertiary variable (TV) (228)	(→  45)
		Assign QV (237)	(→  45)
		Quaternary variable (QV) (203)	(→  45)
	Application →		
	Reset all totalizers (2806)		(→  77)
		Totalizer →	
		Assign process variable (914)	(→  66)
		Unit (915)	(→  66)
		Control totalizer (912)	(→  77)
		Preset value (913)	(→  77)
		Failure mode (901)	(→  66)
	Diagnostics →		
	Actual diagnostics (691)		(→  79)
	Previous diagnostics (690)		(→  79)
	Operating time from restart (653)		-
	Operating time (652)		(→  68)
		Diagnostics list →	(→  87)
		Diagnostics 1 (692)	(→  87)
		Diagnostics 2 (693)	(→  87)
		Diagnostics 3 (694)	(→  87)
		Diagnostics 4 (695)	(→  87)
		Diagnostics 5 (696)	(→  87)
		Event logbook →	(→  87)
		Filter options (705)	(→  88)
		Device info →	(→  45)
		Device tag (11)	(→  90)

Serial number (9)		(→  90)
Firmware version (10)		(→  45)
Device name (13)		(→  45)
Order code (8)		(→  45)
Extended order code 1 (23)		(→  45)
Extended order code 2 (21)		(→  45)
Extended order code 3 (22)		(→  45)
ENP version (12)		(→  45)
Configuration counter (233)		
Data logging	→	(→  78)
Assign channel 1 (851)		(→  78)
Assign channel 2 (852)		(→  78)
Assign channel 3 (853)		(→  78)
Assign channel 4 (854)		(→  78)
Logging interval (856)		(→  78)
Clear logging data (855)		(→  78)
		Display channel 1 → (→  78)
		Display channel 2 → (→  78)
		Display channel 3 → (→  78)
		Display channel 4 → (→  78)
Data logging	→	
		Electronics temperature →
		Minimum value (3445)
		Maximum value (3444)
		Process temperature →
		Minimum value (3447)
		Maximum value (3446)
Simulation	→	(→  69)
Assign process variable (1810)		(→  70)

          Value process variable (1811)	(→  70)
Simulation current output 1 (354)	(→  70)
Value current output 1 (355)	(→  70)
Frequency simulation (472)	(→  70)
Frequency value (473)	(→  70)
Pulse simulation (458)	(→  70)
Pulse value (459)	(→  70)
Switch output simulation (462)	(→  70)
Pulse value (463)	(→  70)
Simulation device alarm (654)	(→  70)

Index

A

- Access authorization to parameters
 - Read access 40
 - Write access 40
- Access code 40
 - Incorrect input 40
- Adapting the diagnostic behavior 84
- Ambient temperature range 19, 102
- AMS Device Manager 42
 - Function 42
- Application 8, 94
- Applicator 94, 94, 95
- Approvals 107

C

- C-Tick symbol 107
- Cable entries
 - Technical data 99
- Cable entry
 - Degree of protection 24
- Cable specification 22, 100
- CE mark 107
- CE mark (declaration of conformity) 9
- Certificates 107
- Characteristic values 94
- Check
 - Installation 21
 - Post-connection 25
 - Received goods 11
- Checklist
 - Post-connection check 25
 - Post-mounting check 21
- Cleaning
 - Cleaning the transducer 91
 - Exterior cleaning 91
 - Interior cleaning 91
- Commissioning 47
 - Advanced settings 52
 - Configuring the measuring device 48
- Communication-specific data 45
- Connecting cable
 - Requirements 22
- Connecting the measuring device 23
- Connection preparations 23
- Connection tools 22
- Context menu
 - Calling up 35
 - Close 35
 - Explanation 35
- Current consumption 99

D

- Declaration of Conformity 9
- Declaration of Contamination 92
- Define access code 71
- Degree of protection 24, 102

Design

- Measuring device 10
- Designated use
 - 8
- Device components 10
- Device description files 45, 45
- Device documentation
 - Supplementary documentation 7
- Device name
 - Sensor 13
 - Transmitter 12
- Device repair 90
- Device revision 45
- Device type ID 45
- Diagnosis
 - Symbols 81
- Diagnostic behavior
 - Explanation 81
 - Symbols 81
- Diagnostic information 82
 - In the operating tool 83
 - Local display 81
 - Overview 85
 - Remedy information 85
- Diagnostic message 81
- Diagnostics list 87
- DIP switch
 - see Write protection switch
- Direct access 37
- Direct access code 31
- Disabling write protection 70
- Display
 - see Local display
- Display area
 - For operational display 30
 - In the navigation view 32
- Display values
 - For output values 76
 - For process variables 75
 - For the totalizer 75
- Disposal 93
- Document
 - Function 5
 - Symbols used 5
- Document function 5

E

- Electrical connection
 - Commubox FXA191, 195 43
 - Commubox FXA195 106
 - Commubox FXA291 44, 107
 - Degree of protection 24
 - Field Communicator 43, 106
 - Handheld terminals 43, 106
 - Measuring device 22
 - Operating tools 43, 106

Via HART protocol 43, 106
 Via service interface (CDI) 44, 107
 Electromagnetic compatibility 102
 Electronic modules 24
 Electronics board
 I/O electronics modules 24
 Electronics housing
 Turning
 see Turning the transmitter housing
 Electronics module 10
 Enabling write protection 70
 Endress+Hauser services
 About maintenance 91
 About repair 90
 Error messages
 see Diagnostic messages
 Event history 87
 Events list 87
 Ex approval 107
 Extended order code
 Sensor 13
 Transmitter 12
 Exterior cleaning 91

F

Field Communicator
 Function 43
 Field Communicator 475 43
 Field of application
 Residual risks 9
 Field Xpert 42
 Function 42
 FieldCare 42
 Function 42
 User interface 42
 Filtering the event logbook 88
 Firmware
 Release date 45
 Version 45
 Flow conditioner 17
 Pressure loss 18
 Flow direction 15, 20
 Flow limit 102
 Function check 47
 Function range
 AMS Device Manager 42
 Field Xpert 42
 FieldCare 42
 SIMATIC PDM 43
 Function scope
 Field Communicator 43
 Field Communicator 475 43
 Functions
 see Parameter

G

Galvanic isolation 97

H

HART protocol
 Device variables 45
 Measured variables 45
 Revision 45
 Help text
 Calling up 38
 Close 38
 Explanation 38
 HistoROM (description) 68

I

Identifying the measuring device 12
 Incoming acceptance 11
 Influence
 Medium pressure 101
 Information on the document 5
 Inlet runs 16
 Input mask 33
 Installation 15
 Installation conditions
 Inlet and outlet runs 16
 Installation dimensions 17
 Mounting location 15
 Orientation 15
 System pressure 19, 102
 Thermal insulation 19, 103
 Installation dimensions 17
 Interior cleaning 91

K

Keypad lock
 Disabling 40
 Enabling 40

L

Languages, local operation 107
 Line recorder 78
 Load 22
 Local display 105
 Editing view 33
 Navigation view 31
 see Diagnostic message
 see In alarm condition
 see Operational display
 Local operation
 Languages 107
 Low flow cut off 97

M

Main electronics module 10
 Maintenance 91
 Maintenance tasks 91
 Managing the device configuration 68
 Manufacturer ID 45
 Manufacturing date 12, 13
 Materials 104
 Maximum measured error 100
 Measured variables

- Calculated 94
 - Direct 94
 - see Process variables
 - Measuring and test equipment 91
 - Measuring device
 - Configuration 48
 - Conversion 90
 - Design 10
 - Disposal 93
 - Enabling 47
 - Integrating via HART protocol 45
 - Mounting the sensor 20
 - Preparing for electrical connection 23
 - Preparing for mounting 20
 - Removing 93
 - Repair 90
 - Return 92
 - Measuring principle 94
 - Measuring range 94
 - Calibrated 94
 - Extended 95
 - Measuring range, recommended 102
 - Measuring system 94
 - Media 8
 - Medium pressure
 - Influence 101
 - Menus
 - For measuring device configuration 48
 - For specific settings 52
 - Mounting dimensions
 - see Installation dimensions
 - Mounting location 15
 - Mounting preparations 20
 - Mounting tools 19
- N**
- Nameplate
 - Sensor 13
 - Transmitter 12
 - Navigation path (navigation view) 31
 - Navigation view
 - In the wizard 31
 - Of the submenu 31
 - Numeric editor 33
- O**
- Operable flow range 95
 - Operating elements 34, 82
 - Operating keys
 - see Operating elements
 - Operating menu
 - Design 26
 - Menus, submenus 26
 - Submenus and user roles 28
 - Wizards 26
 - Operating menu overview
 - Operators and maintenance 109
 - Operating philosophy 28
 - Operating tools
 - Connection overview 43
 - Operation 74
 - Operation options 26, 26
 - Operational display 29
 - Operational safety 9
 - Order code 12, 12, 13
 - Orientation (vertical, horizontal) 15
 - Outlet run
 - Pressure measuring device 17
 - Outlet runs 16
 - Output 95
 - Output signal 95
- P**
- Packaging disposal 14
 - Parameter
 - Changing 39
 - Enter a value 39
 - Parameter settings
 - Assign current output 50
 - For applications 53
 - For conf. backup disp. 68
 - For local display 66, 74
 - For low flow cut off 65
 - For medium selection and setting 49
 - For pulse/frequency/switch output 50
 - For simulation 69
 - For system units 55, 57, 60
 - For the installation factor setting 49
 - For the operation 77
 - For the process pressure setting 49
 - For the totalizer 64, 66
 - Performance characteristics 100
 - Post-connection
 - see Electrical connection
 - Post-connection check (checklist) 25
 - Post-installation check 47
 - Post-mounting check (checklist) 21
 - Potential equalization 99
 - Power supply failure 99
 - Pressure Equipment Directive 107
 - Pressure loss 102
 - Process connections 105
 - Product safety 9
 - Protecting parameter settings 70
- R**
- Read access 40
 - Reading measured values 74
 - Recalibration 91
 - Reference operating conditions 100
 - Registered trademarks 10
 - Remedial measures
 - Calling up 83
 - Closing 83
 - Remote operation 106
 - Repair 90
 - Concept 90
 - Notes 90

- Repair of a device 90
- Repeatability 101
- Replacement
 - Device components 90
- Requirements for personnel 8
- Response time 101
- Returning the measuring device 92
- S**
- Safety
 - Safety instructions 8
- Sensor
 - Medium temperature range 102
 - Mounting 20
 - System pressure 19, 102
- Serial number 12, 13
- Setting the operating language 47
- Settings
 - Adapting the measuring device to the process conditions 77
 - Applications 53
 - Current output 56, 59
 - Device reset 87
 - Device tag 53
 - Installation factor 49
 - Local display 66
 - Low flow cut off 65
 - Managing the device configuration 68
 - Medium 48, 49
 - Operating language 47
 - Pipe shape 50
 - Pulse/frequency/switch output 50
 - Resetting the totalizer 77
 - Simulation 69
 - System units 54
 - Totalizer 64, 66
 - Totalizer reset 77
- Shock resistance 102
- Showing data logging 78
- Signal on alarm 96
- SIMATIC PDM 43
 - Function 43
- Software release 45
- Spare part 90
- Spare parts 90
 - Concept 90
 - Nameplate 90
- Standards and guidelines 108
- Status area
 - For operational display 29
 - In the navigation view 31
- Status signals 81
- Storage conditions 14
- Storage temperature 14
- Structure of the operating menu 26
- Submenu
 - Conf. backup disp. 68
 - Current output 57
 - Data logging 78
- Events list 87
- Local display 65
- Operation 74, 77
- Output values 76
- PFS output 59
- Process variables 74
- Simulation 69
- System units 54
- Totalizer 64, 66, 75
- Submenus 28
- Supply unit
 - Requirements 22
- Supply voltage 22, 22, 99
- Symbols
 - For communication 29
 - For correction 33
 - For diagnostic behavior 29
 - For locking 29
 - For measured variable 30
 - For measurement channel number 30
 - For menus 32
 - For parameters 32
 - For status signal 29
 - For submenu 32
 - For wizard 32
 - In the status area of the local display 29
 - In the text and numeric editor 33
- System design
 - Measuring system 94
 - see Measuring device design
- System integration 45
- System pressure 19, 102
- T**
- Technical data, overview 94
- Temperature range
 - Ambient temperature 19, 102
 - Ambient temperature range for display 105
 - Medium temperature 102
 - Storage temperature 14
- Terminal assignment 24, 98
- Terminal voltage 22
- Terminals 99
- Text editor 33
- Thermal insulation 19, 103
- Tool tip
 - see Help text
- Tools
 - For electrical connection 22
 - For mounting 19
 - Transport 14
- Transmitter
 - Connecting the signal cables 24
 - Turning the display module 21
 - Turning the housing 20
- Transmitter housing
 - Turning 20
- Transporting the measuring device 14
- Troubleshooting

General	79
Turning the display module	21

U

Use of the measuring device see Designated use	
Use of the measuring devices	
Borderline cases	8
Incorrect use	8
User interface	
FieldCare	42
User roles	28

V

Version data for the device	45
Vibration resistance	102

W

W@M	90, 91
W@M Device Viewer	12, 90
Weight	
SI units	103
Transport (notes)	14
US units	103
Workplace safety	9
Write access	40
Write protection	
Via access code	71
Via write protection switch	71
Write protection switch	71

www.endress.com/worldwide

Endress+Hauser 

People for Process Automation
