Technical Information Cerabar PMC11, PMC21, PMP11, PMP21

Process pressure measurement



Pressure transducer with ceramic and metal sensors

Application

The Cerabar is a pressure transducer for the measurement of absolute and gauge pressure in gases, vapors, liquids and dust. The Cerabar can be used internationally thanks to a wide range of approvals and process connections.

Your benefits

- High reproducibility and long-term stability
- Reference accuracy: up to 0.3%
- Customized measuring ranges
 - Turn down up to 5:1
 - Sensor for measuring ranges up to 400 bar (6000 psi)
- Housing and process isolating diaphragm made of 316L





Table of contents

Document information	
Document function	
Symbols used	
Documentation	
Terms and abbreviations	
Turn down calculation	7
Function and system design	8
Measuring principle - process pressure measurement	8
Measuring system	
Device features	
Product design	11
System integration	11
Input	12
Measured variable	12
Measuring range	12
Output	15
Output signal	15
Signal range 4 to 20 mA	15
Load (for 4 to 20 mA devices)	15
Load resistance (for 0 to 10 V devices)	15
Signal on alarm 4 to 20 mA	15
Dead time, time constant	15 16
Dynamic behavior	10
Power supply	17
Terminal assignment	17
Supply voltage	17
Current consumption and alarm signal	17
Power supply fault	18
Electrical connection	18
Cable specification	18 18
Residual ripple	18
Overvoltage protection	18
orenoninge protection	10
Performance characteristics of ceramic process	10
isolating diaphragm	19 19
Reference operating conditions	19
measuring ranges	19
Influence of the installation position	19
Resolution	19
Reference accuracy	19
Thermal change of the zero output and the output span	19
Long-term stability	20
Switch-on time	20
Performance characteristics of metallic process	
isolating diaphragm	21
Reference operating conditions	21
Measuring uncertainty for small absolute pressure	
measuring ranges	21

Reference accuracy	21 21 21 21
InstallationInstallation conditionsInfluence of the installation positionMounting locationMounting instructions for oxygen applications	22 22 22 22 23
Environment	25 25 25 25 25 25 25
Process Process temperature range for devices with ceramic	26
process isolating diaphragm	26
process isolating diaphragm	26
Pressure specifications	27
Mechanical construction Design, dimensions Electrical connection Housing Process connections with internal, ceramic process isolating diaphragm Process connections with internal, metal process isolating diaphragm Process connections with internal, metal process isolating diaphragm Process connections with internal, metal process isolating diaphragm Process connections with internal, metal process isolating diaphragm Process connections with internal, metal process isolating diaphragm Process connections with flush-mounted, metal process isolating diaphragm Materials in contact with process Materials not in contact with process Cleaning	28 28 29 30 31 32 32 32 33 34 35 35 36 37 38 39 40
Plug-on display PHX20 (optional)	40
Certificates and approvals	41 41

RoHSRCM-Tick markingEAC conformityApprovalApprovalSafety Instructions (XA)Marine approval (pending)Pressure Equipment Directive 2014/68/EU (PED)Other standards and guidelinesCRN approvalCalibration unitCalibrationInspection certificates	$\begin{array}{c} 41 \\ 41 \\ 41 \\ 41 \\ 42 \\ 42 \\ 42 \\ 43 \\ 43 \\ 43 \\ 43 \end{array}$
Ordering information	44
Scope of delivery	44
	44
	45
Accessories	
Accessories	45
Accessories	45
Accessories . Weld-in adapter . Plug-on display PHX20 . M12 plug connectors . Documentation .	45 45 45 45 45
Accessories . Weld-in adapter . Plug-on display PHX20 . M12 plug connectors . Documentation . Field of Activities .	45 45 45 45 45 46 46
Accessories . Weld-in adapter . Plug-on display PHX20 . M12 plug connectors . Documentation . Field of Activities . Technical Information .	45 45 45 45 46 46 46
Accessories . Weld-in adapter . Plug-on display PHX20 . M12 plug connectors . Documentation . Field of Activities . Technical Information . Operating Instructions .	45 45 45 45 46 46 46 46
Accessories . Weld-in adapter . Plug-on display PHX20 . M12 plug connectors . Documentation . Field of Activities . Technical Information .	45 45 45 45 46 46 46

Document information

Document function

The document contains all the technical data on the device and provides an overview of the accessories and other products that can be ordered for the device.

Symbols used

Safety symbols

Symbol	Meaning
A DANGER	DANGER! This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.
WARNING	WARNING! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.
	CAUTION! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.
NOTICE	NOTE! This symbol contains information on procedures and other facts which do not result in personal injury.

Electrical symbols

Symbol	Meaning	Symbol	Meaning
	Protective ground connection A terminal which must be connected to ground prior to establishing any other connections.	<u>+</u>	Ground connection A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system.

Symbols for certain types of information

Symbol	Meaning
	Permitted Procedures, processes or actions that are permitted.
\mathbf{X}	Forbidden Procedures, processes or actions that are forbidden.
i	Tip Indicates additional information.
I	Reference to documentation
	Reference to page
	Reference to graphic
	Visual inspection

Symbols in graphics

Symbol	Meaning
1, 2, 3	Item numbers
1. , 2. , 3	Series of steps
A, B, C,	Views

E

Documentation

The document types listed are available:

In the Download Area of the Endress+Hauser Internet site: www.endress.com \rightarrow Download

Brief Operating Instructions (KA): getting the 1st measured value quickly

The Brief Operating Instructions contain all the essential information from incoming acceptance to initial commissioning.

Operating Instructions (BA): your comprehensive reference

These Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

Safety Instructions (XA)

Safety Instructions (XA) are supplied with the device depending on the approval. These instructions are an integral part of the Operating Instructions.

Device	Directive	Documentation	Option 1)
PMP21	ATEX II 1/2G Ex ia IIC T4 Ga/Gb	XA01271P	BA
PMC21	ATEX II 2G Ex ia IIC T4 Gb	XA01271P	BB
PMC21 PMP21	ATEX II 3G Ex ec IIC T4 Gc	XA01533P	BC
PMC21 PMP21	FM IS Cl. I, Div.1 Gr. A-D T4	XA01321P	FA
PMC21 PMP21	CSA C/US IS Cl. I Div. 1 Gr. A-D	XA01322P	СВ
PMC21 PMP21	EAC Ex ia IIC T4 Ga/Gb	XA01540P	GA
PMC21 PMP21	IEC Ex ia IIC T4 Ga/Gb	XA01271P	IA
PMC21 PMP21	NEPSI Ex ia IIC T4	XA01363P	NA
PMC21 PMP21	TIIS Ex ia IIC T4	In preparation	ТА

1) Product Configurator, order code for "Approval"

The nameplate provides information on the Safety Instructions (XA) that are relevant for the device.


A0029505

Terms and abbreviations

Term/ Item Explanation abbreviation OPL 1 The OPL (over pressure limit = sensor overload limit) for the measuring device depends on the lowest-rated element, with regard to pressure, of the selected components, i.e. the process connection has to be taken into consideration in addition to the measuring cell. Also observe pressure-temperature dependency. For the relevant standards and additional notes, see the "Pressure specifications" section → 🖹 27. The OPL may only be applied for a limited period of time. 2 MWP The MWP (maximum working pressure) for the sensors depends on the lowestrated element, with regard to pressure, of the selected components, i.e. the process connection has to be taken into consideration in addition to the measuring cell. Also observe pressure-temperature dependency. For the relevant standards and additional notes, see the "Pressure specifications" section \rightarrow 🗎 27 . The MWP may be applied at the device for an unlimited period. The MWP can also be found on the nameplate. 3 Maximum sensor Span between LRL and URL This sensor measuring range is equivalent to the maximum calibratable/adjustable measuring range span. 4 Calibrated/ Span between LRV and URV Factory setting: 0 to URL adjusted span Other calibrated spans can be ordered as customized spans. Pressure р LRL Lower range limit URL Upper range limit LRV Lower range value URV Upper range value TD (turn down) Turn down The turn down is preset at the factory and cannot be changed. Example - see the following section.

Endress+Hauser

Turn down calculation

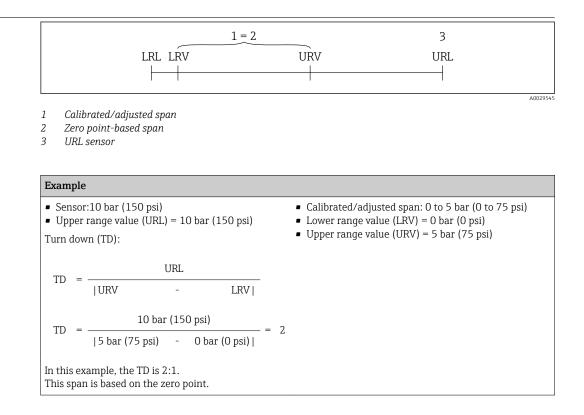

Function and system design

Devices with ceramic process isolating diaphragm (Ceraphire®)

The ceramic sensor is an oil-free sensor, i.e. the process pressure acts directly on the robust ceramic process isolating diaphragm and causes it to deflect. A pressure-dependent change in capacitance is measured at the electrodes of the ceramic substrate and the process isolating diaphragm. The measuring range is determined by the thickness of the ceramic process isolating diaphragm.


Advantages:

Measuring principle -

process pressure

measurement

- Guaranteed overload resistance up to 40 times the nominal pressure
- The ultrapure 99.9% ceramic (Ceraphire[®], see also "www.endress.com/ceraphire") ensures:
 Extremely high chemical durability
 - High mechanical durability
- Can be used in absolute vacuum
- Small measuring ranges

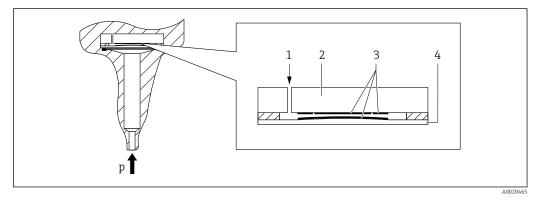


- 1 Air pressure (gauge pressure sensors)
- 2 Ceramic substrate
- 3 Electrodes
- 4 Ceramic process isolating diaphragm

Devices with metallic process isolating diaphragm

The process pressure deflects the metal process isolating diaphragm of the sensor and a fill fluid transfers the pressure to a Wheatstone bridge (semiconductor technology). The pressure-dependent change in the bridge output voltage is measured and evaluated.

Advantages:


- Can be used for high process pressures
- Fully welded sensor
- Slim, flush-mounted process connections available

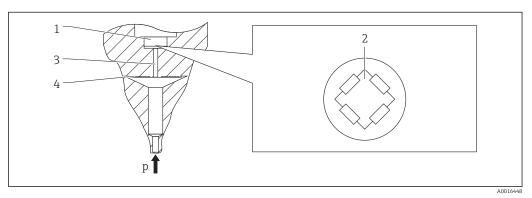

- 1 Silicon measuring element, substrate
- 2 Wheatstone bridge
- 3 Channel with fill fluid
- 4 Metal process isolating diaphragm

Measuring system

A complete measuring system comprises:

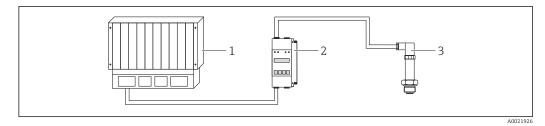

PLC (programmable logic control) e.g. RN221N / RMA42 (if required) Pressure transducer 1 2 3

Device features

	PMC11
Field of application	Gauge pressure
Process connections	Thread ISO 228Thread ASMEDIN 13
Measuring ranges	From -400 to +400 mbar (-6 to +6 psi) to -1 to +40 bar (-15 to +600 psi).
OPL (depends on the measuring range)	Max. 0 to +60 bar (0 to +900 psi)
Process temperature range	-25 to +85 °C (-13 to +185 °F)
Ambient temperature range	-40 to +70 °C (-40 to +158 °F)
Reference accuracy	Up to 0.5 %, TD 5:1, for details see the "Reference accuracy" section.
Supply voltage	 4 to 20 mA output: 10 to 30V DC 0 to 10 V output: 12 to 30V DC
Output	 4 to 20 mA 0 to 10 V
Material	 Housing made from 316L (1.4404) Process connections made from 316L Process isolating diaphragm made from Al₂O₃ aluminum-oxide ceramic, (Ceraphire[®]), ultrapure 99.9 %
Options	Certificate of calibrationCleaned from oil+grease

	PMP11
Field of application	Gauge pressure
Process connections	Thread ISO 228, also flush-mountThread ASMEDIN 13
Measuring ranges	From -400 to +400 mbar (-6 to +6 psi) to -1 to +40 bar (-15 to +600 psi).
OPL (depends on the measuring range)	Max. 0 to +160 bar (0 to +2 400 psi)
Process temperature range	-25 to +85 °C (-13 to +185 °F)
Ambient temperature range	-40 to +70 °C (-40 to +158 °F)
Reference accuracy	Up to 0.5 %, TD 5:1, for details see the "Reference accuracy" section.
Supply voltage	 4 to 20 mA output: 10 to 30V DC 0 to 10 V output: 12 to 30V DC
Output	 4 to 20 mA 0 to 10 V


	PMP11
Material	 Housing made from 316L (1.4404) Process connections made from 316L (1.4404) Process isolating diaphragm made from 316L (1.4435)
Options	Certificate of calibrationCleaned from oil+grease

	PMC21
Field of application	Gauge pressure and absolute pressure
Process connections	 Thread ISO 228 Thread DIN 13 Thread ASME Thread JIS
Measuring ranges	From -100 to +100 mbar (-1.5 to +1.5 psi) to -1 to +40 bar (-15 to +600 psi).
OPL (depends on the measuring range)	Max. 0 to +60 bar (0 to +900 psi)
Process temperature range	-25 to +100 °C (-13 to +212 °F)
Ambient temperature range	 -40 to +85 °C (-40 to +185 °F) Devices for hazardous areas: -40 to +70 °C (-40 to +158 °F)
Reference accuracy	Up to 0.3 %, TD 5:1, for details see the "Reference accuracy" section.
Supply voltage	10 to 30 V DC
Output	4 to 20 mA
Material	 Housing made from 316L (1.4404) Process connections made from 316L Process isolating diaphragm made from Al₂O₃ aluminum-oxide ceramic, (Ceraphire[®]), ultrapure 99.9 %
Options	 Ex approvals Marine certificate Min. alarm current setting 3.1 Material certificates Certificate of calibration Cleaned from oil+grease Cleaned for O₂ service

	PMP21			
Field of application	Gauge pressure and absolute pressure			
Process connections	 Thread ISO 228, also flush-mount Thread DIN 13 Thread ASME Thread JIS 			
Measuring ranges	From -400 to +400 mbar (-6 to +6 psi) to -1 to +400 bar (-15 to +6000 psi).			
OPL (depends on the measuring range)	Max. 0 to +600 bar (0 to +9000 psi)			
Process temperature range	-40 to +100 °C (-40 to +212 °F)			
Ambient temperature range	-40 to +85 °C (-40 to +185 °F)			
Reference accuracy	Up to 0.3 %, TD 5:1, for details see the "Reference accuracy" section.			
Supply voltage	10 to 30 V DC			
Output	4 to 20 mA			

	PMP21
Material	 Housing made from 316L (1.4404) Process connections made from 316L (1.4404) Process isolating diaphragm made from 316L (1.4435)
Options	 Ex approvals Marine certificate Min. alarm current setting 3.1 Material certificates Certificate of calibration Cleaned from oil+grease

Product design

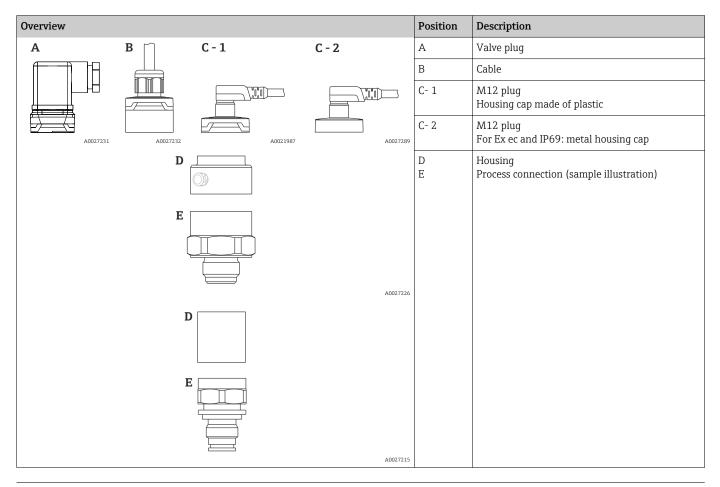

System integration

The device can be given a tag name (max. 8 alphanumeric characters).

Description	Option ¹⁾
Measuring point (TAG), see additional specifications	Z1

1) Product Configurator, order code for "Identification"

Input

Measured variable

Measured process variable

- PMC11: gauge pressurePMP11: gauge pressure
- PMC21: gauge pressure or absolute pressure
- PMP21: gauge pressure or absolute pressure

Calculated process variable

Pressure

Measuring range

Ceramic process isolating diaphragm

Sensor	Device	Maximum Sensor meas	uring range	Lowest calibratable	MWP	OPL	Factory settings ²⁾	Option ³⁾
		lower (LRL) upper (URL)		span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for gauge pres	ssure mea	surement						
100 mbar (1.5 psi) ⁴⁾	PMC21	-0.1 (-1.5)	+0.1 (+1.5)	0.02 (0.3)	2.7 (40.5)	4 (60)	0 to 100 mbar (0 to 1.5 psi)	1C
250 mbar (4 psi) ⁵⁾	PMC21	-0.25 (-4)	+0.25 (+4)	0.05 (1)	3.3 (49.5)	5 (75)	0 to 250 mbar (0 to 4 psi)	1E
400 mbar (6 psi) ⁶⁾	PMC11 PMC21	-0.4 (-6)	+0.4 (+6)	0.08 (1.2)	5.3 (79.5)	8 (120)	0 to 400 mbar (0 to 6 psi)	1F
1 bar (15 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+1 (+15)	0.2 (3)	6.7 (100.5)	10 (150)	0 to 1 bar (0 to 15 psi)	1H
2 bar (30 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+2 (+30)	0.4 (0.6)	12 (180)	18 (270)	0 to 2 bar (0 to 30 psi)	1K
4 bar (60 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+4 (+60)	0.8 (1.2)	16.7 (250.5)	25 (375)	0 to 4 bar (0 to 60 psi)	1M
6 bar (90 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+6 (+90)	2.4 (36)	26.7 (400.5)	40 (600)	0 to 6 bar (0 to 90 psi)	1N
10 bar (150 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+10 (+150)	2 (30)	26.7 (400.5)	40 (600)	0 to 10 bar (0 to 150 psi)	1P
16 bar (240 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+16 (+240)	6.4 (96)	40 (600)	60 (900)	0 to 16 bar (0 to 240 psi)	1Q
25 bar (375 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+25 (+375)	10 (150)	40 (600)	60 (900)	0 to 25 bar (0 to 375 psi)	1R
40 bar (600 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+40 (+600)	8 (120)	40 (600)	60 (900)	0 to 40 bar (0 to 600 psi)	1S

Sensor	Device	Maximum Sensor meas			MWP	OPL	Factory settings ²⁾	Option ³⁾
		lower (LRL)	upper (URL)	span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for absolute p	Devices for absolute pressure measurement							
100 mbar (1.5 psi) ⁶⁾	PMC21	0	+0.1 (+1.5)	0.1 (1.5)	2.7 (40.5)	4 (60)	0 to 100 mbar (0 to 1.5 psi)	2C
250 mbar (4 psi) ⁶⁾	PMC21	0	+0.25 (+4)	0.25 (4)	3.3 (49.5)	5 (75)	0 to 250 mbar (0 to 4 psi)	2E
400 mbar (6 psi) ⁶⁾	PMC21	0	+0.4 (+6)	0.4 (6)	5.3 (79.5)	8 (120)	0 to 400 mbar (0 to 6 psi)	2F
1 bar (15 psi) ⁶⁾	PMC21	0	+1 (+15)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 1 bar (0 to 15 psi)	2H
2 bar (30 psi) ⁶⁾	PMC21	0	+2 (+30)	0.4 (0.6)	12 (180)	18 (270)	0 to 2 bar (0 to 30 psi)	2K
4 bar (60 psi) ⁶⁾	PMC21	0	+4 (+60)	0.8 (1.2)	16.7 (250.5)	25 (375)	0 to 4 bar (0 to 60 psi)	2M
10 bar (150 psi) ⁶⁾	PMC21	0	+10 (+150)	2 (30)	26.7 (400.5)	40 (600)	0 to 10 bar (0 to 150 psi)	2P
40 bar (600 psi) ⁶⁾	PMC21	0	+40 (+600)	8 (120)	40 (600)	60 (900)	0 to 40 bar (0 to 600 psi)	2S

Highest turn down that can be set at the factory: 5:1. The turn down is preset and cannot be changed. 1)

Other measuring ranges (e.g. -1 to +5 bar (-15 to 75 psi)) can be ordered with customer-specific settings (see the Product Configurator, order 2)

code for "Calibration; Unit" option "J"). It is possible to invert the output signal (LRV = 20 mA; URV = 4 mA). Prerequisite: URV < LRV 3) Product Configurator, order code for "Sensor range"

Vacuum resistance: 0.7 bar (10.5 psi) abs 4)

5) Vacuum resistance: 0.5 bar (7.5 psi) abs

Vacuum resistance: 0 bar (0 psi) abs

6)

Maximum turn down which can be ordered for absolute pressure and gauge pressure sensors

Devices for gauge pressure measurement

- 6 bar (90 psi), 16 bar (240 psi), 25 bar (375 psi): TD 1:1 to TD 2.5:1
- All other measuring ranges: TD 1:1 to TD 5:1

Devices for absolute pressure measurement

- 100 mbar (1.5 psi), 250 mbar (4 psi), 400 mbar (6 psi): TD 1:1
- 1 bar (15 psi): TD 1:1 to TD 2.5:1
- All other measuring ranges: TD 1:1 to TD 5:1

Metal process isolating diaphragm

Sensor	Device	Device Maximum Sensor measuring range		calibratable		OPL	Factory settings ²⁾	Option ³⁾
		lower (LRL)	upper (URL)	span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for gauge pres	ssure me	asurement	1					
400 mbar (6 psi) ⁴⁾	PMP11 PMP21	-0.4 (-6)	+0.4 (+6)	0.4 (6)	1 (15)	1.6 (24)	0 to 400 mbar (0 to 6 psi)	1F
1 bar (15 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+1 (+15)	0.4 (6)	2.7 (40.5)	4 (60)	0 to 1 bar (0 to 15 psi)	1H
2 bar (30 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+2 (+30)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 2 bar (0 to 30 psi)	1K
4 bar (60 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+4 (+60)	0.8 (12)	10.7 (160.5)	16 (240)	0 to 4 bar (0 to 60 psi)	1M
6 bar (90 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+6 (+90)	2.4 (36)	16 (240)	24 (360)	0 to 6 bar (0 to 90 psi)	1N
10 bar (150 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+10 (+150)	2 (30)	25 (375)	40 (600)	0 to 10 bar (0 to 150 psi)	1P
16 bar (240 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+16 (+240)	5 (75)	25 (375)	64 (960)	0 to 16 bar (0 to 240 psi)	1Q
25 bar (375 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+25 (+375)	5 (75)	25 (375)	100 (1500)	0 to 25 bar (0 to 375 psi)	1R
40 bar (600 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+40 (+600)	8 (120)	100 (1500)	160 (2400)	0 to 40 bar (0 to 600 psi)	1S
100 bar (1500 psi) ⁴⁾	PMP21	-1 (-15)	+100 (+1500)	20 (300)	100 (1500)	160 (2400)	0 to 100 bar (0 to 1500 psi)	1U
400 bar (6000 psi) ⁴⁾	PMP21	-1 (-15)	+400 (+6000)	80 (1200)	400 (6000)	600 (9000)	0 to 400 bar (0 to 6 000 psi)	1W
Devices for absolute p	oressure r	neasurement						
400 mbar (6 psi) ⁴⁾	PMP21	0 (0)	0.4 (+6)	0.4 (6)	1 (15)	1.6 (24)	0 to 400 mbar (0 to 6 psi)	2F
1 bar (15 psi) ⁴⁾	PMP21	0 (0)	1 (+15)	0.4 (6)	2.7 (40.5)	4 (60)	0 to 1 bar (0 to 15 psi)	2H
2 bar (30 psi) ⁴⁾	PMP21	0 (0)	2 (+30)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 2 bar (0 to 30 psi)	2K
4 bar (60 psi) ⁴⁾	PMP21	0 (0)	4 (+60)	0.8 (12)	10.7 (160.5)	16 (240)	0 to 4 bar (0 to 60 psi)	2M
10 bar (150 psi) ⁴⁾	PMP21	0 (0)	10 (+150)	2 (30)	25 (375)	40 (600)	0 to 10 bar (0 to 150 psi)	2P
40 bar (600 psi) ⁴⁾	PMP21	0 (0)	+40 (+600)	8 (120)	100 (1500)	160 (2400)	0 to 40 bar (0 to 600 psi)	2S
100 bar (1500 psi) ⁴⁾	PMP21	0 (0)	+100 (+1500)	20 (300)	100 (1500)	160 (2400)	0 to 100 bar (0 to 1 500 psi)	2U
400 bar (6000 psi) $^{4)}$	PMP21	0 (0)	+400 (+6000)	80 (1200)	400 (6000)	600 (9000)	0 to 400 bar (0 to 6 000 psi)	2W

1)

Highest turn down that can be set at the factory: 5:1. The turn down is preset and cannot be changed. Other measuring ranges (e.g. -1 to +5 bar (-15 to 75 psi)) can be ordered with customer-specific settings (see the Product Configurator, order code for "Calibration; Unit" option "J"). It is possible to invert the output signal (LRV = 20 mA; URV = 4 mA). Prerequisite: URV < LRV 2) Product Configurator, order code for "Sensor range" 3)

Vacuum resistance: 0.01 bar (0.145 psi) abs 4)

Maximum turn down which can be ordered	for absolute pressure and gauge pressure sensors
maximum tant down which can be ordered	for absolute pressure and gauge pressure sensors

Device	Range	400 mbar (6 psi)	1 bar (15 psi) 6 bar (90 psi) 16 bar (240 psi)	2 bar (30 psi) 4 bar (60 psi) 10 bar (150 psi) 25 to 400 bar (375 to 6000 psi)
PMP11	0.5%	TD 1:1	TD 1:1 to TD 2.5:1	TD 1:1 to TD 5:1
PMP21	0.3%	TD 1:1	TD 1:1 to TD 2.5:1	TD 1:1 to TD 5:1

	output							
Output signal	Description		Option ¹⁾					
	4 to 20 mA (2-wire)		1					
	PMC11: 0 to 10 V or PMP11: 0 to 10 V or		2					
	1) Product Configurator, order code for "Output"							
ignal range 4 to 20 mA	3.8 mA to 20.5 mA	3.8 mA to 20.5 mA						
oad (for 4 to 20 mA evices)		ee sufficient terminal voltage in two-wire devices, a m stance) must not be exceeded, depending on the suppl						
	$\frac{R_{Lmax}}{[\Omega]} 1068 \\ 614 \\ 10 \\ 20 \\ 30 \\ U_{B}} 2 \rightarrow R_{Lmax} \leq \frac{U_{B} - 6.5V}{22mA}$ $\frac{1}{I} Power supply 10 to 30 V DC$							
oad resistance (for 0 to 10 V evices)	The load resistance	e must be $\geq 5 [k\Omega]$.						
ignal on alarm 4 to 20 mA	The response of th	e output to error is regulated in accordance with NAM	UR NE43.					
5	Factory setting MA							
	alarm current							
	Device	Description	Option					
	PMC21 PMP21	Adjusted min. alarm current	IA 1)					
	1) Product Configurator order code for "Service"							
ead time, time constant	Presentation of the dead time and the time constant:							
		$ \begin{array}{c} I \\ 100 \% \\ 90 \% \\ 63 \% \\ \hline t_1 \\ t_2 \\ t_3 \\ \hline t_3 \\ \hline \end{array} $	t 40019					

Output

Dynamic behavior

Analog electronics

Dead time (t ₁) [ms]	Time constant (T63), t ₂ [ms]	Time constant (T90), t ₃ [ms]	
6 ms	10 ms	15 ms	


Power supply

WARNING


Limitation of electrical safety due to incorrect connection!

- ► In accordance with IEC/EN61010 a separate circuit breaker must be provided for the device .
- When using the measuring device in hazardous areas, installation must comply with the corresponding national standards and regulations and the Safety Instructions or Installation or Control Drawings.
- All explosion protection data are given in separate documentation which is available upon request. The Ex documentation is supplied as standard with all devices approved for use in explosion hazardous areas.
- Protective circuits against reverse polarity, HF influences and overvoltage peaks are integrated.
- ► The device must be operated with a 500 mA fine-wire fuse (slow-blow).

Terminal assignment

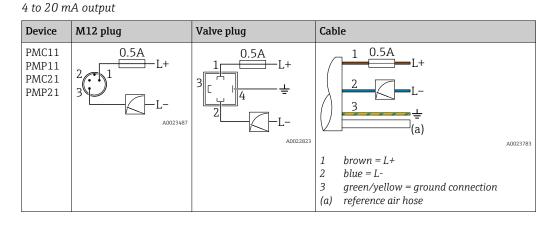

0 to 10 V output

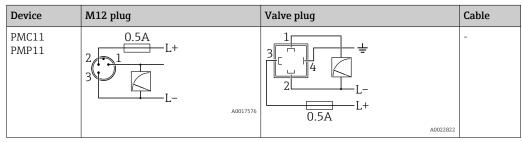

Supply voltage	Electronic version	Device	Supply voltage
	4 to 20 mA output	PMC11 PMP11 PMC21 PMP21	10 to 30 V DC
	0 to 10 V output	PMC11 PMP11	12 to 30 V DC

Current consumption and alarm signal	Number of wires	Device	Normal operation	Alarm signal ¹⁾
	2	PMC11 PMP11 PMC21 PMP21	≤ 26 mA	> 21 mA
	3	PMC11 PMP11	< 12 mA	11 V

1) For MAX alarm (factory setting)

Power supply fault	 Behavior in the event of overvoltage (>30 V): The device works continuously up to 34 V DC without damage. If the supply voltage is exceeded, the specified characteristics are no longer guaranteed. Behavior in the event of undervoltage: If the supply voltage falls below the minimum value, the device switches off in a defined manner (status same as for no power supply). 						
Electrical connection	Degree o	f protection					
	Device	Connection	Climate class	Option ¹⁾			
	PMP21 PMP21	Cable5 m (16 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	A			
	PMP21 PMP21	Cable10 m (33 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	В			
	PMP21 PMP21	Cable25 m (82 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	С			
	PMC11 M12 plug PMP11		IP65 NEMA type 4X enclosure	L			
	PMC21 PMP21	M12 plug	IP65/67 NEMA type 4X enclosure	М			
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO4400 M16	IP65 NEMA type 4X enclosure	U			
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO4400 NPT ½	IP65 NEMA type 4X enclosure	V			
	 Product Configurator, order code for "Electrical connection" IP 68 (1.83m H2O for 24 h) 						
Cable specification	For valve plug: < 1.5 mm ² (16 AWG) and Ø3.5 to 6.5 mm (0.14 to 0.26 in)						
Residual ripple	The device operates within the reference accuracy up to ± 5 % of the residual ripple of the supply voltage, within the permitted voltage range.						
Influence of power supply	≤0.005 %	o of the URL/1 V					
Overvoltage protection	Neverthe	The device does not contain any special elements to protect against overvoltage ("wire to ground"). Nevertheless the requirements of the applicable EMC standard EN 61000-4-5 (testing voltage 1kV EMC wire/ground) are met.					

Performance characteristics of ceramic process isolating diaphragm

Reference operating conditions	 As per IEC 60770 Ambient temperature T_A = constant, in the range of:+21 to +33 °C (+70 to +91 °F) Humidity φ = constant, in the range of 5 to 80 % rH Ambient pressure p_A = constant, in the range of:860 to 1060 mbar (12.47 to 15.37 psi) Position of measuring cell = constant, in range: horizontal ±1° (see also "Influence of the installation position" section → 🗎 22) Zero based span Material of process isolating diaphragm: Al₂O₃ (aluminum-oxide ceramic, Ceraphire[®]) Supply voltage: 24 V DC ±3 V DC Load: 320 Ω (at 4 to 20 mA output) 						
Measuring uncertainty for small absolute pressure measuring ranges	 in range 1 to 	extended uncertainty o 30 mbar (0.0145 to (mbar (0.0145 psi): 1	0.435 psi): 0.4 % c		ed by our standards is:		
Influence of the installation position	→ 🗎 22						
Resolution	Current output						
Reference accuracy	The reference accuracy contains the non-linearity [DIN EN 61298-2 3.11] including the pressure hysteresis [DIN EN 61298-23.13] and non-repeatability [DIN EN 61298-2 3.11] in accordance with the limit point method as per [DIN EN 60770].						
	Device	% of the calibrated sp	% of the calibrated span to the maximum turn down				
		Reference accuracy	Non-lin	nearity ¹⁾	Non-repeatability		
	PMC11 ²⁾	±0.5	±0.1		±0.1		
	PMC21 ±0.3		±0.1		±0.1		
	maximum 2) For device 0.03 V.	n turn down.	a non-linearity of up	-	the calibrated span up to the		
	Measuring ran	iges	Turn down	Device	% of URL		
	100 mbar (1.5 j		1:1 to TD 5:1	PMC12	1 ±0.5		
	40 bar (600 psi	.)		PMC2	1 ±0.3 ¹⁾		
	heat effec zero point	ets on the initial reference t or the output span is po	e conditions, an addi ssible.	itional deviation of r	llowing applies: In the event of nax. 0.3 mbar (4.5 psi) from the		
output and the output span			+85 to +100 °C (+185 to +212 °F)				
	% of URL for TD		1.1				
	<1 hon /15 m-1		1:1	<1.2			
	<1 bar (15 psi) ≥ 1 bar (15 psi)	<1	1:1	<1.2			

Long-term stability	1 year	8 years			
	% of URL				
	±0.2	±0.4	±0.45		

Switch-on time

 \leq 2 s (For small measuring ranges, pay attention to the thermal compensation effects.)

Performance characteristics of metallic process isolating diaphragm

Reference operating conditions	 As per IEC 60770 Ambient temperature T_A = constant, in the range of:+21 to +33 °C (+70 to +91 °F) Humidity φ = constant, in the range of 5 to 80 % rH Ambient pressure p_A = constant, in the range of:860 to 1060 mbar (12.47 to 15.37 psi) Position of measuring cell = constant, in range: horizontal ±1° (see also "Influence of the installation position" section → 22) Zero based span Process isolating diaphragm material: AISI 316L (1.4435) Filling oil: NSF-H1 synthetic oil in accordance with FDA 21 CFR 178.3570 Supply voltage: 24 V DC ±3 V DC Load: 320 Ω (at 4 to 20 mA output) 							
Measuring uncertainty for small absolute pressure measuring ranges	The smallest e • in range 1 to • in range < 1	30 n	nbar (0.0145	to 0.435 psi): (0.4 % of re		ered by our standards is:	
Influence of the installation position	→ 🖺 22							
Resolution	Current output	: min	. 1.6 μA					
Reference accuracy	The reference accuracy contains the non-linearity [DIN EN 61298-2 3.11] including hysteresis [DIN EN 61298-23.13] and non-repeatability [DIN EN 61298-2 3.1 the limit point method as per [DIN EN 60770].							
	Device % of the calibrated span to the maximum turn down							
		Ref	erence accura	cy	Non-linea	rity	Non-repeatability	
	PMP11 ¹⁾	±0.	5		±0.1		±0.1	
	PMP21	±0.	3		±0.1		±0.1	
	1) For device 0.015 V. Overview of the		-		ty of up to r	nax. 0.3 V ca	n occur for signal values below	
Thermal change of the zero output and the output span	Measuring cell		–20 to +85 °C	· · · · · · · · · · · · · · · · · · ·			-40 °C (-4 to -40 °F) +100 °C (+185 to +212 °F)	
			% of the calibrated span for TD 1:1					
	<1 bar (15 psi)		<1		<1.2			
	≥ 1 bar (15 psi)		<0.8			<1		
Long-term stability	1 year		5	years		8 y	ears	
				%	of URL			
	±0.2		±(0.4		±0.	45	
Switch-on time	≤2 s							

Installation conditions	 No moisture may enter the housing when installing or operating the device, or when establishing the electrical connection. Point the cable and connector downwards where possible to prevent moisture from entering (e.g. rain or condensation water). 				
Influence of the installation position	Any orientation is possible. However, the orientation may cause a zero point shift i.e. the measured value does not show zero when the vessel is empty or partially full.				

Installation


Туре	Process isolating diaphragm axis is horizontal (A)	Process isolating diaphragm pointing upwards (B)	Process isolating diaphragm pointing downwards (C)
PMP11 PMP21	Calibration position, no effect	Up to +4 mbar (+0.058 psi)	Up to -4 mbar (-0.058 psi)
PMC11, PMC21 < 1 bar (15 psi)	Calibration position, no effect	Up to +0.3 mbar (+0.0044 psi)	Up to -0.3 mbar (-0.0044 psi)
PMC11, PMC21 ≥1 bar (15 psi)	Calibration position, no effect	Up to +3 mbar (+0.0435 psi)	Up to -3 mbar (-0.0435 psi)

Mounting location

Pressure measurement

Pressure measurement in gases

Mount the device with shutoff device above the tapping point so that any condensate can flow into the process.

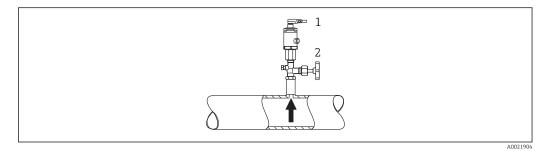

1 Device


2 Shutoff device

Pressure measurement in vapors

For pressure measurement in vapors, use a siphon. The siphon reduces the temperature to almost ambient temperature. Mount the device with a shutoff device at the same height as the tapping point.

Advantage: only minor/negligible heat effects on the device.


Note the max. permitted ambient temperature of the transmitter!

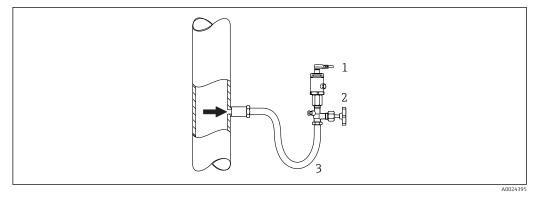

- 1 Device
- 2 Shutoff device
- 3 Siphon

Pressure measurement in liquids

Mount the device with a shutoff device at the same height as the tapping point.




1 Device

2 Shutoff device

Level measurement

- Always install the device below the lowest measuring point.
- Do not install the device at the following positions:
 - In the filling curtain
 - In the tank outlet
 - In the suction area of a pump
 - Or at a point in the tank which could be affected by pressure pulses from the agitator.

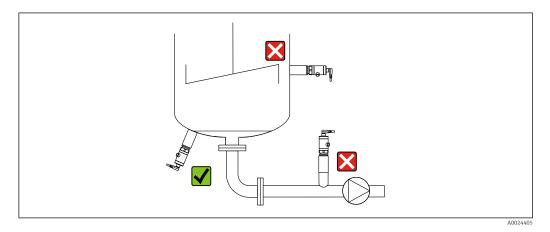

Mounting instructions for oxygen applications

Oxygen and other gases can react explosively to oils, grease and plastics, such that, among other things, the following precautions must be taken:

- All components of the system, such as measuring devices, must be cleaned in accordance with the BAM requirements.
- Dependent on the materials used, a certain maximum temperature and a maximum pressure for oxygen applications must not be exceeded.
- The following table lists devices (devices only, not accessories or enclosed accessories), which are suitable for gaseous oxygen applications.

Device	p _{max} for oxygen applications	T _{max} for oxygen applications	Option ¹⁾
PMC21	40 bar (600 psi)	–10 to +60 °C (+14 to +140 °F)	HB

1) Product Configurator, order code for "Service"

Environment

Ambient temperature range	Device	Ambient temperature range ¹⁾
	PMC11 PMP11	-40 to +70 °C (-40 to +158 °F)
	PMC21 PMP21	-40 to +85 °C (-40 to +185 °F)
	PMC21 PMP21	Devices for hazardous areas: -40 to +70 °C (-40 to +158 °F)

Exception: the following cable is designed for an operating temperature range of -25 to +70 °C (-13 to +158 °F): Product Configurator order code for "Accessory enclosed", option "RZ". 1)

Storage temperature range

-40 to +85 °C (-40 to +185 °F)

Climate class	Device	Climate class	Note
	PMC11 PMP11 PMC21 PMP21	Class 3K5	Air temperature: -5 to +45 °C (+23 to +113 °F), relative humidity: 4 to 95 % satisfied according to IEC 721-3-3 (condensation not possible)

Degree of protection	Device	Connection	Climate class	Option 1)
	PMP21 PMP21	Cable5 m (16 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	A
	PMP21 PMP21	Cable10 m (33 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	В
	PMP21 PMP21	Cable25 m (82 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	С
	PMC11 PMP11	M12 plug	IP65 NEMA type 4X enclosure	L
	PMC21 PMP21	M12 plug	IP65/67 NEMA type 4X enclosure	М
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO4400 M16	IP65 NEMA type 4X enclosure	U
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO4400 NPT ½	IP65 NEMA type 4X enclosure	V

de for "Electrical connection 2)

IP 68 (1.83m H2O for 24 h)

Vibration resistance	Test standard	Vibration resistance		
	IEC 60068-2-64:2008	Guaranteed for 5 to 2000Hz: 0.05g²/Hz		
compatibility	 Interference emission as per EN 61 Interference immunity as per EN 6 NAMUR recommendation EMC (N 	1326-1 (industrial environment)		

• Maximum deviation: 1.5% for TD 1:1

For more details, refer to the Declaration of Conformity.

Process

Process temperature range for devices with ceramic process isolating diaphragm

Device	Process temperature range
PMC11	–25 to +85 °C (–13 to +185 °F)
PMC21	-25 to +100 °C (-13 to +212 °F)
PMC21 for oxygen applications	-10 to +60 °C (+14 to +140 °F)

- For saturated steam applications, use a device with a metal process isolating diaphragm, or provide a siphon for temperature isolation when installing.
- Pay attention to the process temperature range of the seal. See also the following table.

Seal	Notes	otes Process temperature range			
FKM	-	-20 to +100 °C (-4 to +212 °F)	A ¹⁾		
FKM	Cleaned for oxygen service	-10 to +60 °C (+14 to +140 °F)	A $^{1)}$ and HB $^{2)}$		
EPDM 70	-	-25 to +100 °C (-13 to +212 °F)	J ¹⁾		

1) Product Configurator, order code for "Seal"

2) Product Configurator, order code for "Service"

Applications with changes in temperature

Frequent extreme changes in temperatures can temporarily cause measuring errors. Temperature compensation takes place after a few minutes. Internal temperature compensation is faster the smaller the change in temperature and the longer the time interval.

For further information please contact your local Endress+Hauser Sales Center.

Process temperature range for devices with metallic	Device	Process temperature range
process isolating diaphragm	PMP11	–25 to +85 °C (–13 to +185 °F)
	PMP21	-40 to +100 °C (-40 to +212 °F)

Applications with changes in temperature

Frequent extreme changes in temperatures can temporarily cause measuring errors. Internal temperature compensation is faster the smaller the change in temperature and the longer the time interval.

For further information please contact your local Endress+Hauser Sales Center.

Pressure specifications	A WARNING
	The maximum pressure for the measuring device depends on the lowest-rated element with
	regard to pressure.
	 For pressure specifications, see the "Measuring range" section and the "Mechanical construction" section.
	The Pressure Equipment Directive (2014/68/EU) uses the abbreviation "PS". The abbreviation "PS" corresponds to the MWP (maximum working pressure) of the measuring device.
	MWP (maximum working pressure): The MWP (maximum working pressure) is specified on the nameplate. This value is based on a reference temperature of +20 °C (+68 °F) and may be applied to the device for an unlimited period of time. Observe the temperature dependency of the MWP.
	 OPL (over pressure limit): The test pressure corresponds to the over pressure limit of the sensor and may only be applied temporarily to ensure that the measurement is within the specifications and no permanent damage develops. In the case of sensor range and process connections where the over pressure limit (OPL) of the process connection is smaller than the nominal value of the sensor, the device is set at the factory, at the very maximum, to the OPL value of the process connection. If you want to use the entire sensor range, select a process connection with a higher OPL value.
	 Oxygen applications: In oxygen applications, the values for "p_{max} and T_{max} for oxygen applications may not be exceeded.
	Devices with ceramic process isolating diaphragm: avoid steam hammering! Steam hammering can cause zero point drifts. Recommendation: Residue (water droplets or condensation) may remain on the process isolating diaphragm following CIP cleaning and can result in local steam hammering the next time steam cleaning takes place. In practice, drying the process isolating diaphragm (e.g. by blowing) has proved to prevent steam hammering.

Mechanical construction


Design, dimensions

Device height


The device height is calculated from

- the height of the electrical connection
- the height of the housing and
- the height of the individual process connection.

The individual heights of the components are listed in the following sections. To calculate the device height simply add up the individual heights of the components. Where applicable also take into consideration the installation distance (space that is used to install the device). You can use the following table for this purpose:

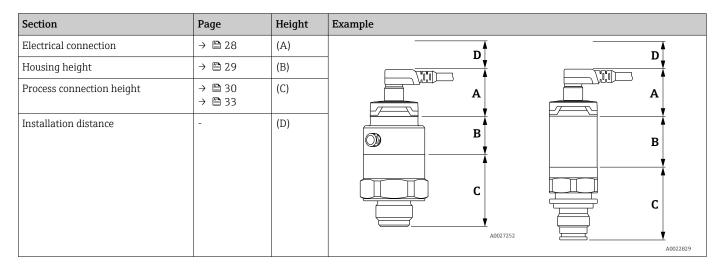

Electrical connection

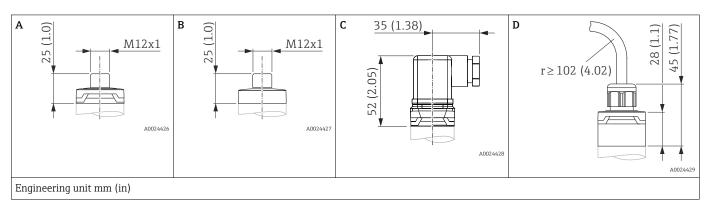



Position	Description	Material	Weight kg (lbs)	Device	Option ¹⁾
А	M12 plug IP65 (Additional dimensions $\rightarrow \square$ 45)	Housing cap made of plastic	0.012 (0.03)	PMC11 PMP11	L
A	M12 plug IP65/67 (Additional dimensions → 🗎 45)	Housing cap made of plastic	0.012 (0.03)	PMC21 PMP21	M Plug connector with cable can be ordered as an accessory → 🗎 45
В	M12 plug IP66/67	Housing cap made of metal	0.030 (0.07)	PMC21 PMP21	In the case of Ex ec type of protection, the housing cap is made of metal.
С	M16 valve plug	Plastic PPSU	0.060 (0.14)	PMC11 PMP11 PMC21 PMP21	U

Position	Description	Material	Weight kg (lbs)	Device	Option ¹⁾
С	NPT ½ valve plug	Plastic PPSU	0.060 (0.14)	PMC11 PMP11 PMC21 PMP21	V
D	Cable5 m (16 ft)	PUR (UL94V0)	0.280 (0.62)	PMC21 PMP21	A
D	Cable10 m (33 ft)	PUR (UL94V0)	0.570 (1.26)	PMC21 PMP21	В
D	Cable25 m (82 ft)	PUR (UL94V0)	1.400 (3.09)	PMC21 PMP21	C

1) Product Configurator, order code for "Electrical connection"


Housing

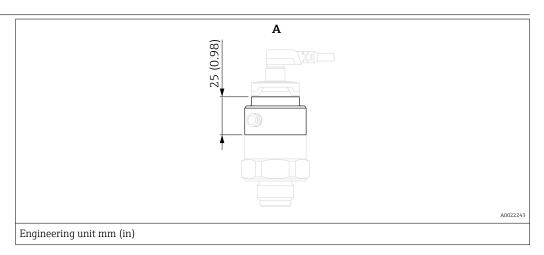

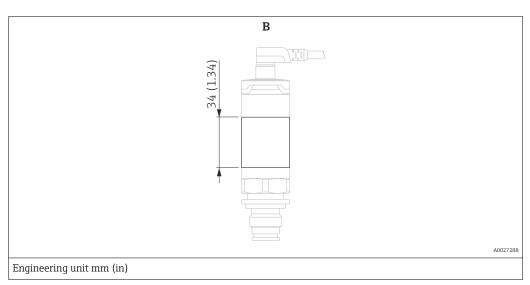


Item	Device	Material	Weight kg (lbs)
A	PMC11 PMC21	Stainless steel 316L	0.150 (0.33)
В	PMP11 PMP21	Stainless steel 316L	0.090 (0.20)


Process connections with internal, ceramic process isolating diaphragm

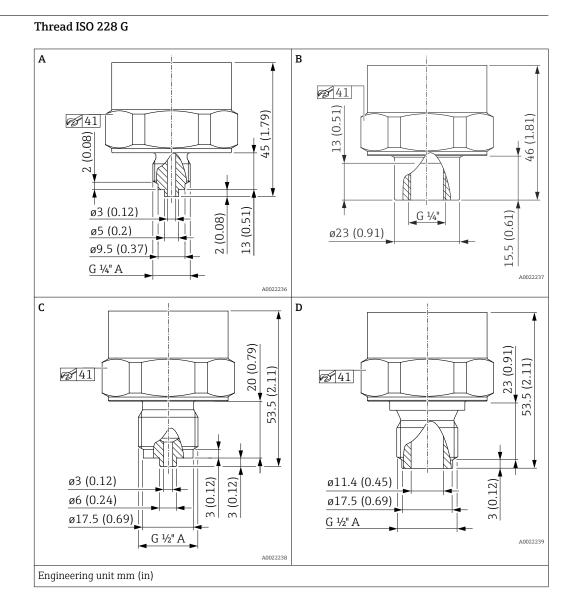


Device	Item	Description	Material	Weight	Option ¹⁾
				kg (lbs)	
PMC11PMC21	A	Thread ISO 228 G ¼" A, EN 837	316L	0.160 (0.35)	WTJ
PMC11PMC21	В	Thread ISO 228 G ¼" (female)	316L	0.180 (0.40)	WAJ
PMC11PMC21	С	Thread ISO 228 G ½" A, EN 837	316L	0.180 (0.40)	WBJ
PMC11PMC21	D	Thread ISO 228 G ½" A, bore11.4 mm (0.45 in)	316L	0.180 (0.40)	WWJ



Thread ASME

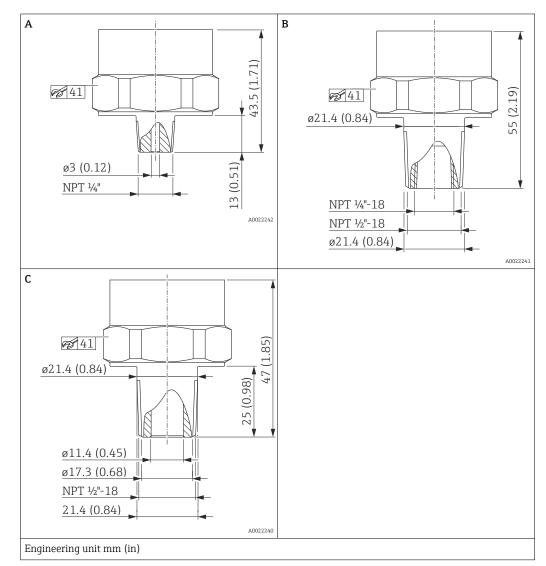


Device	Item	Description	Material Weight		Approval	Option ¹⁾
				kg (lbs)		
PMC11PMC21	A	ASME ¼" MNPT, bore3 mm (0.12 in)	316L	0.160 (0.35)	CRN	VUJ
PMC11PMC21	В	ASME ½" MNPT, ¼" FNPT (female)	316L	0.190 (0.42)	CRN	VXJ
PMC11PMC21	С	ASME ½" MNPT, bore11.4 mm (0.45 in)	316L	0.190 (0.42)	CRN	VWJ

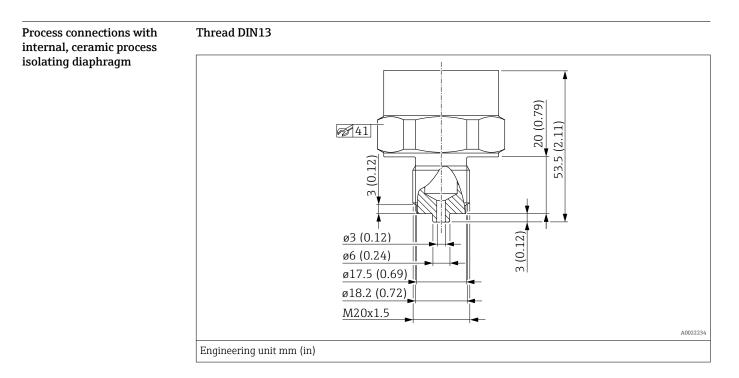


Device	Description Ma		Weight	Option ¹⁾
			kg (lbs)	
PMC11PMC21	DIN 13 M20 x 1.5, EN 837, bore 3 mm (0.12 in)	316L	0.180 (0.40)	X4J

1) Product Configurator, order code for "Process connection"


Process connections with internal, ceramic process isolating diaphragm

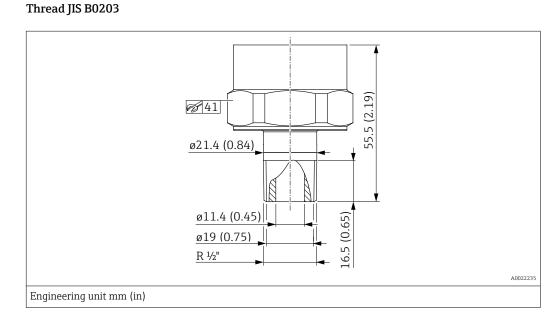


Device	Description	Material	Weight	Option ¹⁾
			kg (lbs)	
PMC21	JIS B0203 R 1/2 (male)	316L	0.180 (0.40)	ZJJ



Thread ISO 228 G

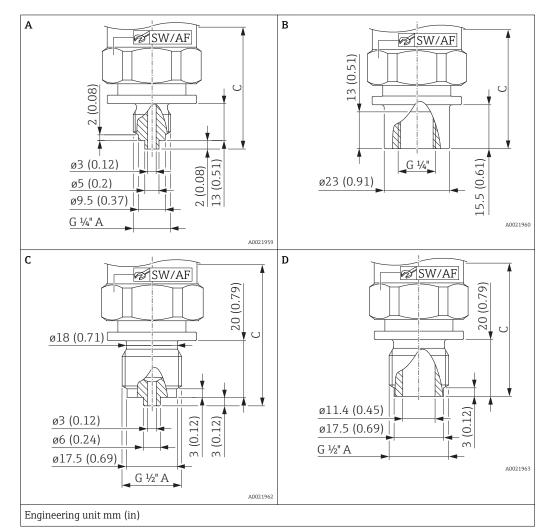


Position	Device	Description	Material	Nominal value to 100 bar (1500 psi)			Nominal valu 400 bar (600	Option ¹⁾		
				Weight	Height C	SW/	Weight	Height C	SW/	
				kg (lbs)		AF	kg (lbs)		AF	
A	PMP11 PMP21	Thread ISO 228 G ¼" A, EN 837	316L	0.200 (0.44)	57 (2.24)	32	0.240 (0.53)	69 (2.72)	27	WTJ
В	PMP11 PMP21	Thread ISO 228 G ¼" (female)	316L	0.220 (0.49)	57 (2.24)	32	0.260 (0.57)	69 (2.72)	27	WAJ
С	PMP11 PMP21	Thread ISO 228 G ½" A, EN 837	316L	0.220 (0.49)	65 (2.56)	32	0.270 (0.60)	77 (3.03)	27	WBJ
D	PMP11 PMP21	Thread ISO 228 G ½" A, bore11.4 mm (0.45 in)	316L	0.220 (0.49)	62 (2.44)	32	0.260 (0.57)	74 (2.91)	27	WWJ

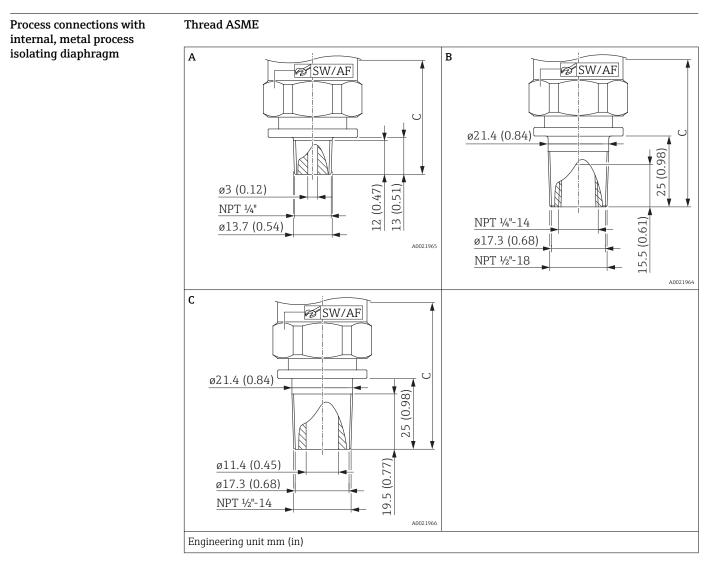

Position	Device	Description	Material	Nominal value to 100 bar (1500 psi)		Nominal valu 400 bar (600		Approval	Option ¹⁾				
				Weight	Height C	AF		-	Weight	Height C	SW/		
				kg (lbs)			kg (lbs)]	AF				
А	PMP11 PMP21	ASME ¼" MNPT, bore3 mm (0.12 in)	316L	0.200 (0.44)	55 (2.17)	32	0.240 (0.53)	67 (2.64)	27	CRN	VUJ		
В	PMP11 PMP21	ASME ½" MNPT, ¼" FNPT (female)	316L	0.230 (0.51)	67 (2.64)	32	0.260 (0.57)	79 (3.11)	27	CRN	VXJ		
С	PMP11 PMP21	ASME ¼" MNPT, bore11.4 mm (0.45 in)	316L	0.230 (0.51)	67 (2.67)	32	0.270 (0.60)	79 (3.11)	27	CRN	VWJ		

Process connections with internal, metal process isolating diaphragm


Thread DIN13

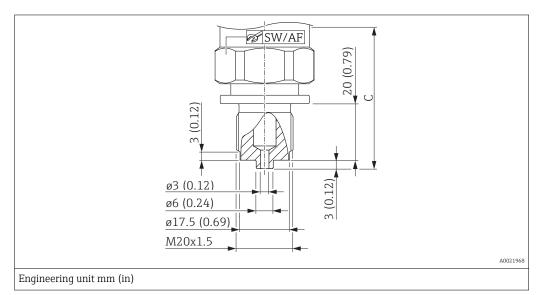

Description	Device		Nominal value to 100 bar (1500 psi)		Nominal value 400 bar (6 000 psi)			Option ¹⁾	
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)		AF	kg (lbs)		AF	
DIN 13 M20 x 1.5, EN 837, bore 3 mm (0.12 in)	PMP11 PMP21	316L	0.220 (0.49)	65 (2.56)	32	0.260 (0.57)	77 (3.03)	27	X4J

1) Product Configurator, order code for "Process connection"


Process connections with internal, metal process isolating diaphragm

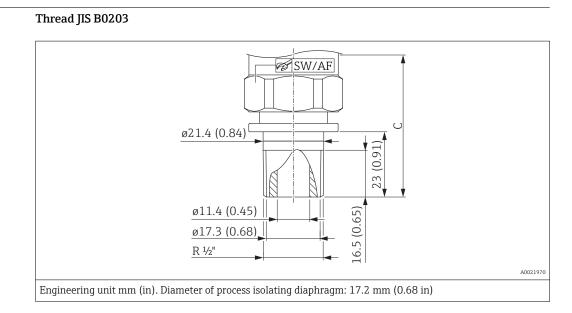

Description	Device	Material	Nominal value to 100 bar (1500 psi)			Nominal value 400 bar (6000 p	Option ¹⁾		
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)		AF	kg (lbs)		AF	
JIS B0203 R ½" (male)	PMP21	316L	0.230 (0.51)	65 (2.56)	32	0.260 (0.57)	77 (3.03)	27	ZJJ


Process connections with flush-mounted, metal process isolating diaphragm

Thread ISO 228 G

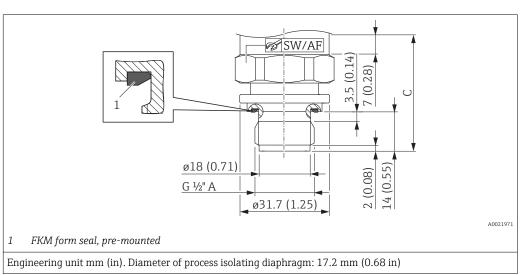

Device	Description	Material	Nominal value to 100 bar (1500 psi)			Nominal value 400 bar (6 000 p	Option ¹⁾		
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)	1	AF	kg (lbs)		AF	
PMP11 PMP21	Thread ISO 228 G ½" A DIN3852	316L	0.140 (0.31)	41 (1.61)	32	0.120 (0.26)	35 (1.38)	32	WJJ

1) Product Configurator, order code for "Process connection"

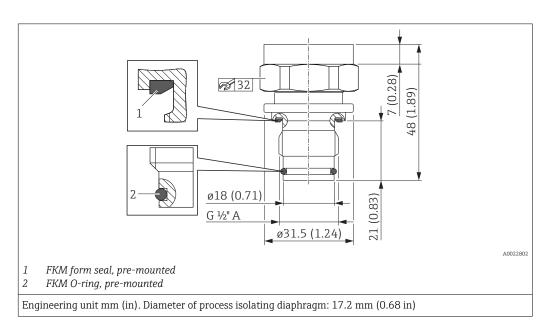

Device ¹⁾	Description		Weight kg (lbs)	Option ²⁾
PMP11 PMP21	Thread ISO 228 G ½" A O-ring seal, flush-mounted	316L	0.150 (0.33)	WUJ

1) Suitable for weld-in adapter 52002643 and 52010172

Materials in contact with	NOTICE
process	• Device components in contact with the process are listed in the "Mechanical construction" and
	"Ordering information" sections.

TSE Certificate of Suitability

The following applies to all device components in contact with the process:

- They do not contain any materials derived from animals.
- No additives or operating materials derived from animals are used in production or processing.

Process connections

Endress+Hauser supplies a threaded connection made of stainless steel in accordance with AISI 316L (DIN/ EN material number 1.4404 or 1.4435). With regard to their stability-temperature property, the materials 1.4404 and 1.4435 are grouped together under 13E0 in EN 1092-1: 2001 Tab. 18. The chemical composition of the two materials can be identical.


Process isolating diaphragm

Description	Material
Ceramic process isolating diaphragm	Al_2O_3 aluminum-oxide ceramic, Ceraphire [®] FDA, ultrapure 99.9 % (see also www.endress.com/ceraphire) The US Food & Drug Administration (FDA) has no objections to the use of ceramics made from aluminum oxide as a surface material in contact with foodstuffs. This declaration is based on the FDA certificates of our ceramic suppliers.
Metal process isolating diaphragm	AISI 316L (DIN/EN material number 1.4435)

Seals

See the specific process connection.

Materials not in contact with Housing process

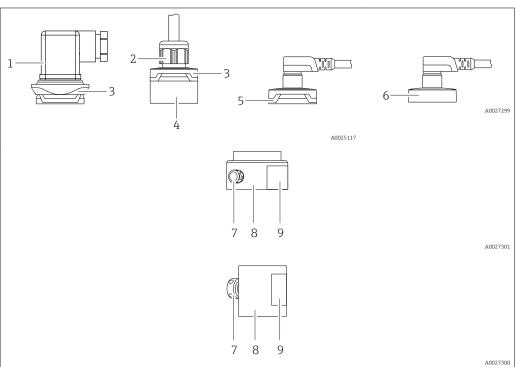

Item number	Component part	Material
1	Valve plug	Seal: NBRPlug: PAScrew: V2A
2	Cable	 Pressure screw: PVDF Seal: TPE-V Cable: PUR (UL 94 V0)
3	Design element	PBT/PC
4	Connection	PPSU
5	M12 plug	Plastic: PPSU
6	M12 plug	Metal 316L (1.4404) For Ex ec: metal housing cap
7	Pressure compensation element	PMP11: PBT/PC PMP21 standard: PBT/PC PMP21 with Ex ec approval: 1.4404
8	Housing	316L (1.4404)
9	Nameplates	Plastic foil (attached to housing) or directly lasered onto the housing

Filling oil

Device	Filling oil
PMP11 PMP21	NSF-H1 synthetic oil in accordance with FDA 21 CFR 178.3570

Cleaning

Device	Description	Option ¹⁾
PMC11	Cleaned from oil+grease	НА
PMP11	5	
PMC21		
PMP21		
PMC21	Cleaned for oxygen service	НВ

1) Product Configurator, order code for "Service"

Operability

Plug-on display PHX20 (optional) No display or other operation facility is required to operate the device. However, devices with a valve plug can be fitted with the optional local display PHX20.

Description	Option ¹⁾
Plug-on display PHX20, IP65	RU

1) Product Configurator, order code for "Accessories"

A 1-line liquid crystal display (LCD) is used. The local display shows measured values, fault messages and information messages. The device display can be turned in 90° steps. Depending on the orientation of the device, it is therefore easy to read the measured values.

Technical data

D: 1	
Display:	4-digit, red LED display
Digit height:	7.62 mm; programmable decimal point setting
Display range:	-1999 to 9999
Accuracy:	0.2% of the span ±1 digit
Electrical connection:	To transmitter with 4 to 20 mA output and elbow plug DIN 43 650, reverse polarity protection
Display power supply:	Not required, powered automatically from the power loop
Voltage drop:	\leq 5 V (corresponds to load: max. 250 Ω)
Rate of conversion:	3 measurements per second
Damping:	0.3 to 20 s (configurable)
Data backup:	Non-volatile EEPROM
Error message:	HI: overrangeLO: below range
Programming:	Via 2 keys, menu-guided, display range scaling, decimal point, damping, error message
Degree of protection:	IP 65
Influence of temperature on the display:	0.1% / 10 K
Electromagnetic compatibility (EMC):	Interference emission as per EN 50081, interference immunity as per EN 50082
Permitted current load:	Max. 60 mA
Ambient temperature:	0 to +60 °C (+32 to +140 °F)
Housing material:	Pa6 GF30 plastic, blue Front screen made from red PMMA
Order number:	52022914

Certificates and approvals

CE mark	The device meets the legal requirements of the relevant EC directives. Endress+Hauser confirms that the device has been successfully tested by applying the CE mark.				
RoHS	The measuring system complies with the substance restrictions of the Restriction on Hazardous Substances Directive 2011/65/EU (RoHS 2).				
RCM-Tick marking	The supplied product or measuring system meets the ACMA (Australian Communications and Media Authority) requirements for network integrity, interoperability, performance characteristics as well as health and safety regulations. Here, especially the regulatory arrangements for electromagnetic compatibility are met. The products are labelled with the RCM- Tick marking on the name plate.				
				A002	
EAC conformity	The PMC21, PMP21 and PMP23 devices meet the legal requirements of the applicable EAC directives. These are listed in the corresponding EAC Declaration of Conformity along with the standards applied.				
	Endress+Hauser confirms successful testing of the device by affixing to it the EAC mark.				
Approval		General Purpose			
Approval Safety Instructions (XA)	CSA C/US Safety Inst				
	CSA C/US Safety Inst	General Purpose cructions (XA) are supplied with the device			
	CSA C/US Safety Inst are an inte	General Purpose cructions (XA) are supplied with the device egral part of the Operating Instructions.	ce depending on the approval.	These instructions	
	CSA C/US Safety Inst are an inte Device	General Purpose cructions (XA) are supplied with the device egral part of the Operating Instructions.	ce depending on the approval. Documentation	These instructions	
	CSA C/US Safety Inst are an inte Device PMP21	General Purpose cructions (XA) are supplied with the device gral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb	ce depending on the approval. Documentation XA01271P	These instructions Option 1) BA	
	CSA C/US Safety Inst are an inte Device PMP21 PMC21 PMC21	General Purpose cructions (XA) are supplied with the device gral part of the Operating Instructions.	ce depending on the approval. Documentation XA01271P XA01271P	These instructions Option ¹⁾ BA BB	
	CSA C/US Safety Inst are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21	General Purpose cructions (XA) are supplied with the device gral part of the Operating Instructions.	ce depending on the approval. Documentation XA01271P XA01271P XA01533P	These instructions Option ¹⁾ BA BB BB BC	
	CSA C/US Safety Inst are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMP21 PMC21 PMC21 PMC21	General Purpose cructions (XA) are supplied with the device gral part of the Operating Instructions.	ce depending on the approval. Documentation XA01271P XA01271P XA01533P XA01321P	These instructions Option ¹⁾ BA BB BB BC FA	
	CSA C/US Safety Inst are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21	General Purpose cructions (XA) are supplied with the device gral part of the Operating Instructions.	ce depending on the approval. Documentation XA01271P XA01271P XA01533P XA01321P XA01322P	These instructions Option ¹⁾ BA BB BB BC CB CB	
	CSA C/US Safety Inst are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21	General Purpose cructions (XA) are supplied with the device egral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb ATEX II 3G Ex ec IIC T4 Gc FM IS Cl. I, Div.1 Gr. A-D T4 CSA C/US IS Cl. I Div. 1 Gr. A-D EAC Ex ia IIC T4 Ga/Gb	ce depending on the approval. Documentation XA01271P XA01271P XA01533P XA01321P XA01322P XA01540P	These instructions Option ¹⁾ BA BB BB BC CB CB CB CB	

1) Product Configurator, order code for "Approval"

The nameplate provides information on the Safety Instructions (XA) that are relevant for the device.

Marine approval (pending)	Device	Description	Option ¹⁾			
	PMC21 PMP21	DNV GL	LE			
	PMC21 PMP21	ABS	LF			
	1) Product Configurator,	order code for "Additional approval"				
Pressure Equipment Directive 2014/68/EU (PED)	Pressure equipment with allowable pressure \leq 200 bar (2 900 psi)					
	Pressure equipment (with a maximum allowable pressure PS \leq 200 bar (2900 psi)) can be classified as pressure accessories in accordance with Pressure Equipment Directive 2014/68/EU. If the maximum allowable pressure is \leq 200 bar (2900 psi) and the pressurized volume of the pressure equipment is \leq 0.1 l, the pressure equipment is subject to the Pressure Equipment Directive (cf. Pressure Equipment Directive 2014/68/EU, Article 4, point 3). The Pressure Equipment Directive only requires that the pressure equipment shall be designed and manufactured in accordance with the "sound engineering practice of a Member State".					
	Reasons:					
		rective (PED) 2014/68/EU Article 4, poin rective 2014/68/EU, Commission's Workin				
	Note:					
	for the protection of a pip	all be performed for pressure instruments be or vessel from exceeding allowable limit Directive 2014/68/EU, Article 2, point 4	s (safety accessory in accordance			
	Pressure equipment wit	h allowable pressure > 200 bar (2900 p	si)			
	Pressure equipment with allowable pressure > 200 bar (2 900 psi) Pressure equipment designated for application in every process fluid having a pressurized volume of <0.1 l and a max. allowable pressure PS > 200 bar (2 900 psi) shall satisfy the essential safety requirements set out in Annex I of the Pressure Equipment Directive 2014/68/EU. According to Article 13 pressure equipment shall be classified by category in accordance with Annex II. The conformity assessment of the pressure equipment shall be determined by the category I under consideration of the above-mentioned low pressurized volume. These devices shall be provided with CE marking.					
	Reasons:					
	 Pressure Equipment Directive 2014/68/EU, Article 13, Annex II Pressure equipment directive 2014/68/EU, Commission's Working Group "Pressure", Guideline A-05 					
	Note:					
	A partial examination shall be performed for pressure instruments that are part of safety equipment for the protection of a pipe or vessel from exceeding allowable limits (safety accessory in accordance with Pressure Equipment Directive 2014/68/EU, Article 2, point 4).					
	The following also applies	:				
		nnection and internal process isolating dia	phragm PN > 200 :			
	Suitable for stable gases in group 1, category I, module A					
Other standards and guidelines	The applicable European guidelines and standards can be found in the relevant EU Declarations of Conformity. The following were also applied:					
	DIN EN 60770 (IEC 60770):					
	Transmitters for use in industrial process control systems Part 1: Methods for performance evaluation					
	Methods for evaluating the performance of transmitters for control and regulation in industrial process control systems.					

	DIN 16086: Electrical pressure measuring instruments, pressure sensors, pressure transmitters, pressure					
	measuring instruments, concepts, specifications on data sheets					
	Procedure for writing specifications in data sheets for electrical pressure measuring instruments, pressure sensors and pressure transmitters.					
	EN 61326-X:					
	EMC product family standard for electrical equipment for measurement, control and laboratory use.					
	EN 60529:					
	Degrees of protection provided by enclosures (IP code)					
	NAMUR - User association of automation technology in p	process industries.				
	NE21 - Electromagnetic Compatibility (EMC) of Industrial Pr Equipment.	Process and Laboratory Control				
	NE43 - Standardization of the Signal Level for the Failure In	nformation of Digital Transmitters.				
	NE44 - Standardization of Status Indicators on PCT Instrume Diodes	ents with the Help of Light Emitting				
	NE53 - Software of Field Devices and Signal-processing Devi	rices with Digital Electronics				
	A CRN approval is available for some device versions. A CRN-approved process connection with a CSA approval must be ordered for a CRN-approved device. The CRN-approved devices are assigned the registration number 0F18141.5C					
CRN approval						
	CSA approval must be ordered for a CRN-approved device. T	The CRN-approved devices are assigned "Process connection" (the CRN process				
	CSA approval must be ordered for a CRN-approved device. T the registration number 0F18141.5C. Ordering information: Product Configurator, order code for "	The CRN-approved devices are assigned "Process connection" (the CRN process				
	CSA approval must be ordered for a CRN-approved device. The registration number 0F18141.5C. Ordering information: Product Configurator, order code for "connections are indicated appropriately in the "Mechanical connections are indicated appropriately indicated	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.)				
	CSA approval must be ordered for a CRN-approved device. The registration number 0F18141.5C. Ordering information: Product Configurator, order code for "connections are indicated appropriately in the "Mechanical connections are indicated appropriately in the "Mechanical connections"	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option ¹⁾				
	CSA approval must be ordered for a CRN-approved device. To the registration number 0F18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical context" Description Sensor range; %	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A				
	CSA approval must be ordered for a CRN-approved device. To the registration number OF18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical content of the "Mechanical content of the "Mechanical content of the "Sensor range; % Sensor range; mbar/bar	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B				
	CSA approval must be ordered for a CRN-approved device. To the registration number 0F18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical content of the "Mechanical content" of the "Mechanical content of the "Mechanical content" of the "Mechanical content of the "Mechanical content" of	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C				
	CSA approval must be ordered for a CRN-approved device. T the registration number OF18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical c Description Sensor range; % Sensor range; mbar/bar Sensor range; kPa/MPa Sensor range; psi	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C				
Calibration unit	CSA approval must be ordered for a CRN-approved device. To the registration number 0F18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical content of the "Mechanical content" of the "Mechanical content of the "Mecha	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C				
Calibration unit	CSA approval must be ordered for a CRN-approved device. T the registration number OF18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical c Description Sensor range; % Sensor range; mbar/bar Sensor range; kPa/MPa Sensor range; psi Customer-specific; see additional spec. 1) Product Configurator, order code for "Calibration; unit"	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C F J				
Calibration unit	CSA approval must be ordered for a CRN-approved device. T the registration number OF18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical c Description Sensor range; % Sensor range; mbar/bar Sensor range; kPa/MPa Sensor range; psi Customer-specific; see additional spec. 1) Product Configurator, order code for "Calibration; unit" Description	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C F J				
CRN approval Calibration unit Calibration Calibration Inspection certificates	CSA approval must be ordered for a CRN-approved device. T the registration number OF18141.5C. Ordering information: Product Configurator, order code for " connections are indicated appropriately in the "Mechanical c Description Sensor range; % Sensor range; mbar/bar Sensor range; kPa/MPa Sensor range; psi Customer-specific; see additional spec. 1) Product Configurator, order code for "Calibration; unit" Description 3-point certificate of calibration	The CRN-approved devices are assigned "Process connection" (the CRN process construction" section.) Option 1) A B C F J				

Ordering information

Detailed ordering information is available from the following sources:

- In the Product Configurator on the Endress+Hauser website: www.endress.com -> Click "Corporate"
 -> Select your country -> Click "Products" -> Select the product using the filters and search field ->
 Open product page -> The "Configure" button to the right of the product image opens the Product
 Configurator.
- From your Endress+Hauser Sales Center: www.addresses.endress.com
- Product Configurator the tool for individual product configuration
- Up-to-the-minute configuration data
 - Depending on the device: Direct input of measuring point-specific information such as measuring range or operating language
 - Automatic verification of exclusion criteria
 - Automatic creation of the order code and its breakdown in PDF or Excel output format
 - Ability to order directly in the Endress+Hauser Online Shop

Scope of delivery

- Measuring device
- Optional accessories
- Brief Operating Instructions
- Certificates

Accessories

Weld-in adapter

Various weld-in adapters are available for installation in vessels or pipes.

Device	Description	Option ¹⁾	Order number
PMP21	Weld-in adapter G½, 316L	QA	52002643
PMP21	Weld-in adapter G½, 316L 3.1 EN10204-3.1 material, inspection certificate	QB	52010172
PMP21	Weld-in tool adapter G½, brass	QC	52005082

1) Product Configurator, order code for "Enclosed accessories"

> If installed horizontally and weld-in adapters with a leakage hole are used, ensure that the leakage hole is pointing down. This allows leaks to be detected as quickly as possible.

Plug-on display PHX20	→ 🖺 40	40			
M12 plug connectors	Connector	Degree of protection	Material	Option ¹⁾	Order number
	M12 (self-terminated connection at M12 plug)	IP67	Union nut: Cu Sn/NiBody: PBTSeal: NBR	R1	52006263
	53 (2.09) A002475				
	M12 90 degrees with 5m (16 ft) cable	IP67	 Union nut: GD Zn/Ni Body: PUR Cable: PVC 	RZ	52010285
	87 11 240 (1.57) ▲4024476				
	M12 90 degrees (self-terminated connection at M12 plug)	IP67	 Union nut: GD Zn/Ni Body: PBT Seal: NBR 	RM	71114212
	28 (1.1) 50 50 50 1 20 (0.79) A0024478				

Product Configurator, order code for "Enclosed accessories" 1)

Field of Activities	Pressure measurement, powerful instruments for process pressure, differential pressure, level and flow:	
	FA00004P/00/EN	
Technical Information	 TI00241F/00/EN: EMC test procedures TI00426F/00/EN: Weld-in adapters, process adapters and flanges (overview) 	
Operating Instructions	BA01271P/00/EN	
Brief Operating Instructions	Dperating Instructions KA01164P/00/EN	
Safety Instructions (XA)	Safety Instructions (XA) are supplied with the device depending on the approval. These instructions are an integral part of the Operating Instructions.	

Documentation

Device	Directive	Documentation	Option 1)
PMP21	ATEX II 1/2G Ex ia IIC T4 Ga/Gb	XA01271P	BA
PMC21	ATEX II 2G Ex ia IIC T4 Gb	XA01271P	BB
PMC21 PMP21	ATEX II 3G Ex ec IIC T4 Gc	XA01533P	BC
PMC21 PMP21	FM IS Cl. I, Div.1 Gr. A-D T4	XA01321P	FA
PMC21 PMP21	CSA C/US IS Cl. I Div. 1 Gr. A-D	XA01322P	CB
PMC21 PMP21	EAC Ex ia IIC T4 Ga/Gb	XA01540P	GA
PMC21 PMP21	IEC Ex ia IIC T4 Ga/Gb	XA01271P	IA
PMC21 PMP21	NEPSI Ex ia IIC T4	XA01363P	NA
PMC21 PMP21	TIIS Ex ia IIC T4	In preparation	ТА

1) Product Configurator, order code for "Approval"

1

The nameplate provides information on the Safety Instructions (XA) that are relevant for the device.



www.addresses.endress.com

